

THERMAL ELECTRICAL INSPECTION

SAMPLE REPORT

6/18/2026



RETROFIT
ELECTRIC

PREPARED FOR

Prepared By

Jake Andrist

jandrist@retrofitcompanies.com

(507) 414-5087



ABOUT US

Retrofit Electric, a division of The Retrofit Companies, Inc., is a full-service Commercial and Industrial Electrical Contractor supporting the St. Paul/Minneapolis metro area and Southern Minnesota. The Retrofit Companies, Inc. is a woman-owned small business (WOSB) and is certified through the Women's Business Enterprise National Council (WBENC).

Since our inception in 1992, we've proudly kept the focus on exceeding our clients' expectations regarding quality, safety and timeliness. We look forward to partnering with your business for your electrical needs.



Wendy Fry
President & Owner



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 1 / 271

INSPECTION REPORT

Inspection Date: 5/14/2026

Inspection location:

[company name]

[company address]

Prepared for:

Inspection company:

Retrofit Electric, a division of The Retrofit Companies, Inc.

1010 Hoffman Drive, Suite A
Owatonna, MN 55060

(507) 455-2181

Thermographer: Gary Johnson

Inspecting Manager:

Jake Andrist
jandrist@retrofitcompanies.com
(507) 414-5087



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 2 / 271

TABLE OF CONTENTS

1. SUMMARY OF INSPECTION	3
2. SUMMARY OF EXISTING EQUIPMENT	4
3. PRESENTATION OF ANOMALIES OBSERVED WITH THERMOGRAM	11
4. THERMOGRAPHER CERTIFICATION	271
5. INFRARED THERMAL CAMERA CALIBRATION CERTIFICATE	273



Summary of Inspection

In May 2026, a comprehensive infrared thermal electrical inspection was performed at [customer name] to satisfy NFPA 70B requirements and insurance risk-mitigation recommendations.

The survey was conducted by Gary Johnson, a Master Electrician and Level-1 Certified Thermographer from Retrofit Electric, utilizing a high-resolution FLIR E96 thermal, infrared camera. The inspection covered a scope of (106) total electrical assets/inspection points, as defined by [customer contact]

The overall findings indicate that the facility and its equipment are clean and exceptionally well-maintained. No immediate concerns or urgent recommendations were identified during this survey.

Asset Breakdown & Status

The (106) inspected assets were categorized into the following statuses based on the thermographic findings:

Status "Good" - (69) Operating within normal thermal parameters; fully compliant with standard operating conditions.

Status "Noted Recommendations" - (20) Minor preventive maintenance suggested; no immediate operational risk.

Status "Not Inspected" - (17) De-energized, inaccessible, or unsafe to open at the time of the survey.

Key Findings & Recommendations

While the vast majority of the equipment is functioning exactly as intended, the (20) "Noted Recommendations" consist of routine maintenance tasks designed to align with compliance tracking and long-term reliability:

- **Rooftop Units (RTUs):** Clean out debris and dust from the units using compressed air to maintain optimal airflow and cooling efficiency.
- **Connection Verification:** Check and verify the torque/tightness on a few specified electrical connections to prevent potential future thermal stress.
- **Baseline Tracking & Compliance:** Utilize the data and thermal images from this report as a baseline for future inspections. This satisfies ongoing tracking required by NFPA 70B and ensures continuous alignment with insurance risk-mitigation standards.

Conclusion: The equipment at [customer name] in excellent health. Implementing these minor, preventative maintenance steps will ensure continued operational uptime, safety, and strict compliance with national electrical maintenance standards.



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 4 / 271

1. SUMMARY OF EXISTING EQUIPMENT

The customer has drawn up the contractual list of the equipment to be inspected. This list is shown below. We disclaim any liability for electrical equipment or installations not included in the list provided by the user company.

Any equipment and / or part of installation not included in the list below should be indicated to us by the user company.

Location / Equipment	Status	Comments (eg reason for no control)	Date
Production 204			
1000			
LZ-EV	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1001			
LZ-2A	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1002			
LZ-2B	Note	Verify connections on lower 3-pole breakers. Possibly dirty or loose.	2026.06.18
1003			
HZ-2	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1004			
LZ-2C	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1005			
East #1	Note	Continue to monitor, use first photo as benchmark	2026.06.18
1006			
East #2	Note	Continue to monitor, use first photo as benchmark	2026.06.18
1007			
Psychometrics	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1008			
Test Chamber Sub Panel	OK	No issue, normal operation. No action recommended at this time. Image showing	2026.06.18
1009			
Test Chamber Transformer	OK	No issue, normal operation. No action recommended at this time.	2026.06.18



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 5 / 271

Location / Equipment	Status	Comments (eg reason for no control)	Date
1010 Fan Control A	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1011 Fan Control B	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1012 LZ-4A	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1013 LZ-4B	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1014 HZ-4	Note	Check connection on left side. Possibly dirty or loose.	2026.06.18
1015 LZ-4C	Note	Check connections on left side	2026.06.18
1016 Transformer North #1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1017 Transformer North #2	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1018 Proxima PZ-3000	Could not inspect	Do not scan	2026.06.18
Styli Lab 201			
1019 SilverCut Saw	Note	Check connection on hot spot.	2026.06.18
1020 Memmert Curing Oven #1	OK	Normal operation	2026.06.18
1021 Memmert Curing Oven #2	OK	Normal operation	2026.06.18
1022 Trumark 5000 Laser	OK	Normal operation	2026.06.18
1023 Elma Ultrasonic Washer	OK	Normal operation	2026.06.18
1024 LP-4a	OK	Normal operation	2026.06.18



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 6 / 271

Location / Equipment	Status	Comments (eg reason for no control)	Date
Mechanical Room 203			
1025			
L1	OK	No issue, normal operation	2026.06.18
1026			
#1 Transformer	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1027			
#2 Transformer	Note	Inspect connections of lower phase. Could be loose connections or load imbalance.	2026.06.18
1028			
Capacitor Disconnect	Note	Continue to monitor. No immediate concern.	2026.06.18
1029			
MM13 Switchboard #1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1030			
MM13 Switchboard #2	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1031			
H1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
Compressor room			
Compressor #1	Note	Verify connections	2026.06.18
Compressor #2	OK		2026.06.18
Dryer #1	OK		2026.06.18
Dryer #2	OK		2026.06.18
Roof Top Units			
#1	OK		2026.06.18
#2	OK	5.9,4.5,5.6amps	2026.06.18
#3	OK	8.7,6.1,7.4amps	2026.06.18
#4	OK	10.4,8.5,9.2amps	2026.06.18
#5	OK	5,4.8,5.6	2026.06.18
#7	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
#8	Could not inspect	Bad compressor is disconnected	2026.06.18
#9	Could not inspect	Could not get good reading cycling	2026.06.18
#10	Could not inspect	Unit not running	2026.06.18



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 7 / 271

Location / Equipment	Status	Comments (eg reason for no control)	Date
#11	Note	Look for loose fuse connection. Monitor fuse function.	2026.06.18
#15	OK		2026.06.18
#16	Could not inspect		2026.06.18
#17	Note	Clean with compressed air	2026.06.18
#18	Note	25.4,21.6,23.7amps Clean with compressed air	2026.06.18
#6	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
#21	Note	This unit blew a fuse yesterday	2026.06.18
#12	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
#13	OK		2026.06.18
#14	OK	Unit cycled off	2026.06.18
#19	Could not inspect		2026.06.18
#20	Note	Clean with compressed air.	2026.06.18
#22	OK	4.5,4.3,3.9amps	2026.06.18
#23	OK	19.2,20.2,18.2	2026.06.18
#24	OK	4.2,3.8,3.9amps	2026.06.18
#25	Note	Check connection on A-phase. Clean with compressed air. 25.8,23.5,24.7amps	2026.06.18
#26	Note	Clean with compressed air. 26.3,26.4,23	2026.06.18
#27	OK	13.8,15,13.2amps	2026.06.18
#28	OK		2026.06.18
#29	Note	Clean with compressed air. 14.5,13.7,14.3amps	2026.06.18
#30	OK	4.8,3.8,4.4amps	2026.06.18
#31	OK	11.2,11.6,9.2amps	2026.06.18
#32	OK	7.2,7.6,5.8amps	2026.06.18
#33	Note	Clean with compressed air. 18.4,16.7,16 amps	2026.06.18
Sensors 204			
1032			
HZ-1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1033			
MM140 Switchboard #1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 8 / 271

Location / Equipment	Status	Comments (eg reason for no control)	Date
1034 MM140 Switchboard #2	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1035 MM140 Switchboard #3	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1036 MM140 Switchboard #4	Note	Continue to monitor. There is a small variance on A-phase.	2026.06.18
1037 Transformer #1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1038 LZ1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1039 LZ1A	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1040 Prismo Navigator 115379	Could not inspect	Do not scan	2026.06.18
1041 Prismo Navigator 150320	Could not inspect	Do not scan	2026.06.18
1042 Prismo Navigator 731706810412	Could not inspect	Do not scan	2026.06.18
1043 Prismo Navigator 731706810413	Could not inspect	Do not scan	2026.06.18
1044 Contura	Could not inspect	Do not scan	2026.06.18
Quality Lab 205			
1045 Compressor #2	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
Prismo Navigator	Could not inspect	Do not scan	2026.06.18
Large Shipping 400			
1046			



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 9 / 271

Location / Equipment	Status	Comments (eg reason for no control)	Date
HZ-3	OK		2026.06.18
1047			
LZ-3B	OK		2026.06.18
1048			
LZ-3A	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1049			
Sanitech Compactor	OK		2026.06.18
1050			
Forklift Charger	Could not inspect	Charger gone	2026.06.18
TZ-3	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
Small Parts Shipping 401			
1051			
GNB GTC-96ST1 Forklift Charger	OK		2026.06.18
1052			
FoamPlus Machine	Could not inspect	Do not scan	2026.06.18
1053			
Schaefer Logimax VLM	Could not inspect	Do not scan	2026.06.18
1054			
Clean Air Humidor	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1055			
Harmony Cardboard Bailer	OK		2026.06.18
Receiving 501			
1056			
Douglas Forklift Charger	OK		2026.06.18
1057			
HP-4	Note	Check connection and amp draw.	2026.06.18
1058			
HP-3	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1059			
V48M28T75S Transformer (TOP)	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1060			



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 10 / 271

Location / Equipment	Status	Comments (eg reason for no control)	Date
V48M28T75S Transformer (BOTTOM)	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1061			
LP-1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1062			
LP-2	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1063			
LV-4	OK		2026.06.18
Engineering Lab 625			
1064			
SEHV-1	OK	No issue, normal operation. No action recommended at this time.	2026.06.18
1065			
Spectrum 40155671	Could not inspect	Do not read	2026.06.18
1066			
Other	Could not inspect	No inspection point	2026.06.18



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 11 / 271

2. PRESENTATION OF ANOMALIES OBSERVED WITH THERMOGRAM

NOTE: Each anomaly is presented with:

- A photograph
- A thermogram
- An array of results
- A set of comments associated with the images.

We specify that the values of the temperatures are indicative.


The differences in temperatures between spots are much more significant.



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 12 / 271

Visual Photo


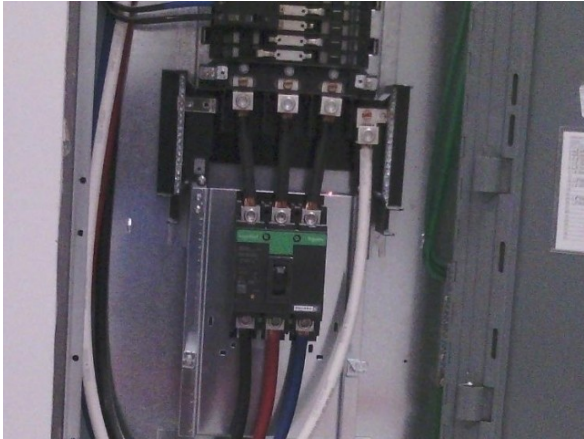


Equipment name : Production 204
Device name : 1000
Measurement Point : LZ-EV
Status OK

Measurements

Bx1	
Max	87.9 °F
Avg	76.9 °F
Min	70.5 °F
Dt1	
Bx1.Max -Bx1.Min	17.4 °F
Sp1	86.5 °F
Sp2	83.2 °F
Sp3	86.5 °F

Thermogram 1 Created: 5/14/2026 9:55:13 AM

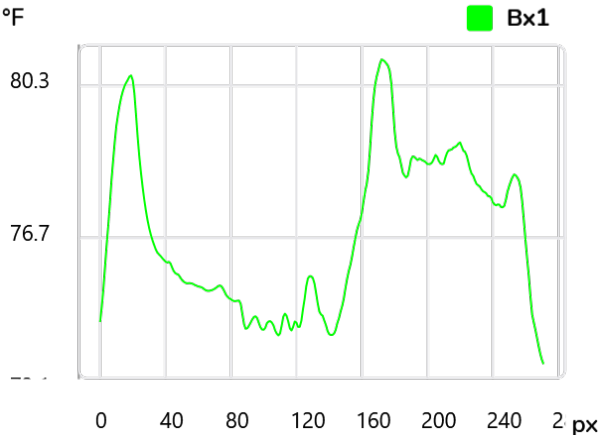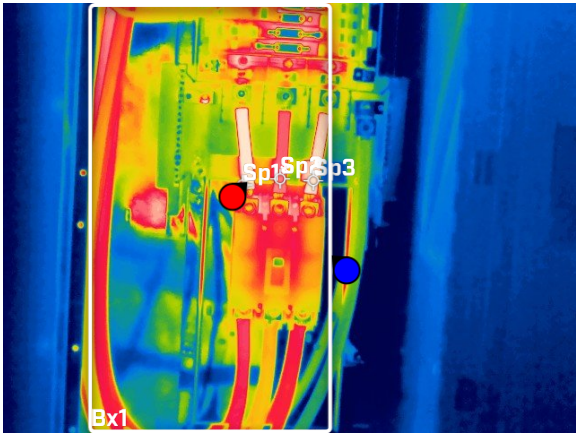

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	5.99 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 13 / 271

Visual Photo


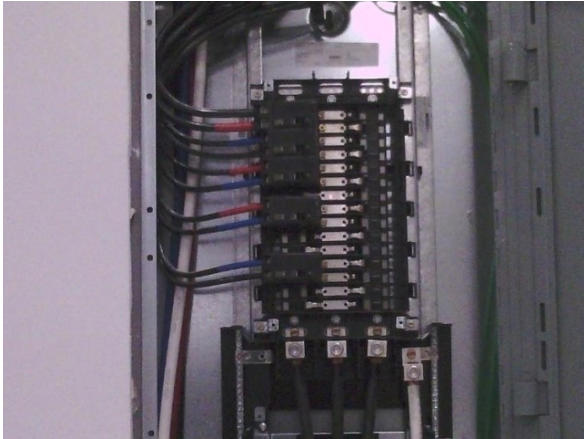


Equipment name : Production 204
Device name : 1000
Measurement Point : LZ-EV
Status OK

Measurements

Bx1	
Max	102.5 °F
Min	70.9 °F
Area	1.647 ft²
Dt1	
Bx1.Max	31.5 °F
-Bx1.Min	
Sp1	99.9 °F
Sp2	94.5 °F

Thermogram 2 Created: 5/14/2026 9:56:18 AM

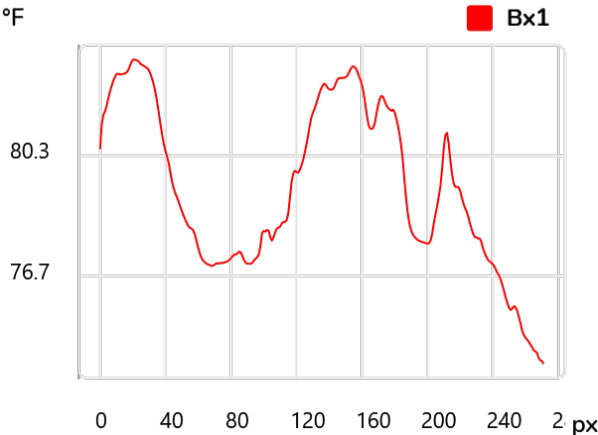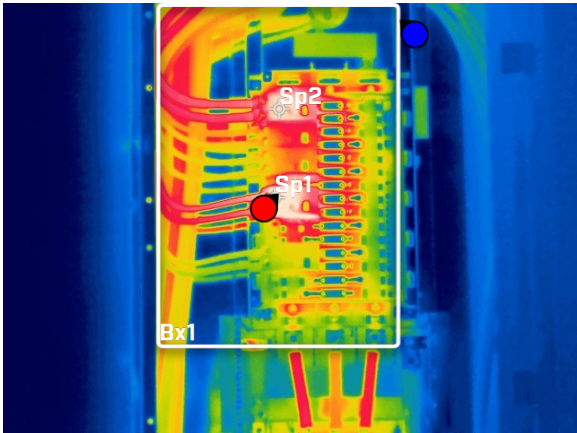

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 6.27 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 14 / 271

Visual Photo


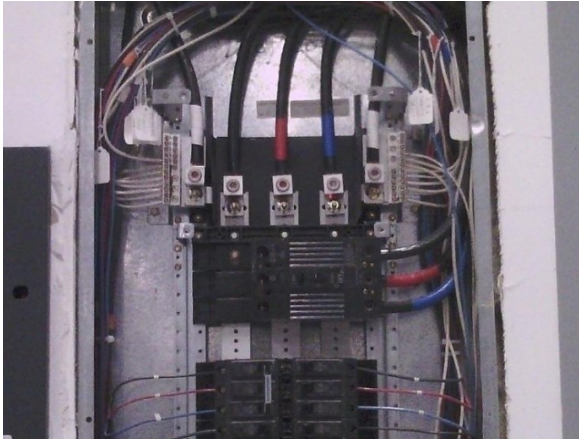


Equipment name : Production 204
Device name : 1000
Measurement Point : LZ-EV
Status OK

Measurements

Bx1	
Max	79.5 °F
Min	69.7 °F
Area	1.407 ft ²
Dt2	
Bx1.Max	9.8 °F
-Bx1.Min	
Sp1	78.1 °F
Sp2	77.7 °F

Thermogram 3 Created: 5/14/2026 10:11:44 AM

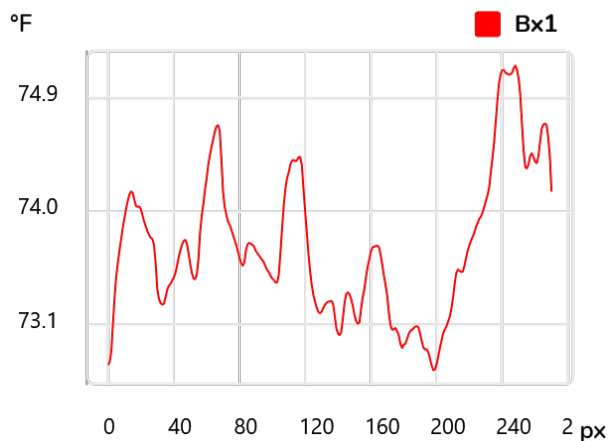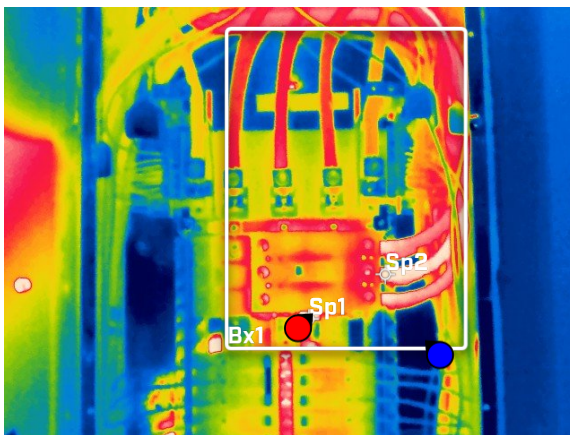

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments

Priority None

Parameters


Emissivity 0.95
Distance 5.99 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 15 / 271

Visual Photo


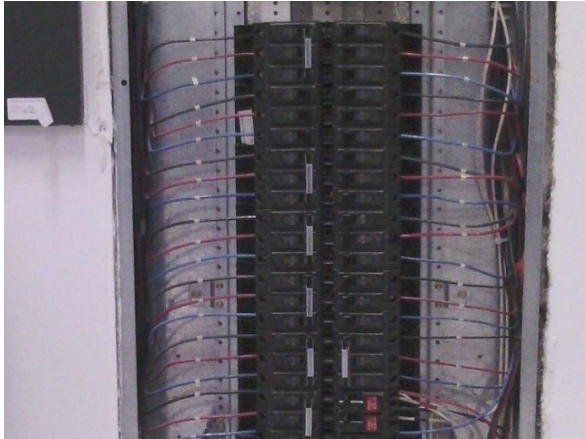


Equipment name : Production 204
Device name : 1000
Measurement Point : LZ-EV
Status OK

Measurements

Value	
Bx1	
Max	80.3 °F
Min	70.1 °F
Area	0.950 ft²
Sp1	78.1 °F
Sp2	76.8 °F

Thermogram 4 Created: 5/14/2026 10:14:37 AM

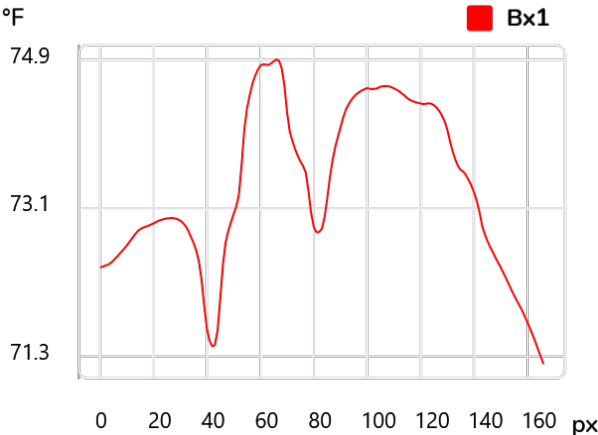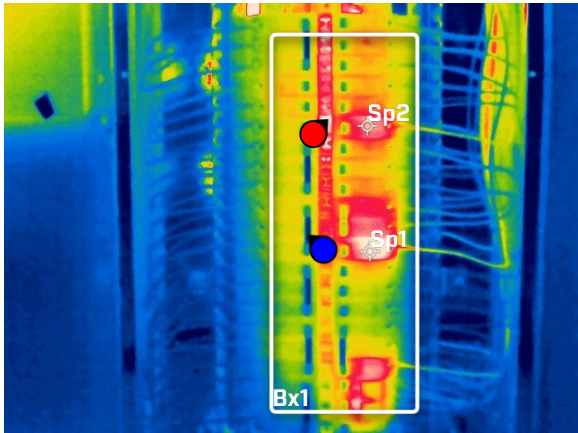

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Parameters


Emissivity 0.95
Distance 5.78 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 16 / 271

Visual Photo


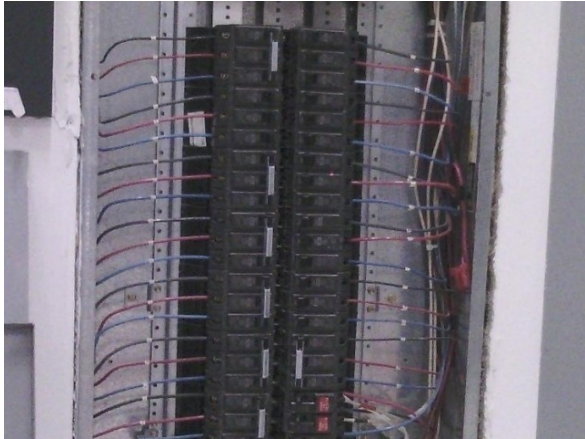


Equipment name : Production 204
Device name : 1001
Measurement Point : LZ-2A
Status OK

Measurements

Bx1	
Max	81.3 °F
Min	70.7 °F
Area	0.480 ft ²
Dt1	
Bx1.Max	10.6 °F
-Bx1.Min	
Sp1	81.1 °F
Sp2	76.6 °F

Thermogram 5 Created: 5/14/2026 1:02:22 PM

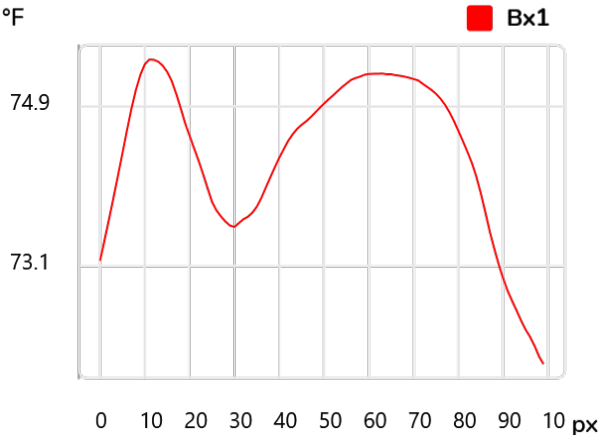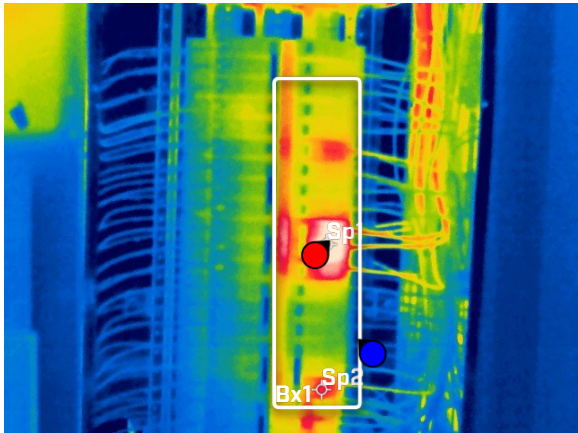

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Parameters


Emissivity 0.95
Distance 5.69 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 17 / 271

Visual Photo


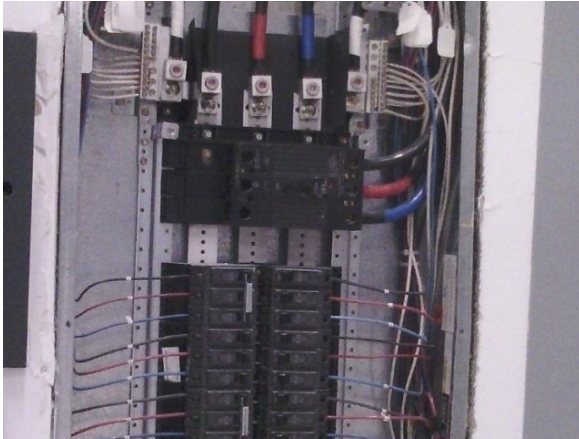


Equipment name : Production 204
Device name : 1001
Measurement Point : LZ-2A
Status OK

Measurements

Bx1	
Max	80.6 °F
Min	69.4 °F
Dt1	
Bx1.Max	11.2 °F
-Bx1.Min	
Sp1	75.2 °F

Thermogram 6 Created: 5/14/2026 1:03:12 PM

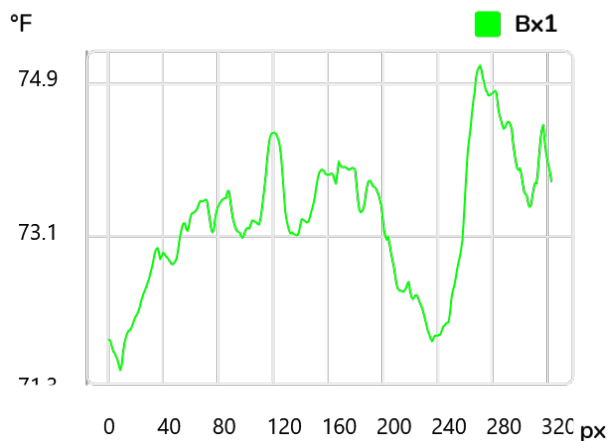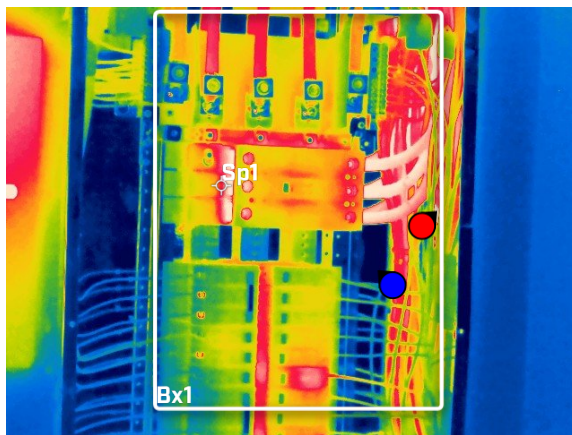

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments

Priority None

Parameters


Emissivity	0.95
Distance	5.69 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 18 / 271

Visual Photo


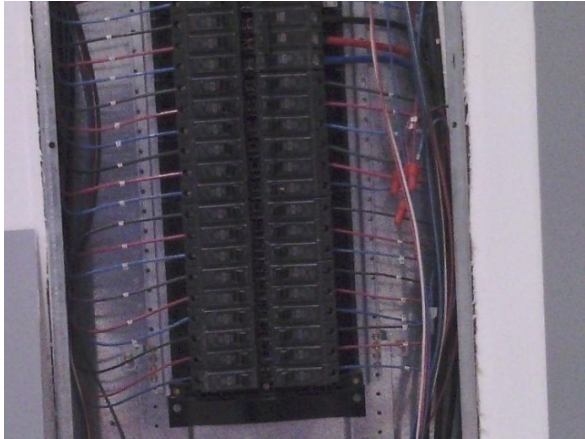


Equipment name : Production 204
Device name : 1002
Measurement Point : LZ-2B
Status Note

Measurements

Value	
Bx1	
Max	82.1 °F
Min	70.3 °F
Area	1.294 ft²
Sp1	80.2 °F
Sp2	79.0 °F

Thermogram 7 Created: 5/14/2026 10:26:02 AM

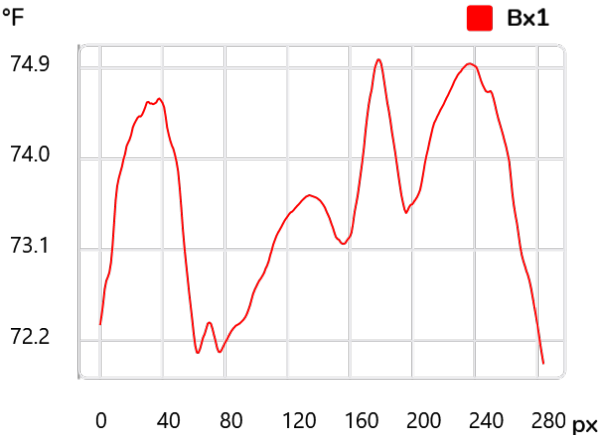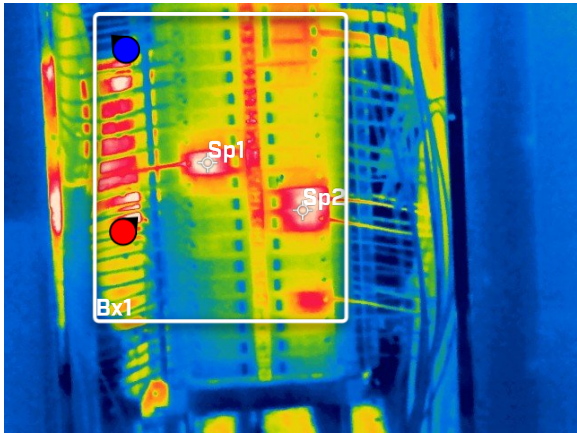

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Verify connections on lower 3-pole breakers.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 5.72 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 19 / 271

Visual Photo


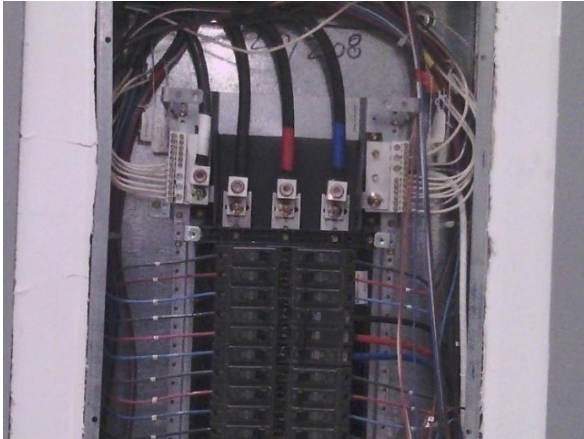


Equipment name : Production 204
Device name : 1002
Measurement Point : LZ-2B
Status Note

Measurements

Bx1	
Max	88.8 °F
Min	69.3 °F
Area	1.988 ft ²
Dt1	
Bx1.Max	19.5 °F
-Bx1.Min	
Sp1	74.0 °F
Sp2	75.1 °F

Thermogram 8 Created: 5/14/2026 10:29:34 AM

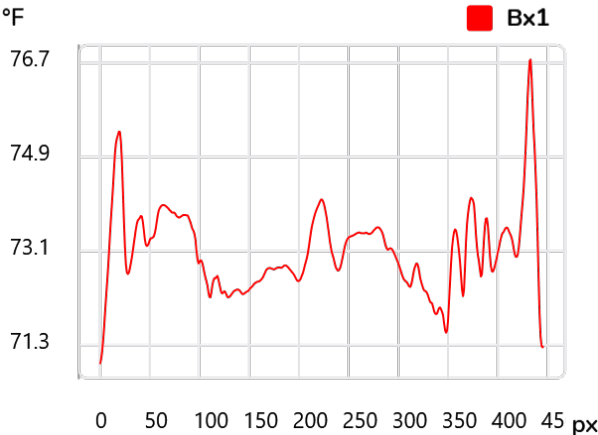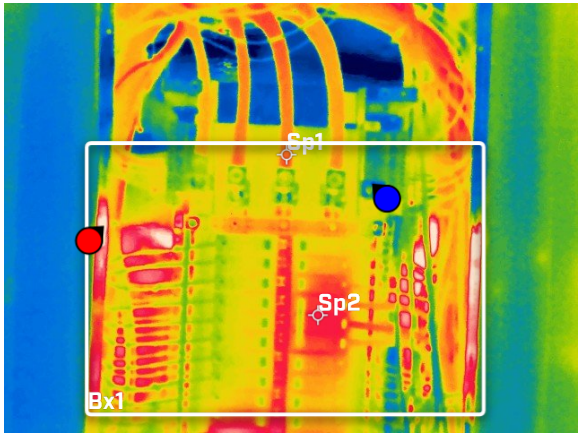

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Verify connections on lower 3-pole breakers.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 6.01 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 20 / 271

Visual Photo


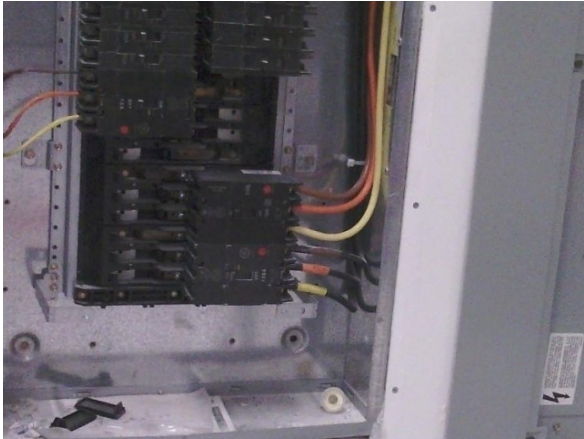


Equipment name : Production 204
Device name : 1002
Measurement Point : LZ-2B
Status Note

Measurements

Value	
Bx1	
Max	84.0 °F
Min	69.3 °F
Area	1.048 ft²
Sp1	82.1 °F
Sp2	81.5 °F
Sp3	77.9 °F

Thermogram 9 Created: 5/14/2026 10:43:03 AM

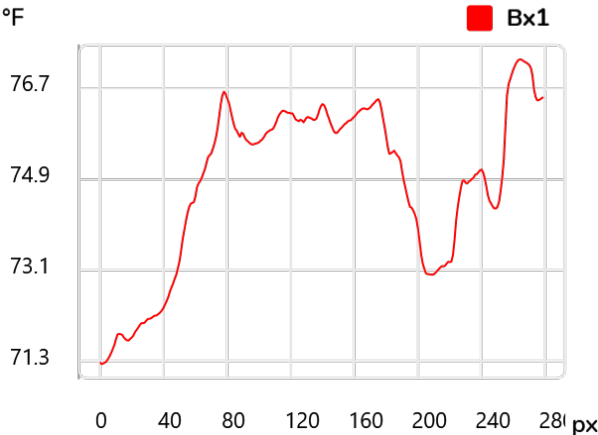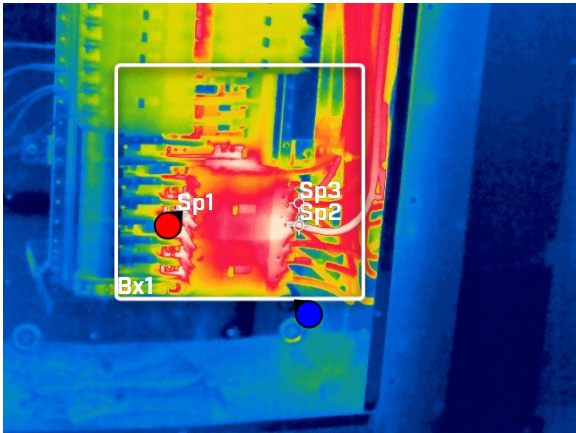

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Verify connections on lower 3-pole breakers.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 5.94 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 21 / 271

Visual Photo


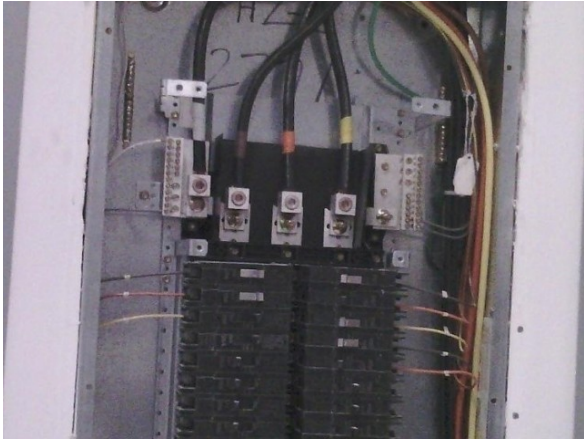


Equipment name : Production 204
Device name : 1002
Measurement Point : LZ-2B
Status Note

Measurements

Bx1	
Max	80.4 °F
Min	69.0 °F
Area	1.280 ft ²
Dt1	
Bx1.Max -Bx1.Min	11.4 °F
Sp1	79.0 °F
Sp2	77.2 °F

Thermogram 10 Created: 5/14/2026 10:49:53 AM

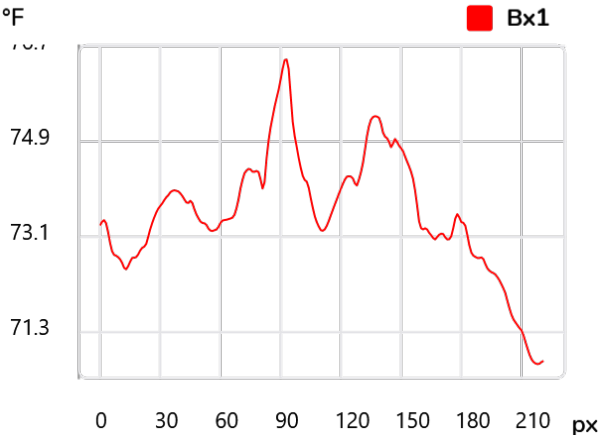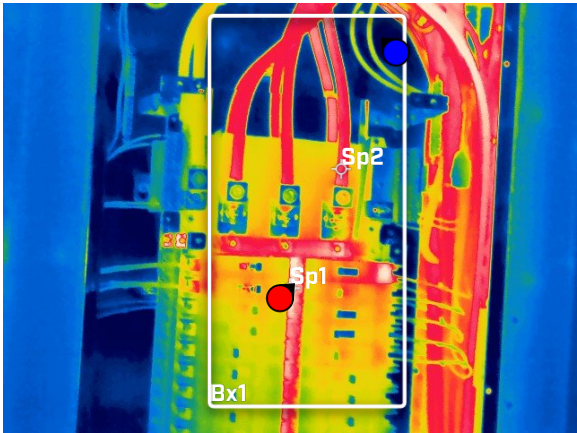

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Verify connections on lower 3-pole breakers.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 5.72 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 22 / 271

Visual Photo


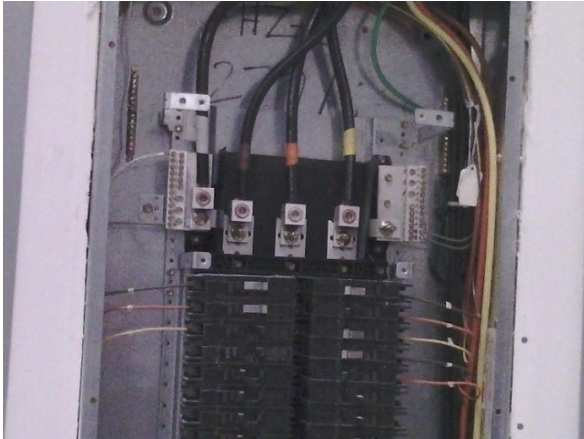


Equipment name : Production 204
Device name : 1002
Measurement Point : LZ-2B
Status Note

Measurements

Bx1	
Max	80.3 °F
Min	69.8 °F
Area	0.752 ft ²
Dt1	
Bx1.Max -Bx1.Min	10.5 °F
Sp1	79.0 °F
Sp2	77.6 °F

Thermogram 11 Created: 5/14/2026 10:50:19 AM

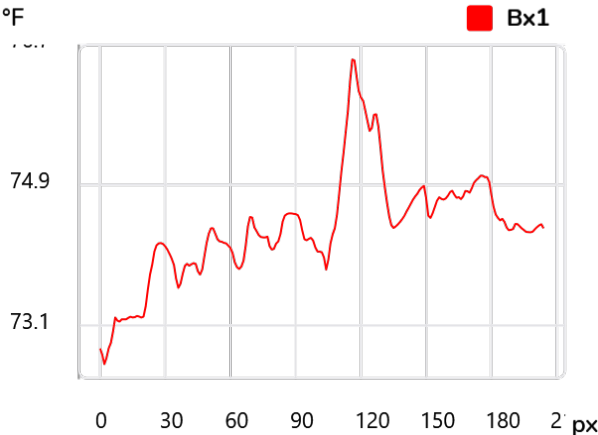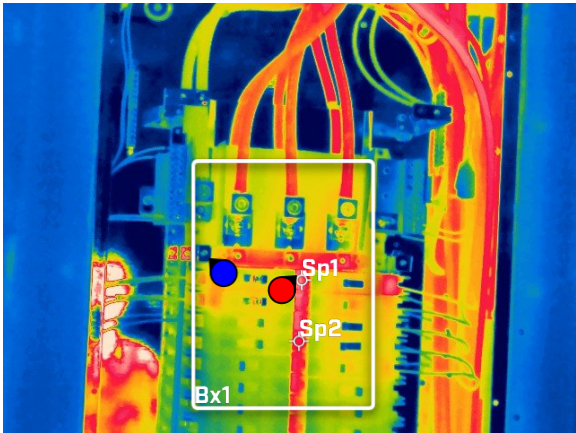

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Verify connections on lower 3-pole breakers.
Priority 2-Intermediate/Investigate

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	5.72 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 23 / 271

Visual Photo


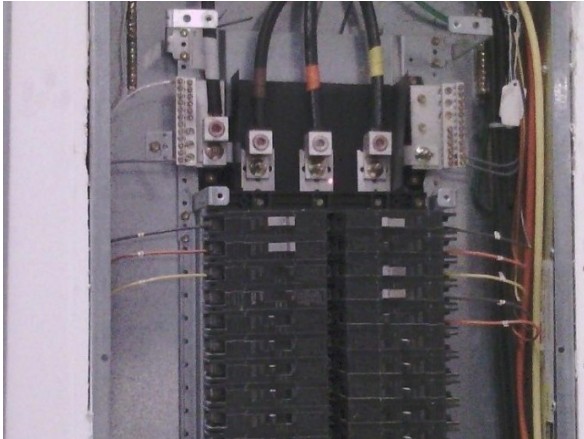


Equipment name : Production 204
Device name : 1003
Measurement Point : HZ-2
Status OK

Measurements

Bx1	
Max	80.6 °F
Min	58.8 °F
Area	2.184 ft ²
Dt1	
Bx1.Max	21.8 °F
-Bx1.Min	
Sp1	76.5 °F
Sp2	72.8 °F

Thermogram 12 Created: 5/15/2026 8:30:40 AM

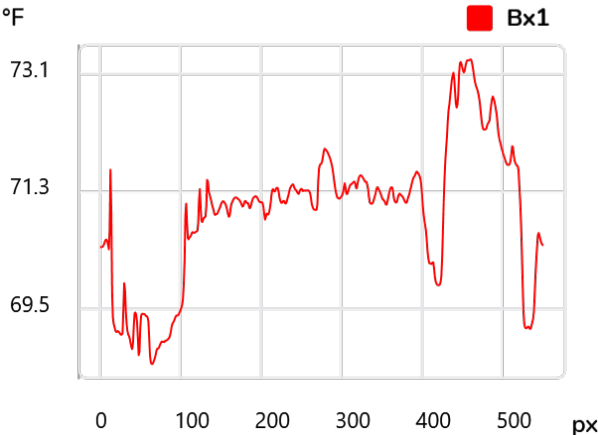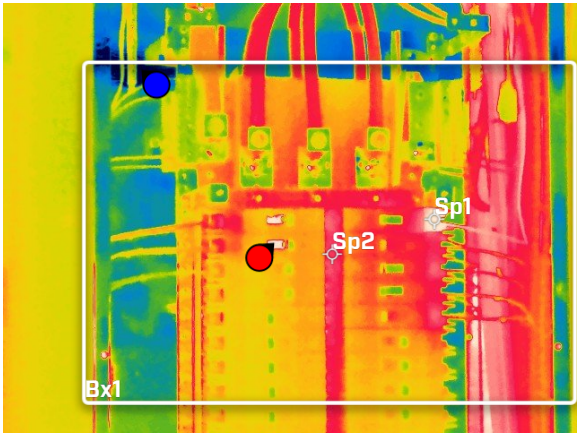

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 5.07 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 24 / 271

Visual Photo


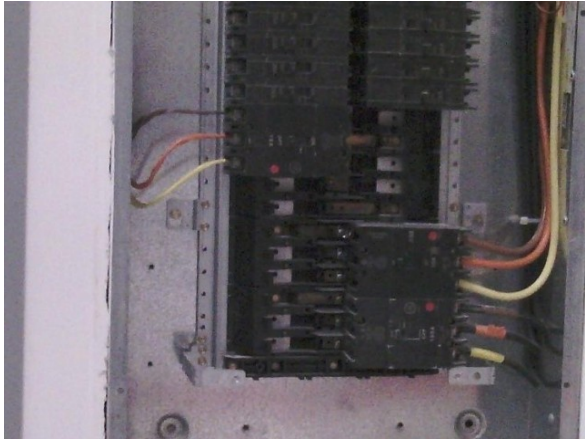


Equipment name : Production 204
Device name : 1003
Measurement Point : HZ-2
Status OK

Measurements

Bx1	
Max	78.6 °F
Min	68.8 °F
Area	1.201 ft²
Dt1	
Bx1.Max	9.8 °F
-Bx1.Min	
Sp1	76.6 °F

Thermogram 13 Created: 5/15/2026 8:31:44 AM

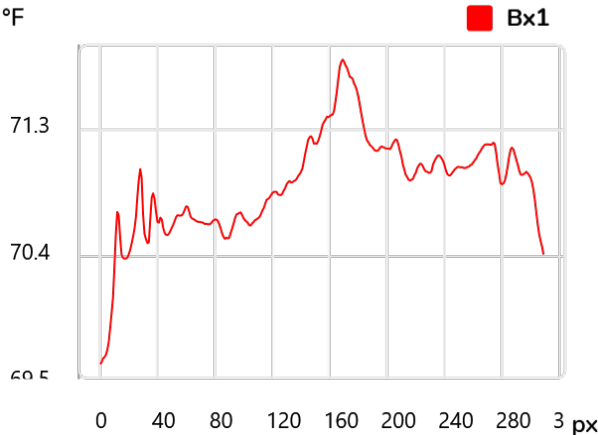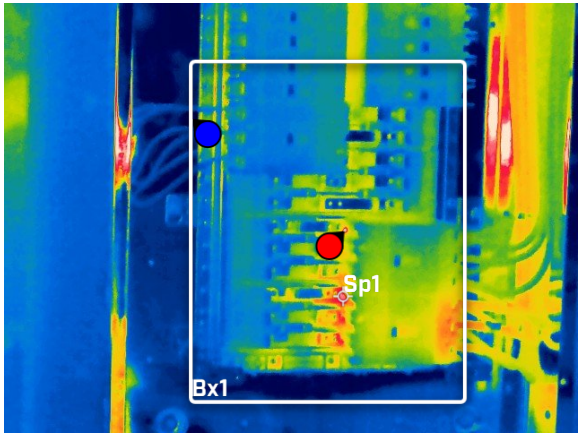

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 5.02 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 25 / 271

Visual Photo


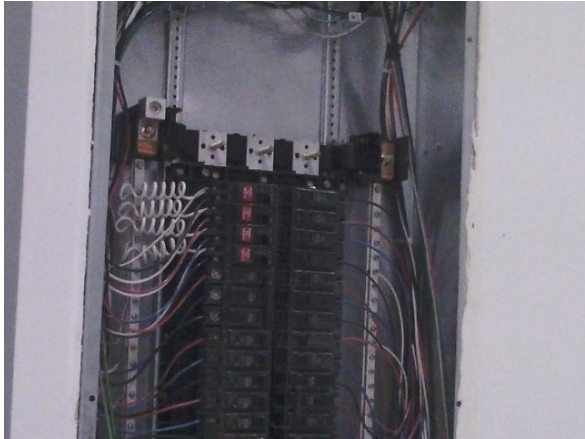


Equipment name : Production 204
Device name : 1004
Measurement Point : LZ-2C
Status OK

Measurements

Bx1	
Max	77.7 °F
Min	69.7 °F
Area	0.651 ft²
Dt1	
Bx1.Max	8.0 °F
-Bx1.Min	
Sp1	75.1 °F

Thermogram 14 Created: 5/14/2026 11:05:49 AM

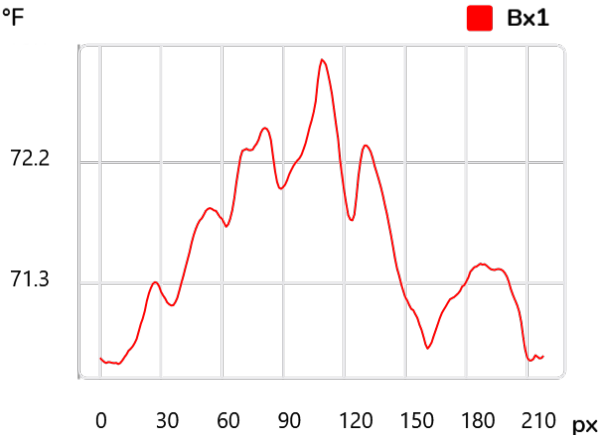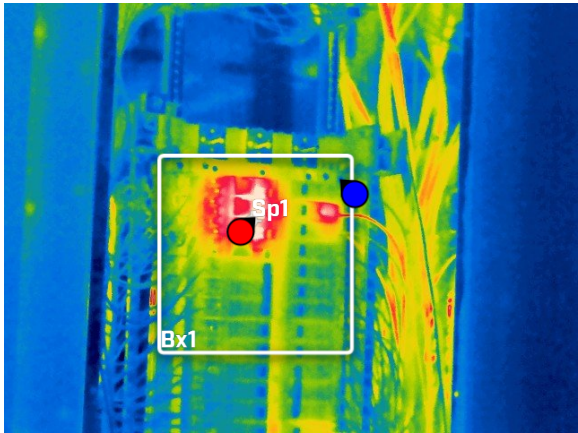

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 5.76 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 26 / 271

Visual Photo



Equipment name : Production 204
Device name : 1004
Measurement Point : LZ-2C
Status OK

Measurements



Value

Bx1

Max 74.9 °F
Min 69.5 °F
Area 0.875 ft²
Sp1 73.7 °F

Thermogram 15

Created: 5/14/2026 11:06:43 AM

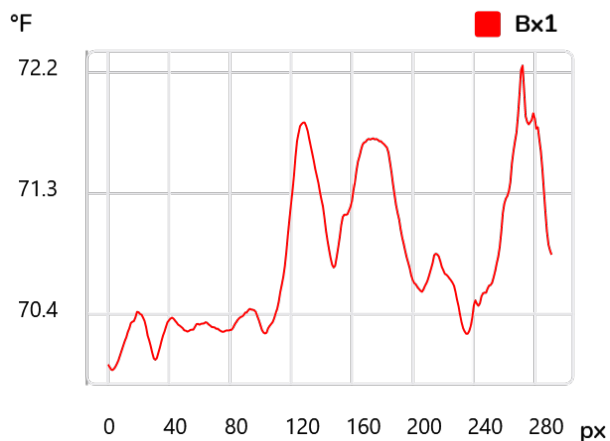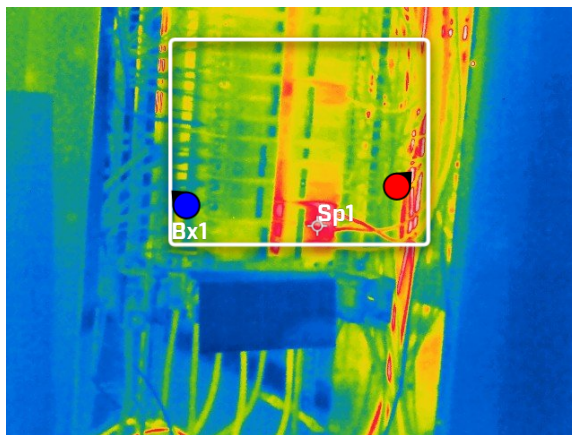

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments

Priority None

Parameters


Emissivity 0.95
Distance 5.67 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 27 / 271

Visual Photo

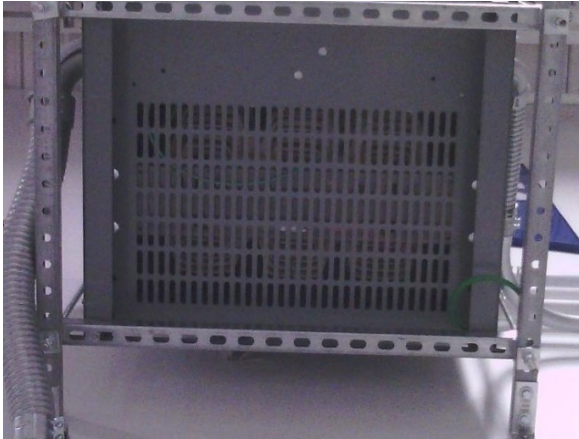

Equipment name : Production 204
Device name : 1005
Measurement Point : East #1
Status Note

Measurements

Value

Bx1

Max 107.5 °F



Min 72.8 °F

Area 0.928 ft²

Sp1 92.7 °F

Thermogram 16

Created: 5/14/2026 12:46:59 PM

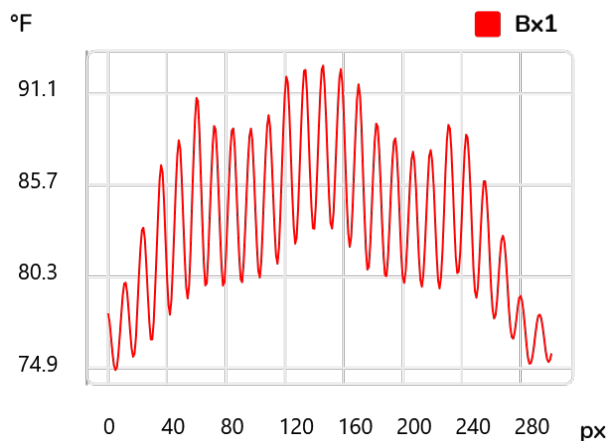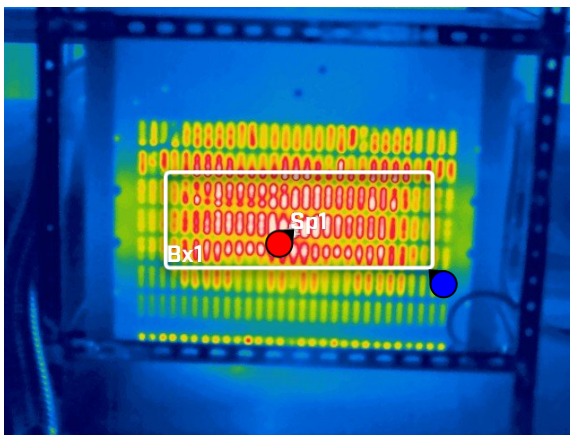

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action Monitor changes

Comment Continue to monitor, use photo as benchmark

Priority 3 - Minor/Monitor

Parameters

Emissivity 0.95
Distance 8.32 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 28 / 271

Visual Photo





Equipment name : Production 204
Device name : 1005
Measurement Point : East #1
Status Note

Measurements

Bx1	
Max	99.4 °F
Min	69.9 °F
Area	7.329 ft ²
Dt1	
Bx1.Max	29.5 °F
-Bx1.Min	
Sp1	78.8 °F

Thermogram 17 Created: 5/14/2026 12:51:25 PM

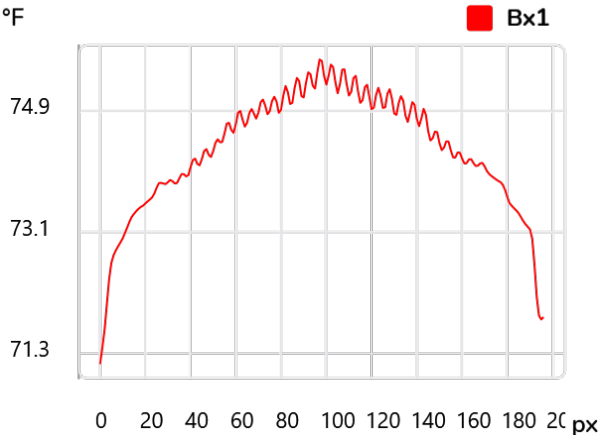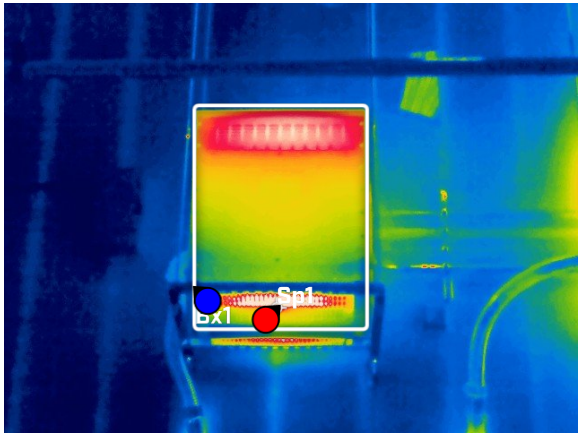

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action Monitor changes
Comment Continue to monitor, use photo as benchmark
Priority 3 - Minor/Monitor

Parameters


Emissivity 0.95
Distance 19.12 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 29 / 271

Visual Photo


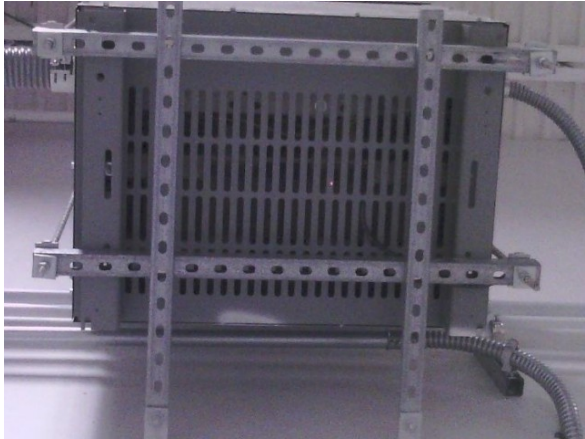


Equipment name : Production 204
Device name : 1006
Measurement Point : East #2
Status Note

Measurements

Value	
Bx1	
Max	185.3 °F
Min	79.7 °F
Area	0.677 ft²
Sp1	110.5 °F

Thermogram 18 Created: 5/14/2026 12:49:02 PM

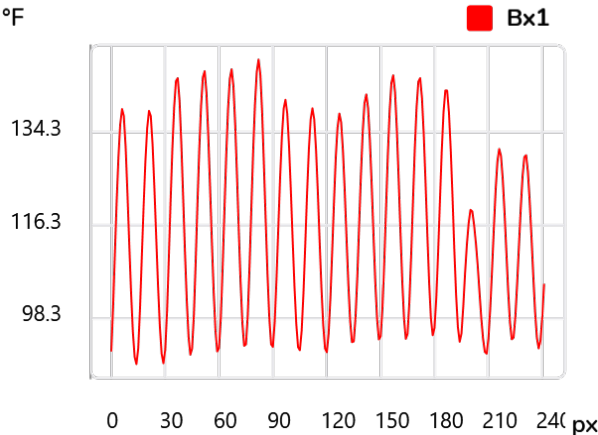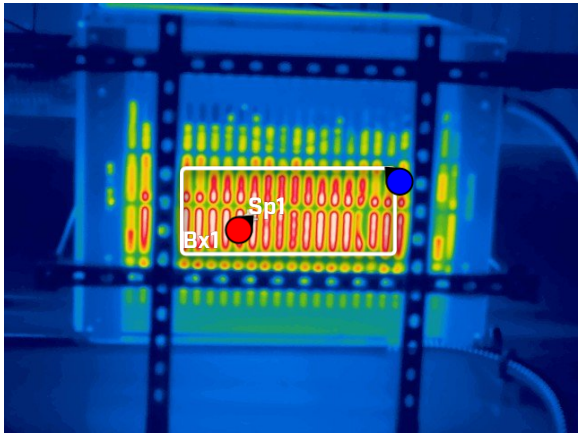

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action Monitor changes
Comment Continue to monitor, use photo as benchmark
Priority 3 - Minor/Monitor

Parameters

Emissivity	0.95
Distance	8.36 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 30 / 271

Visual Photo





Equipment name : Production 204
Device name : 1006
Measurement Point : East #2
Status Note

Measurements

Bx1	
Max	103.0 °F
Min	73.2 °F
Area	4.531 ft ²
Dt1	
Bx1.Max	29.8 °F
-Bx1.Min	
Sp1	79.1 °F

Thermogram 19 Created: 5/14/2026 12:50:42 PM

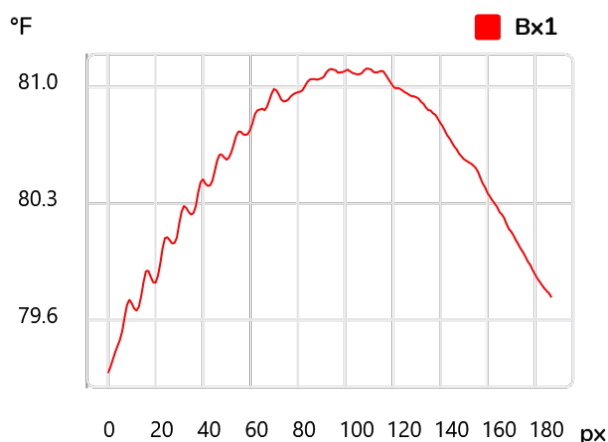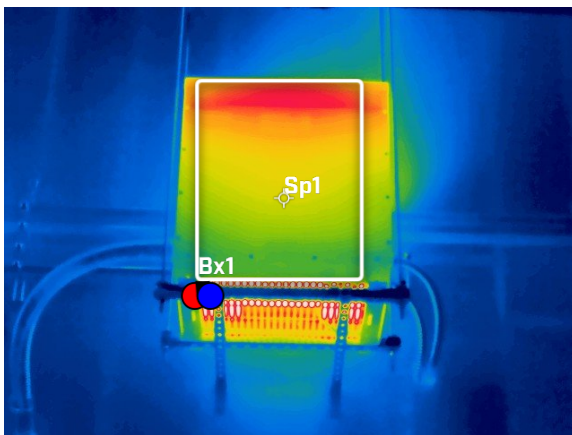

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action Monitor changes

Comment Continue to monitor, use photo as benchmark

Priority 3 - Minor/Monitor

Parameters

Emissivity	0.95
Distance	16.32 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 31 / 271

Visual Photo




Equipment name : Production 204
Device name : 1007
Measurement Point : Psychometrics
Status OK

Measurements

Bx1	
Max	103.7 °F
Min	70.1 °F
Area	2.360 ft²
Dt1	
Bx1.Max	33.6 °F
-Bx1.Min	
Sp1	94.6 °F

Thermogram 20 Created: 5/19/2026 8:54:40 AM

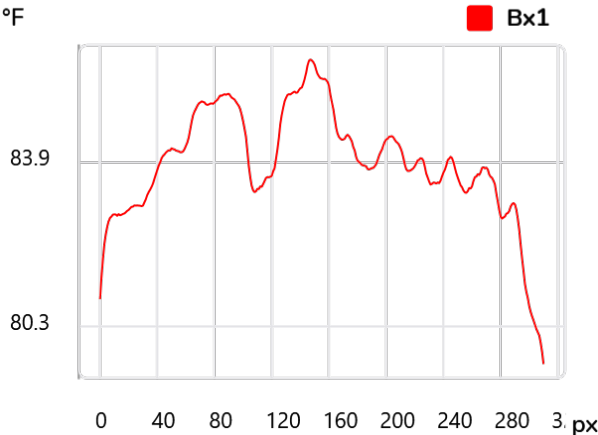

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 6.74 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 32 / 271

Visual Photo

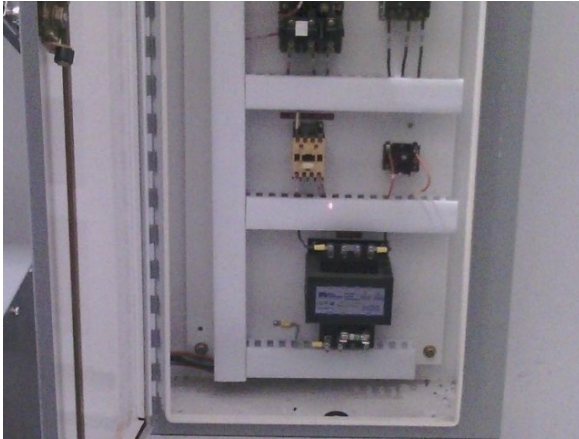

Equipment name : Production 204
Device name : 1007
Measurement Point : Psychometrics
Status OK

Measurements

Value

Bx1

Max 131.6 °F




Min 79.0 °F

Area 1.193 ft²

Sp1 130.9 °F

Thermogram 21

Created: 5/19/2026 8:55:34 AM

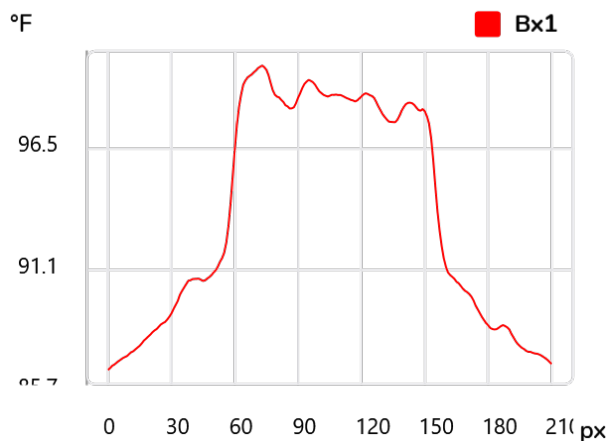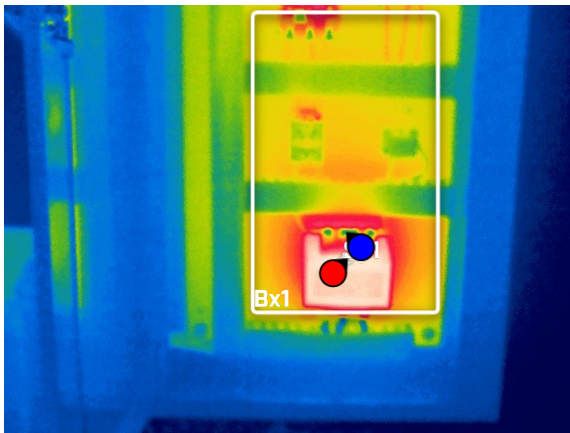

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 6.45 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 33 / 271

Visual Photo

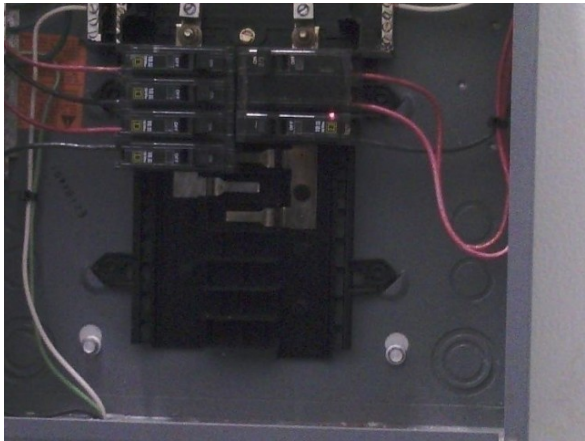



Equipment name : Production 204
Device name : 1008
Measurement Point : Test Chamber Sub Panel

Status OK

Measurements

Bx1	
Max	84.0 °F
Min	70.1 °F
Area	0.254 ft²
Dt1	
Bx1.Max -Bx1.Min	14.0 °F
Sp1	79.7 °F
Sp2	78.0 °F

Thermogram 22 Created: 5/14/2026 1:31:58 PM

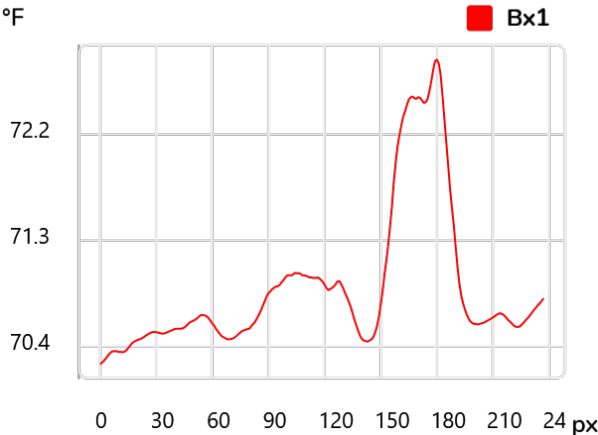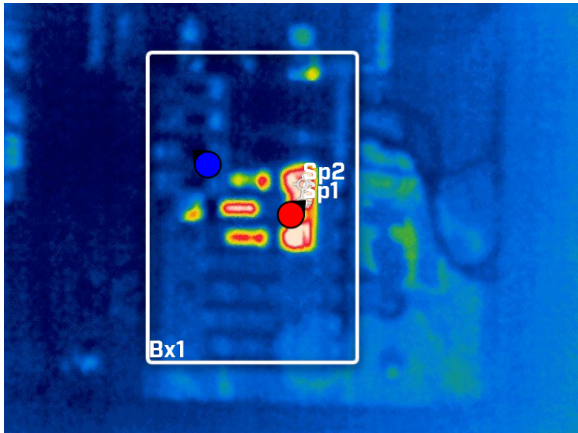

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 2.76 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 34 / 271

Visual Photo

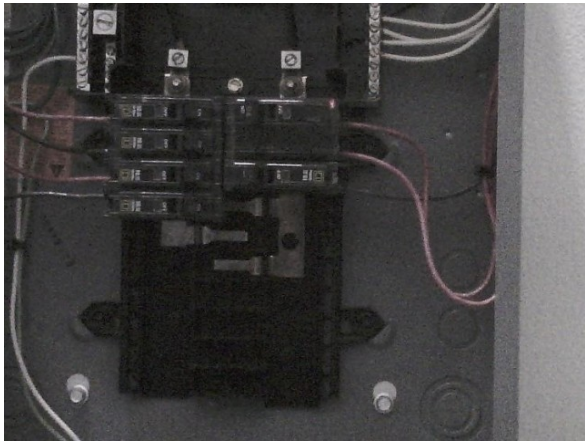



Equipment name : Production 204
Device name : 1008
Measurement Point : Test Chamber Sub Panel

Status OK

Measurements

Value	
Bx1	
Max	83.5 °F
Min	70.1 °F
Area	0.227 ft²
Sp1	81.2 °F

Thermogram 23 Created: 5/14/2026 1:32:29 PM

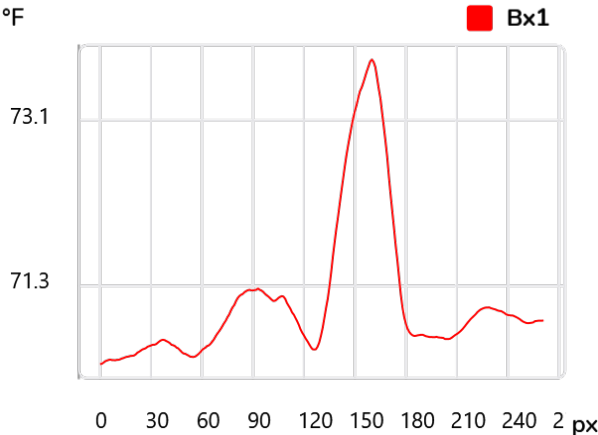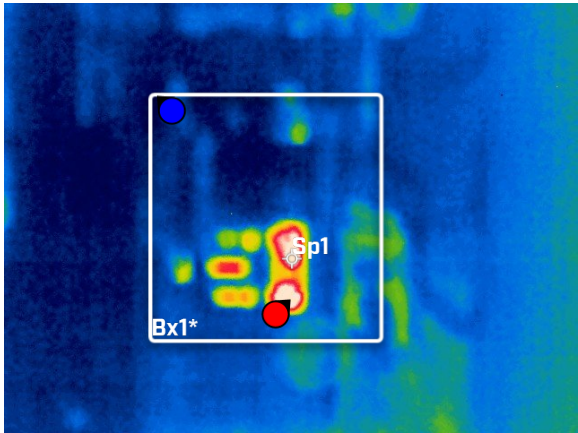

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments
Priority None

Parameters

Emissivity	0.95
Distance	2.78 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 35 / 271

Visual Photo





Equipment name : Production 204
Device name : 1009
Measurement Point : Test Chamber Transformer
Status OK

Measurements

Bx1	
Max	83.2 °F
Avg	78.0 °F
Min	69.9 °F
Dt1	
Bx1.Max -Bx1.Min	13.3 °F
Sp1	82.4 °F
Sp2	79.9 °F

Thermogram 24 Created: 5/14/2026 1:39:30 PM

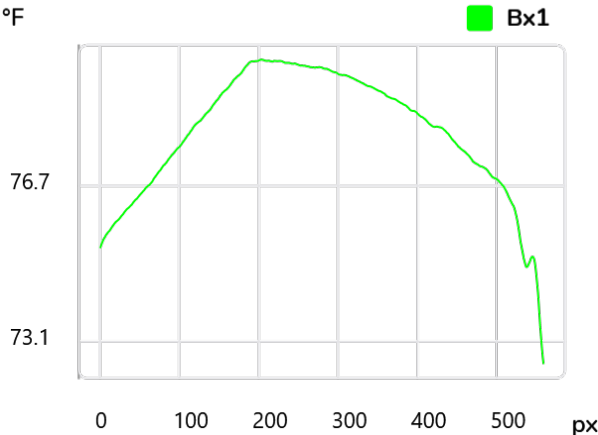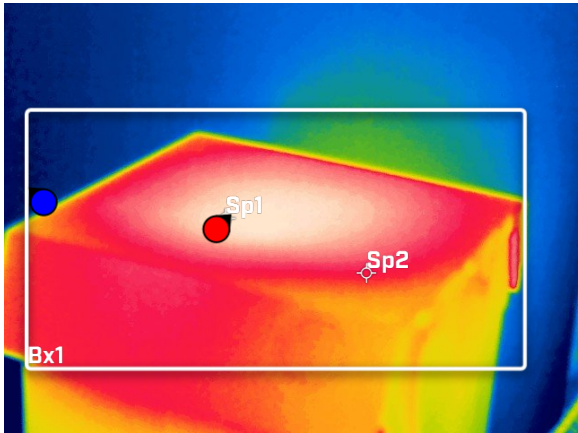

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity	0.95
Distance	5.83 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 36 / 271

Visual Photo





Equipment name : Production 204
Device name : 1009
Measurement Point : Test Chamber Transformer
Status OK

Measurements

Bx1	
Max	81.2 °F
Min	68.9 °F
Area	1.827 ft²
Dt2	
Bx1.Max -Bx1.Min	12.3 °F
Sp1	80.1 °F

Thermogram 25 Created: 5/14/2026 1:39:55 PM

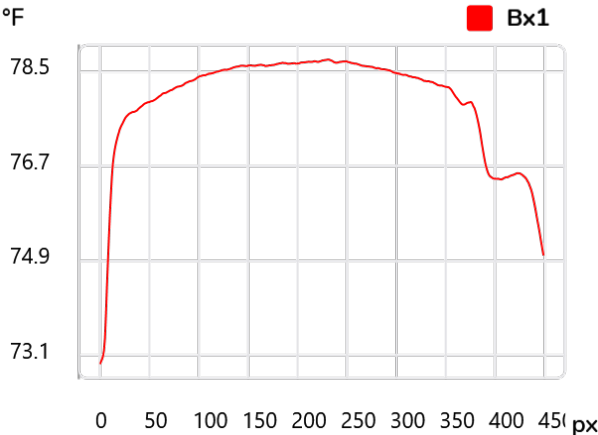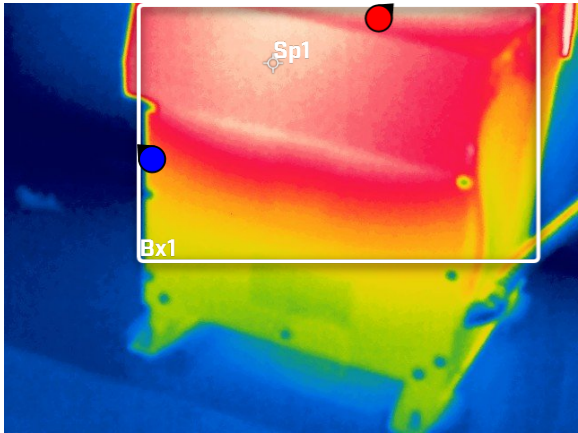

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 5.91 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 37 / 271

Visual Photo





Equipment name : Production 204
Device name : 1009
Measurement Point : Test Chamber Transformer
Status OK

Measurements

Bx1	
Max	114.6 °F
Min	78.6 °F
Area	0.259 ft²
Dt1	
Bx1.Max	36.0 °F
-Bx1.Min	
Sp1	89.5 °F

Thermogram 26 Created: 5/14/2026 1:50:40 PM

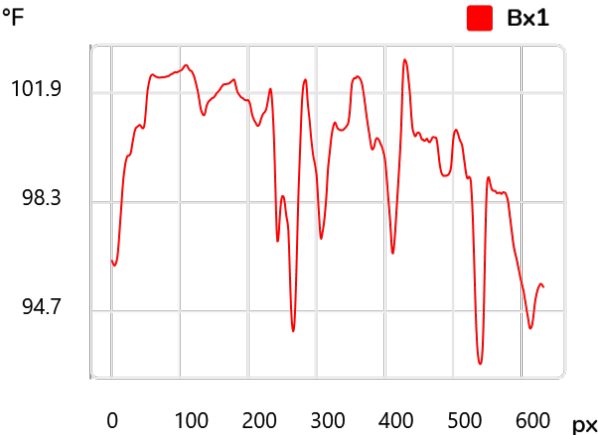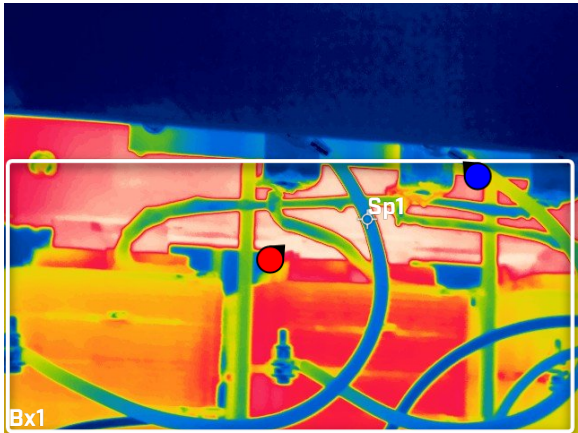

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity 0.95
Distance 1.83 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 38 / 271

Visual Photo



Equipment name : Production 204

Device name : 1009



Measurement Point : Test Chamber
Transformer

Status OK

Measurements

Bx1	
Max	111.6 °F
Min	75.7 °F
Area	0.584 ft ²
Dt1	
Bx1.Max	35.9 °F
-Bx1.Min	
Sp1	86.7 °F

Thermogram 27 Created: 5/14/2026 1:51:10 PM

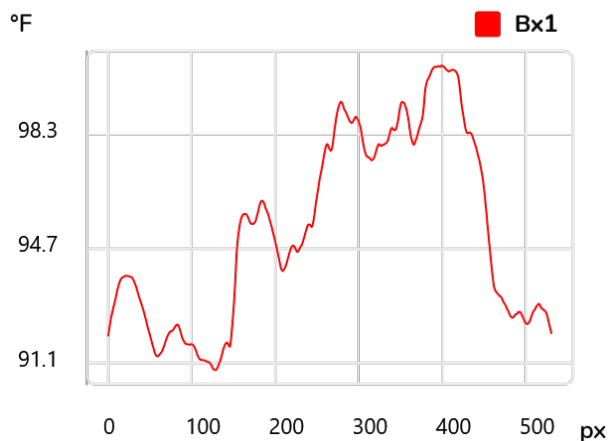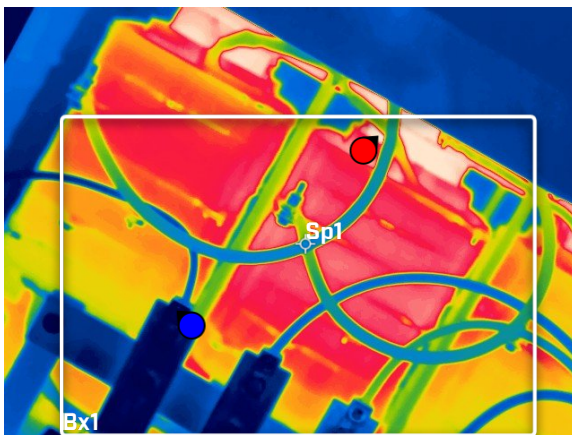

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	2.76 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 39 / 271

Visual Photo


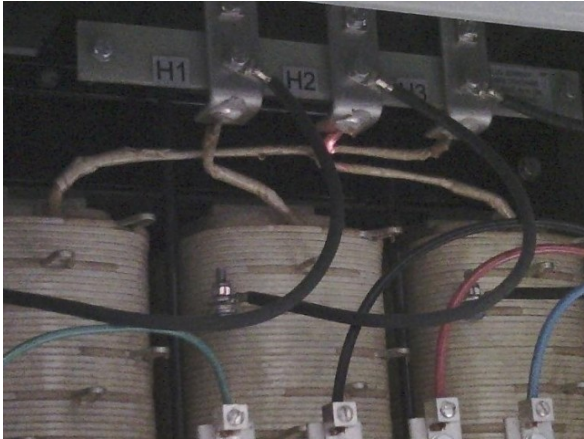


Equipment name : Production 204
Device name : 1009
Measurement Point : Test Chamber Transformer
Status OK

Measurements

Bx1	
Max	114.8 °F
Min	77.1 °F
Area	0.352 ft²
Dt1	
Bx1.Max	37.7 °F
-Bx1.Min	
Sp1	103.6 °F

Thermogram 28 Created: 5/14/2026 1:51:51 PM

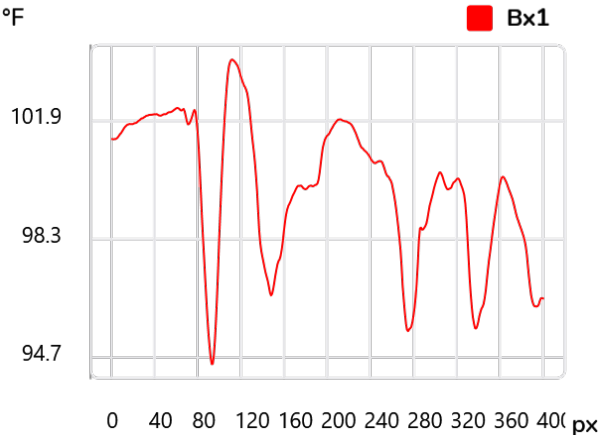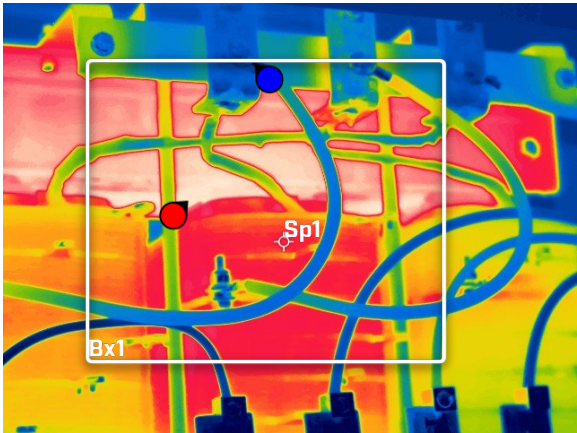

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity 0.95
Distance 2.54 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 40 / 271

Visual Photo





Equipment name : Production 204
Device name : 1010
Measurement Point : Fan Control A
Status OK

Measurements

Bx1	
Max	75.1 °F
Min	70.1 °F
Area	1.418 ft ²
Dt1	
Bx1.Max	5.0 °F
-Bx1.Min	
Sp1	75.0 °F
Sp2	71.9 °F

Thermogram 30 Created: 5/20/2026 1:43:30 PM

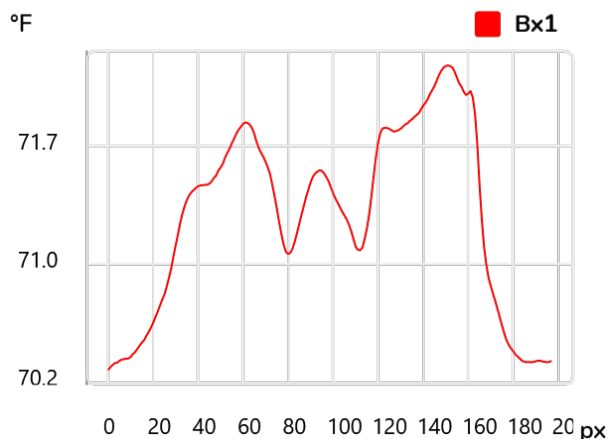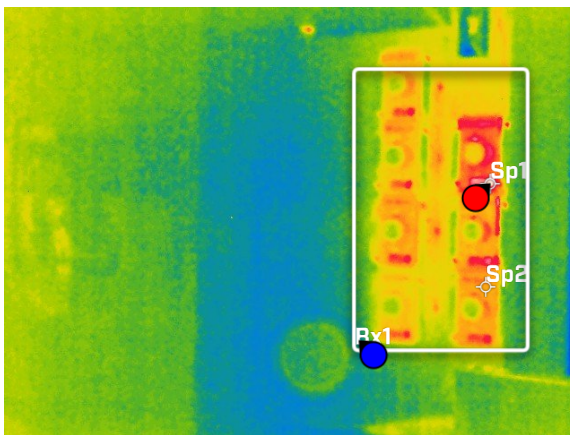

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity 0.95
Distance 7.50 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 41 / 271

Visual Photo


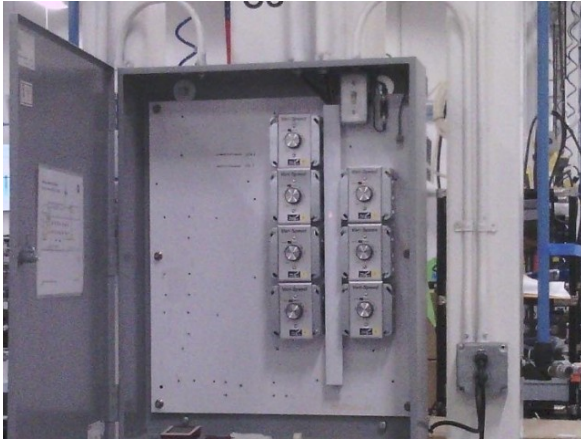


Equipment name : Production 204
Device name : 1010
Measurement Point : Fan Control A
Status OK

Measurements

Bx1	
Max	74.0 °F
Min	68.3 °F
Area	1.891 ft ²
Dt1	
Bx1.Max	5.6 °F
-Bx1.Min	
Sp1	71.9 °F
Sp2	71.6 °F

Thermogram 31 Created: 5/20/2026 1:48:17 PM

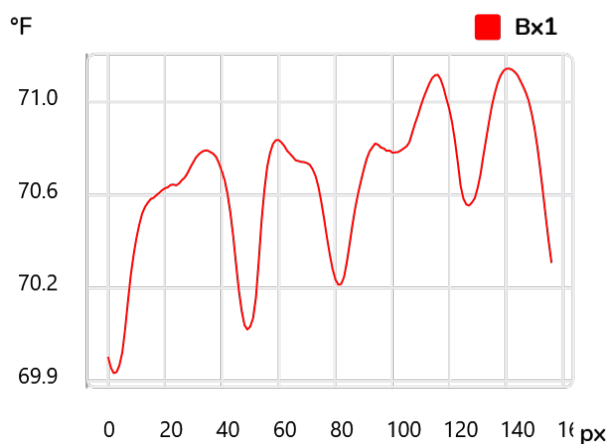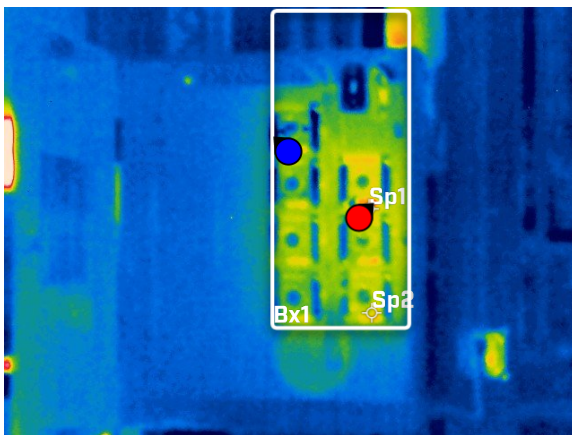

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 9.17 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 42 / 271

Visual Photo





Equipment name : Production 204
Device name : 1011
Measurement Point : Fan Control B
Status OK

Measurements

Bx1	
Max	73.6 °F
Min	68.4 °F
Area	1.984 ft ²
Dt1	
Bx1.Max	5.2 °F
-Bx1.Min	
Sp1	70.4 °F

Thermogram 32 Created: 5/20/2026 1:51:48 PM

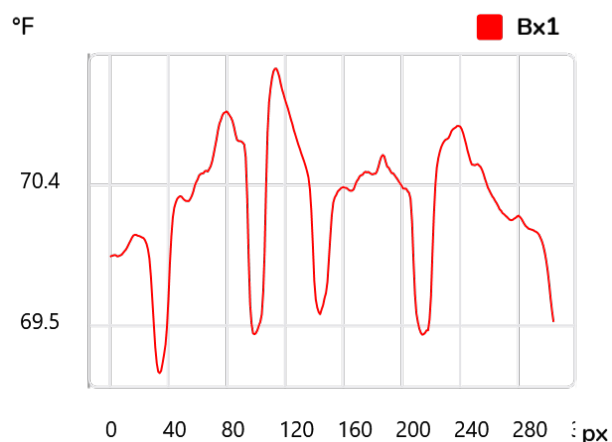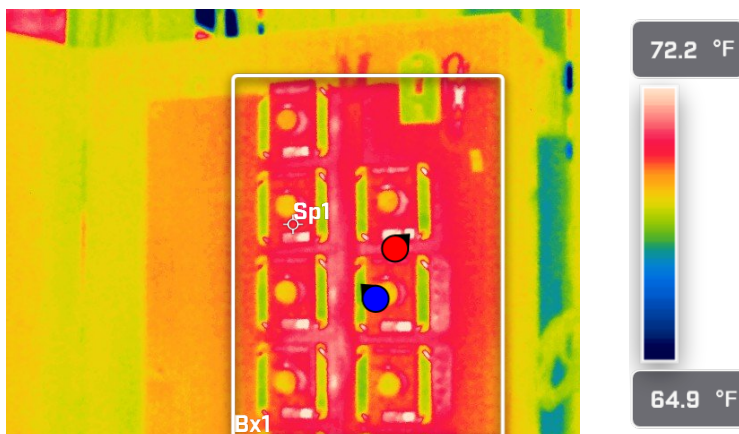

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	6.31 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 43 / 271

Visual Photo





Equipment name : Production 204
Device name : 1011
Measurement Point : Fan Control B
Status OK

Measurements

Bx1	
Max	73.3 °F
Min	68.5 °F
Area	1.817 ft ²
Dt1	
Bx1.Max	4.8 °F
-Bx1.Min	
Sp1	71.7 °F

Thermogram 33 Created: 5/20/2026 1:52:18 PM

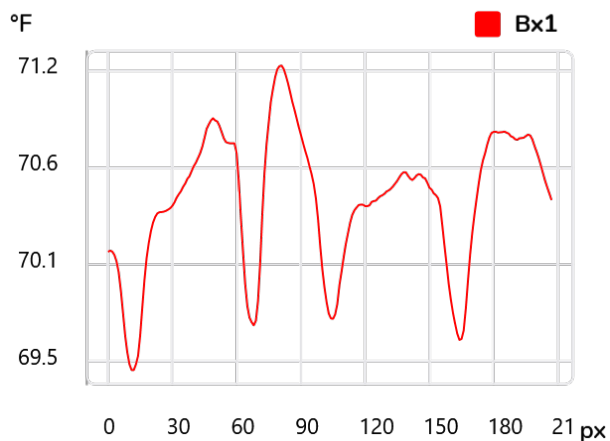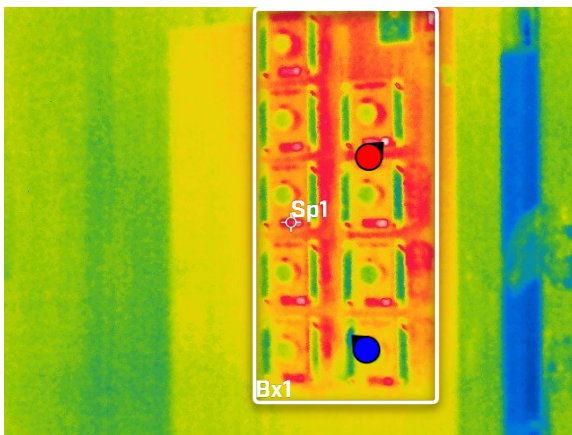

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	7.02 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 44 / 271

Visual Photo





Equipment name : Production 204
Device name : 1012
Measurement Point : LZ-4A
Status OK

Measurements

Bx1	
Max	76.8 °F
Min	70.9 °F
Area	0.498 ft ²
Dt1	
Bx1.Max	5.9 °F
-Bx1.Min	
Sp1	76.5 °F
Sp2	75.3 °F

Thermogram 34 Created: 5/14/2026 2:36:10 PM

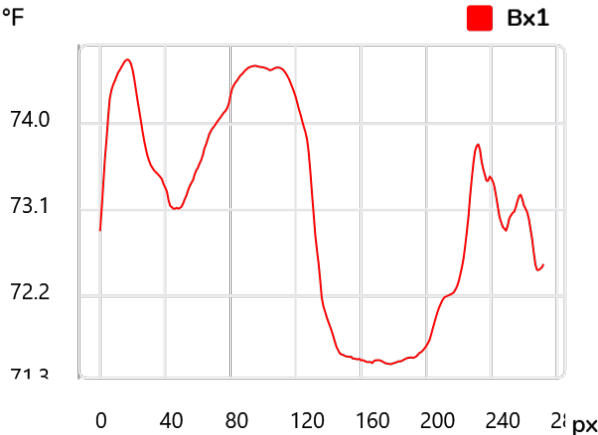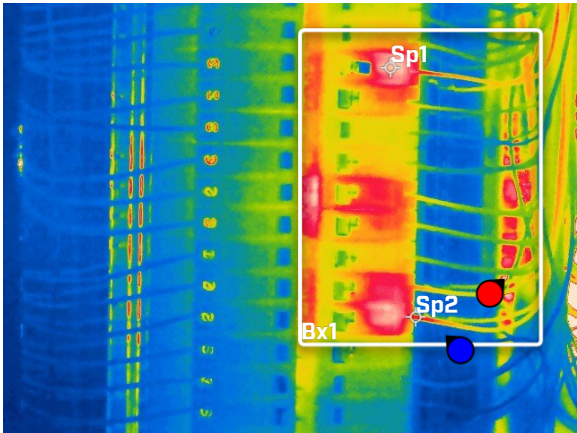

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 3.59 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 45 / 271

Visual Photo


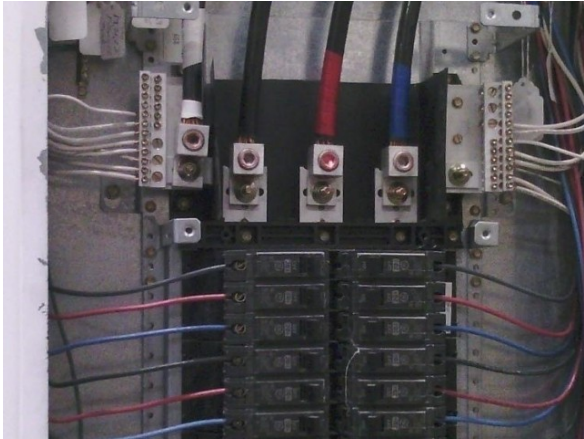


Equipment name : Production 204
Device name : 1012
Measurement Point : LZ-4A
Status OK

Measurements

Value	
Bx1	
Max	79.8 °F
Min	70.0 °F
Area	0.808 ft²
Sp1	74.2 °F
Sp2	73.0 °F

Thermogram 35 Created: 5/14/2026 2:43:02 PM

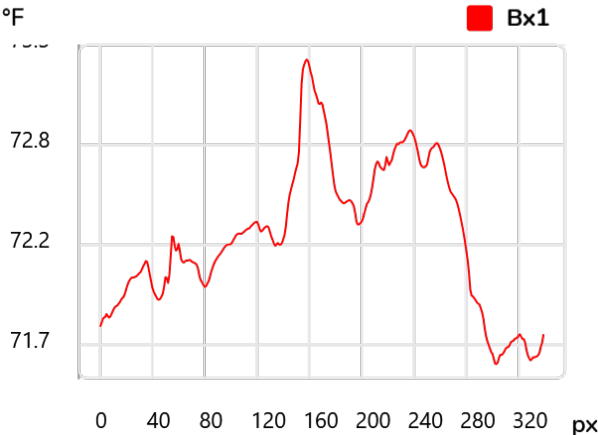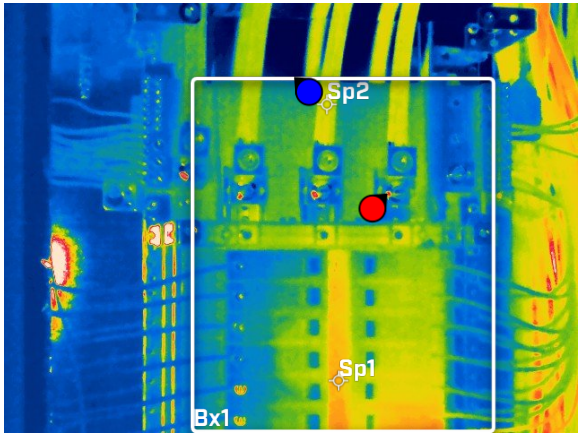

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	3.86 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 46 / 271

Visual Photo


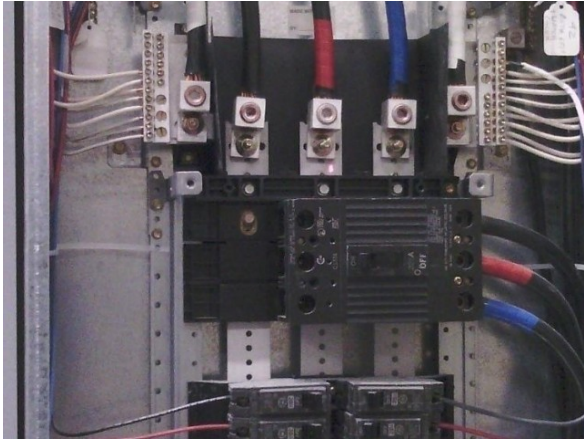


Equipment name : Production 204
Device name : 1013
Measurement Point : LZ-4B
Status OK

Measurements

Value	
Bx1	
Max	78.5 °F
Min	71.1 °F
Area	1.109 ft²
Sp1	75.6 °F

Thermogram 36 Created: 5/14/2026 2:54:40 PM

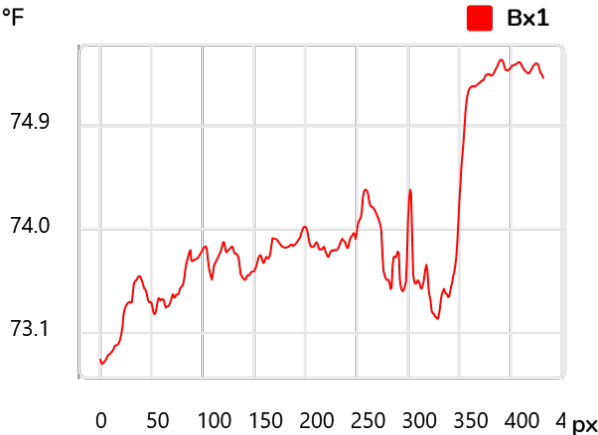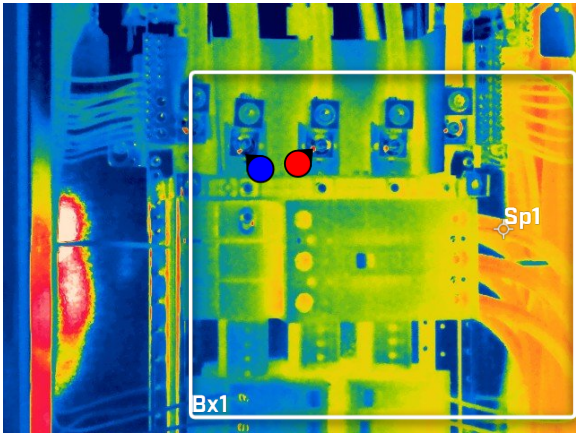

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters


Emissivity 0.95
Distance 4.05 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 47 / 271

Visual Photo


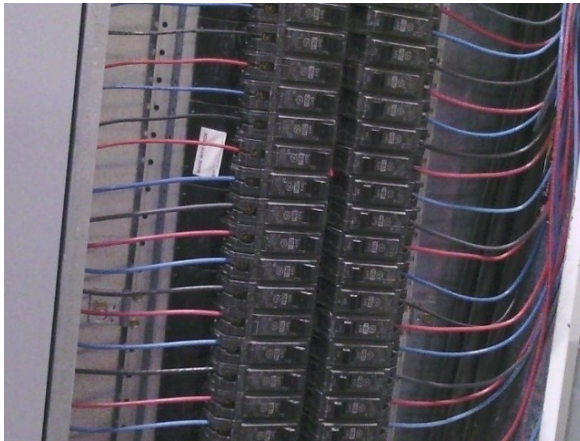


Equipment name : Production 204
Device name : 1013
Measurement Point : LZ-4B
Status OK

Measurements

Bx1	
Max	84.2 °F
Min	70.4 °F
Area	1.425 ft ²
Dt1	
Bx1.Max	13.7 °F
-Bx1.Min	
Sp1	83.9 °F
Sp2	70.6 °F

Thermogram 37 Created: 5/14/2026 2:57:02 PM

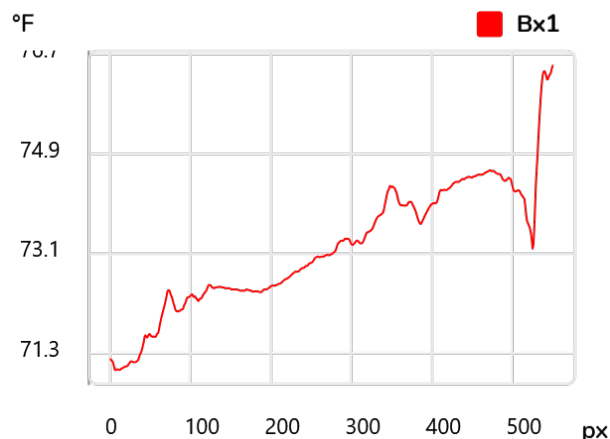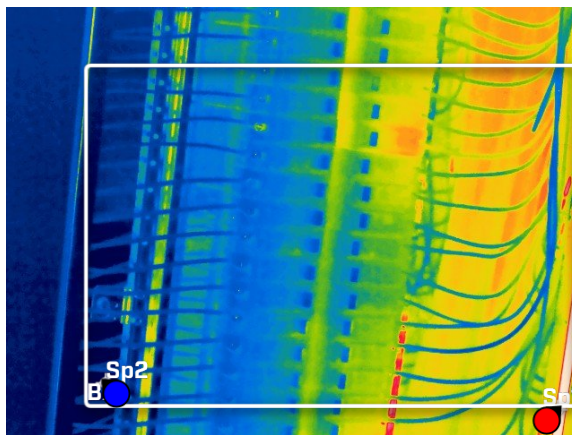

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 4.10 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 48 / 271

Visual Photo


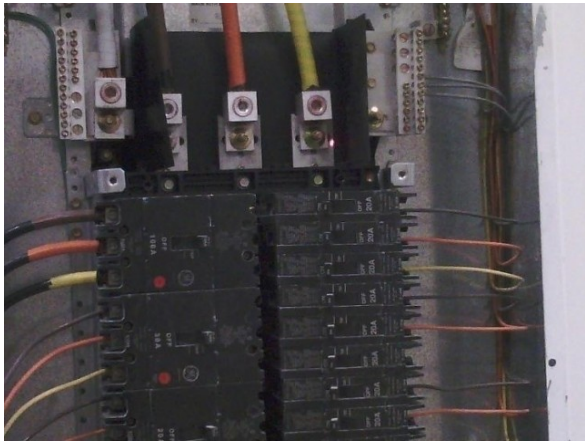


Equipment name : Production 204
Device name : 1014
Measurement Point : HZ-4
Status Note

Measurements

Bx1	
Max	78.8 °F
Min	69.3 °F
Area	1.325 ft ²
Dt1	
Bx1.Max	9.5 °F
-Bx1.Min	
Sp1	76.8 °F
Sp2	75.7 °F

Thermogram 38 Created: 5/14/2026 3:14:16 PM

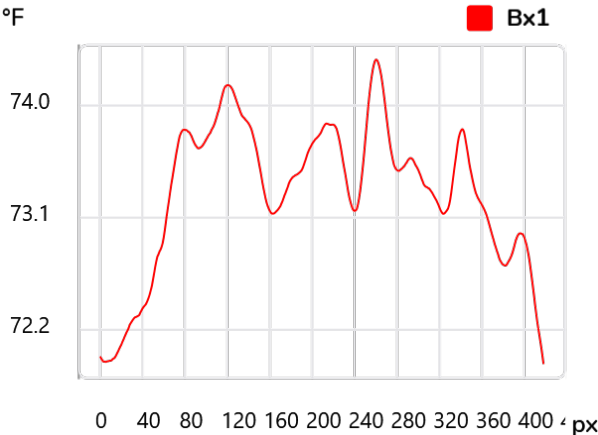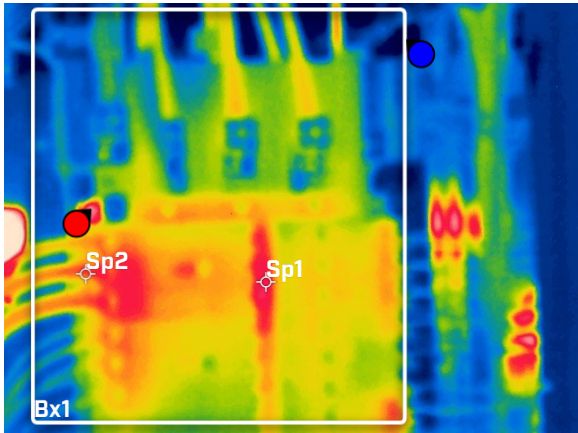

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Check connection on left side. Possibly dirty or loose.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 4.12 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 49 / 271

Visual Photo


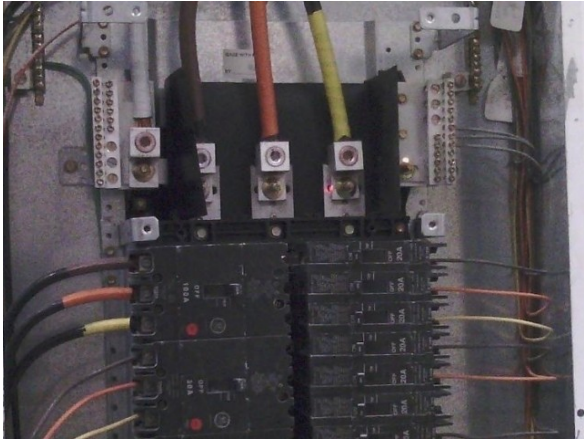


Equipment name : Production 204
Device name : 1014
Measurement Point : HZ-4
Status Note

Measurements

Bx1	
Max	81.0 °F
Min	70.3 °F
Area	1.118 ft ²
Dt1	
Bx1.Max	10.7 °F
-Bx1.Min	
Sp1	75.7 °F

Thermogram 39 Created: 5/14/2026 3:14:56 PM

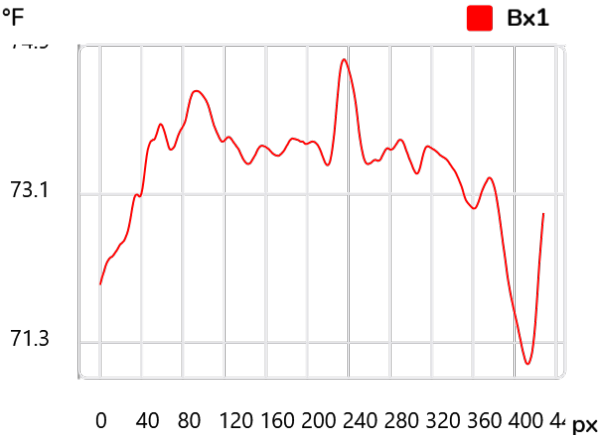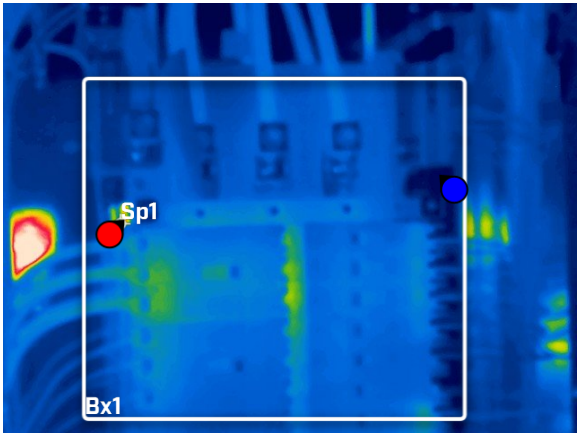

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Check connection on left side. Possibly dirty or loose.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 4.12 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 50 / 271

Visual Photo


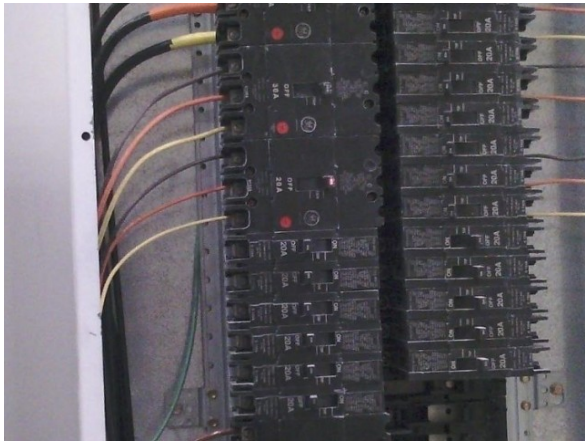


Equipment name : Production 204
Device name : 1014
Measurement Point : HZ-4
Status Note

Measurements

Bx1	
Max	77.8 °F
Min	70.6 °F
Area	0.475 ft²
Dt1	
Bx1.Max	7.2 °F
-Bx1.Min	
Sp1	75.6 °F

Thermogram 40 Created: 5/14/2026 3:15:28 PM

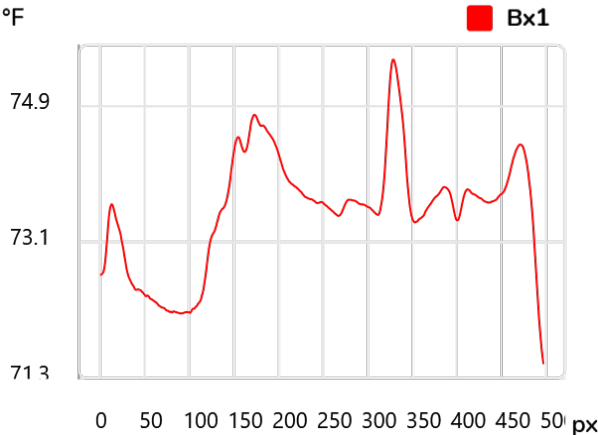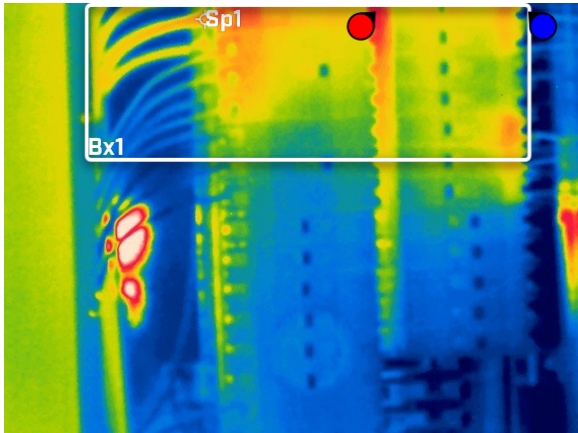

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Check connection on left side. Possibly dirty or loose.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 3.67 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 51 / 271

Visual Photo


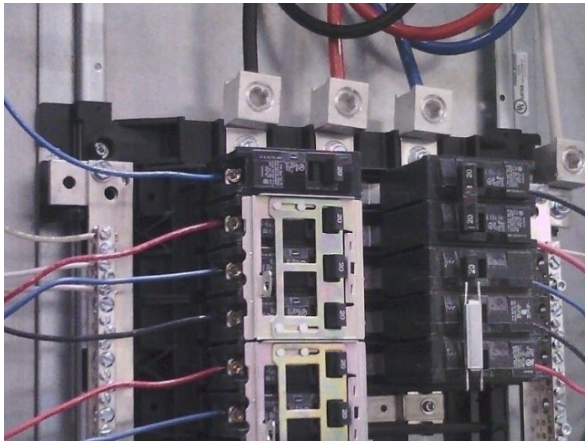


Equipment name : Production 204
Device name : 1014
Measurement Point : HZ-4
Status Note

Measurements

Bx1	
Max	90.3 °F
Min	68.2 °F
Area	0.835 ft ²
Dt1	
Bx1.Max	22.1 °F
-Bx1.Min	
Sp1	74.4 °F

Thermogram 41 Created: 5/14/2026 3:28:19 PM

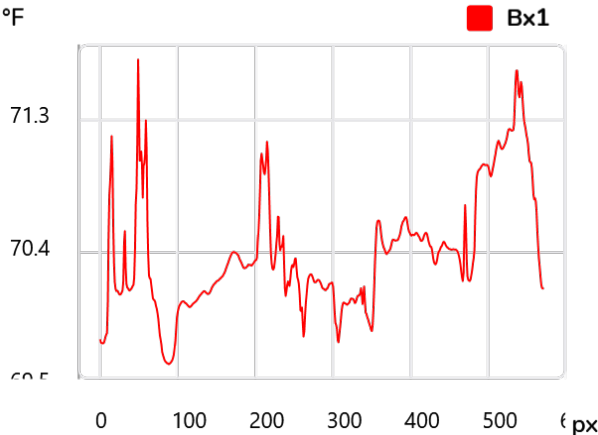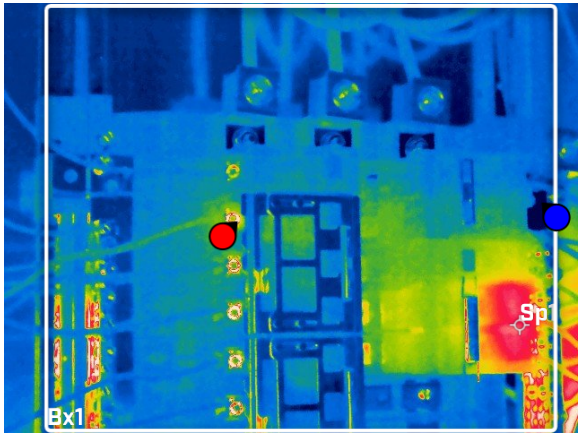

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Check connection on left side. Possibly dirty or loose.
Priority 2-Intermediate/Investigate

Parameters


Emissivity 0.95
Distance 2.76 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 52 / 271

Visual Photo


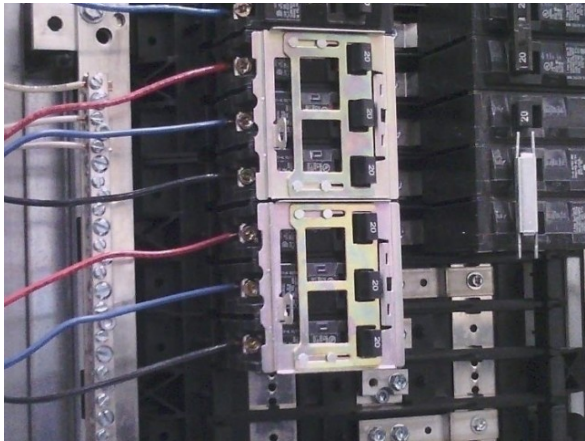


Equipment name : Production 204
Device name : 1015
Measurement Point : LZ-4C
Status Note

Measurements

Bx1	
Max	85.0 °F
Min	69.0 °F
Area	0.406 ft²
Dt1	
Bx1.Max -Bx1.Min	16.0 °F
Sp1	78.1 °F
Sp2	79.9 °F
Sp3	76.6 °F

Thermogram 42 Created: 5/14/2026 3:29:25 PM

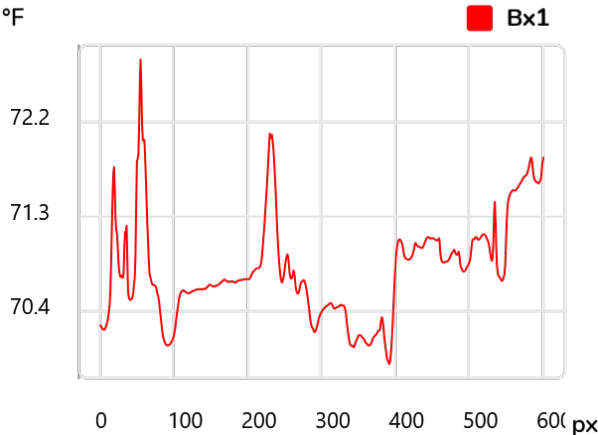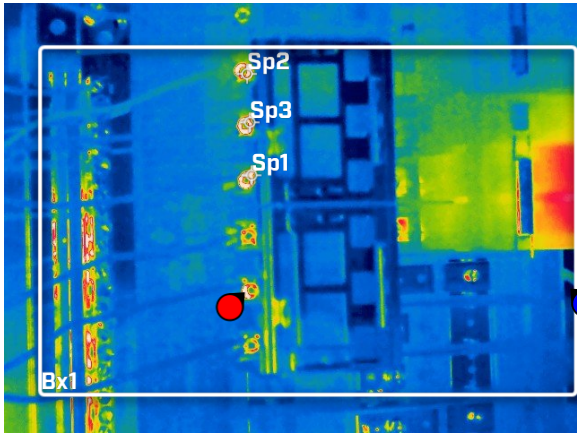

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Check connections on left side
Priority 2-Intermediate/Investigate

Parameters


Emissivity	0.95
Distance	2.07 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 53 / 271

Visual Photo


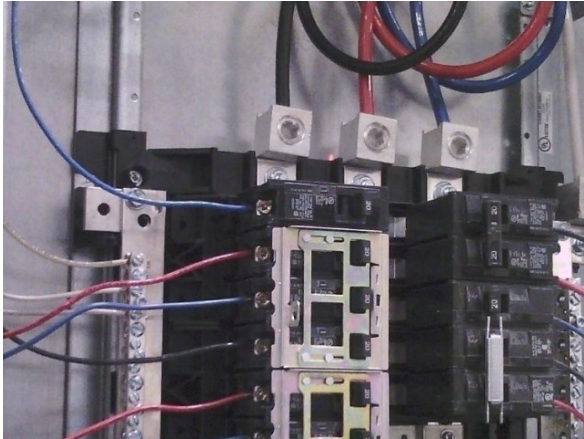


Equipment name : Production 204
Device name : 1015
Measurement Point : LZ-4C
Status Note

Measurements

Bx1	
Max	89.0 °F
Avg	71.0 °F
Min	68.8 °F
Dt1	
Bx1.Max -Bx1.Min	20.2 °F
Sp1	82.7 °F
Sp2	71.8 °F

Thermogram 43 Created: 5/14/2026 3:30:23 PM

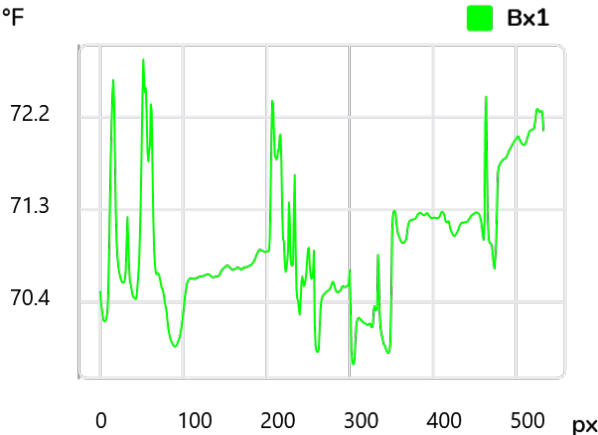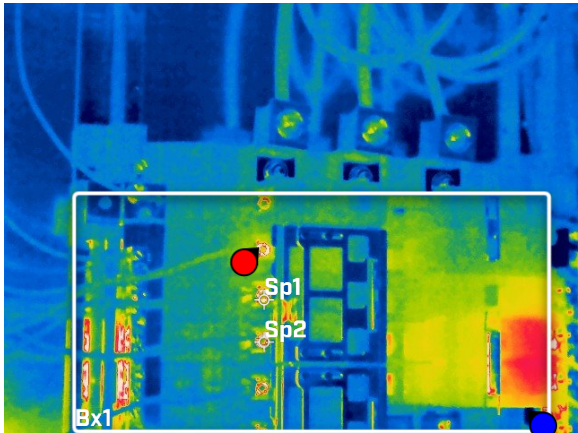

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Check connections on left side
Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.02 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 54 / 271

Visual Photo





Equipment name : Production 204
Device name : 1016
Measurement Point : Transformer North #1
Status OK

Measurements

Bx1	
Max	122.4 °F
Min	70.6 °F
Area	0.908 ft²
Dt1	
Bx1.Max	51.8 °F
-Bx1.Min	
Sp1	107.2 °F

Thermogram 45 Created: 5/15/2026 9:15:13 AM

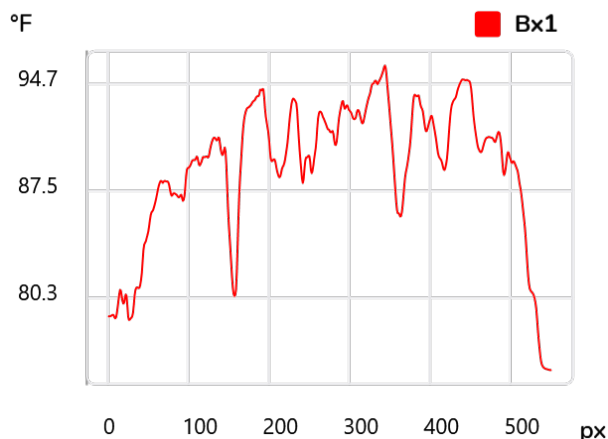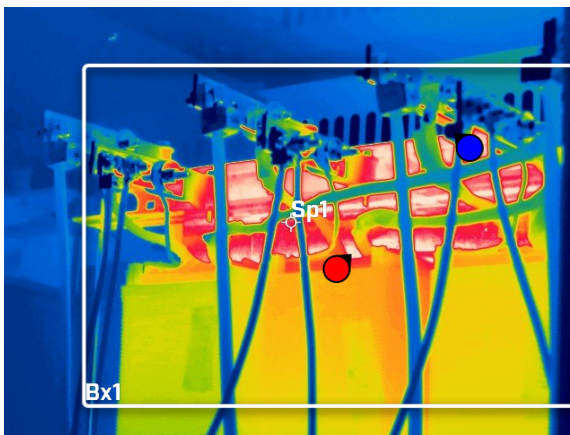

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity 0.95
Distance 3.27 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 55 / 271

Visual Photo





Equipment name : Production 204
Device name : 1016
Measurement Point : Transformer North #1
Status OK

Measurements

Bx1	
Max	123.1 °F
Min	70.9 °F
Area	1.103 ft ²
Dt1	
Bx1.Max	52.2 °F
-Bx1.Min	
Sp1	93.9 °F

Thermogram 46 Created: 5/15/2026 9:15:56 AM

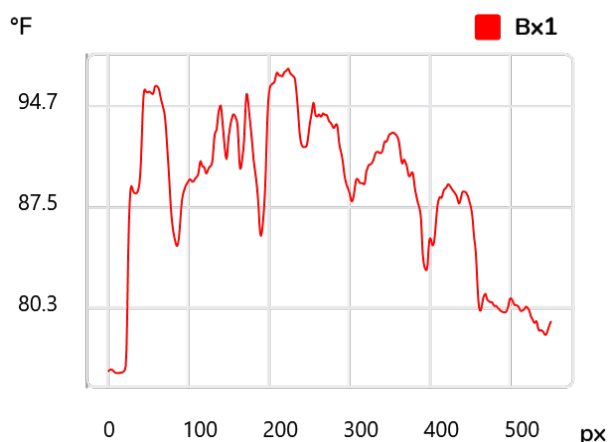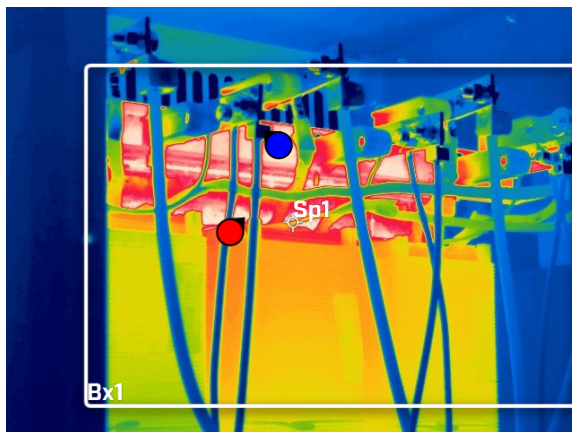

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	3.60 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 56 / 271

Visual Photo



Equipment name : Production 204
Device name : 1017
Measurement Point : Transformer North #2
Status OK



Measurements

Value

Bx1

Max 92.5 °F
Min 70.0 °F
Area 3.145 ft²
Sp1 88.1 °F

Thermogram 48 Created: 5/15/2026 9:24:12 AM

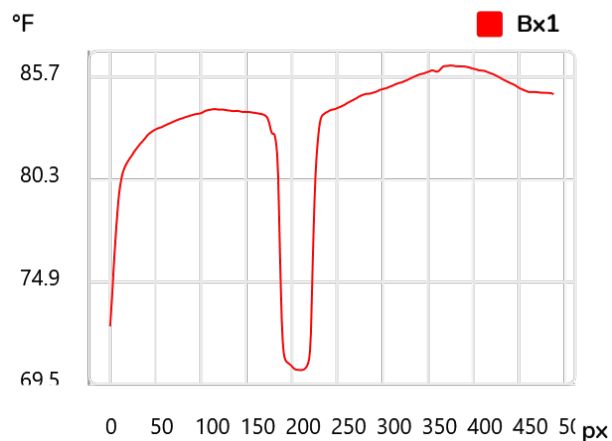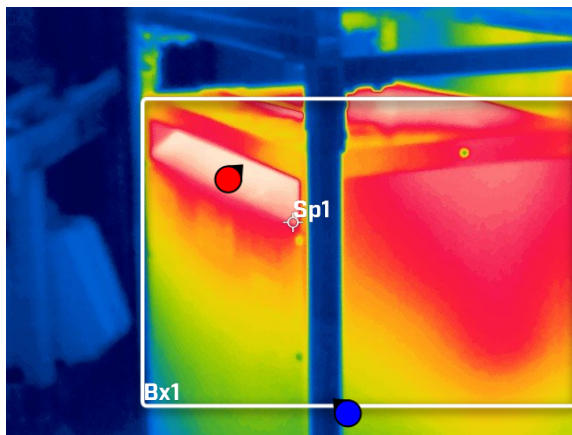

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 6.80 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 57 / 271

Visual Photo





Equipment name : Styli Lab 201
Device name : 1019
Measurement Point : SilverCut Saw
Status Note

Measurements

Bx1	
Max	144.8 °F
Min	70.4 °F
Area	2.527 ft ²
Dt1	
Bx1.Max -Bx1.Min	74.4 °F
Sp1	95.6 °F
Sp2	113.6 °F

Thermogram 49 Created: 5/20/2026 8:23:50 AM

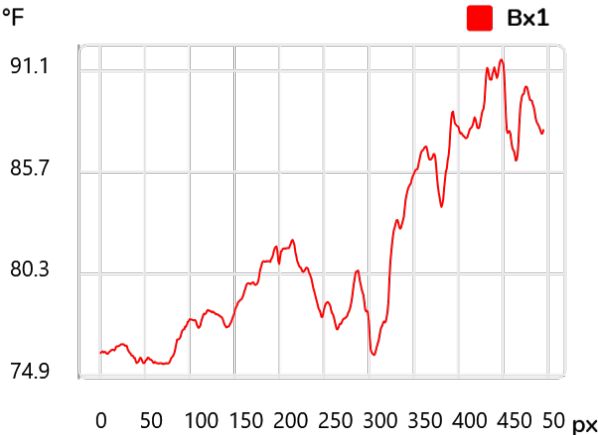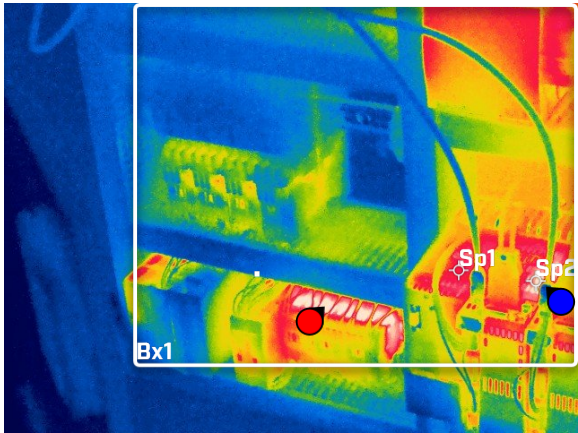

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Check connection on hot spot.
Priority 2-Intermediate/Investigate

Parameters


Emissivity	0.95
Distance	5.60 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 58 / 271

Visual Photo

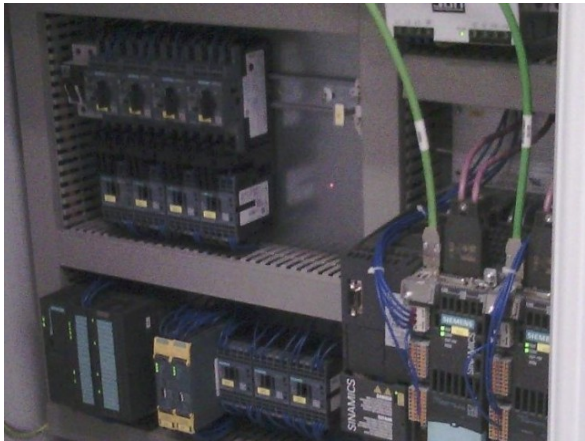


Equipment name : Styli Lab 201
Device name : 1019
Measurement Point : SilverCut Saw
Status Note

Measurements

Bx1	
Max	140.4 °F
Min	70.1 °F
Area	1.920 ft ²
Dt1	
Bx1.Max	70.3 °F
-Bx1.Min	
Sp1	117.1 °F
Sp2	117.3 °F
Sp3	132.3 °F

Thermogram 50 Created: 5/20/2026 8:27:35 AM

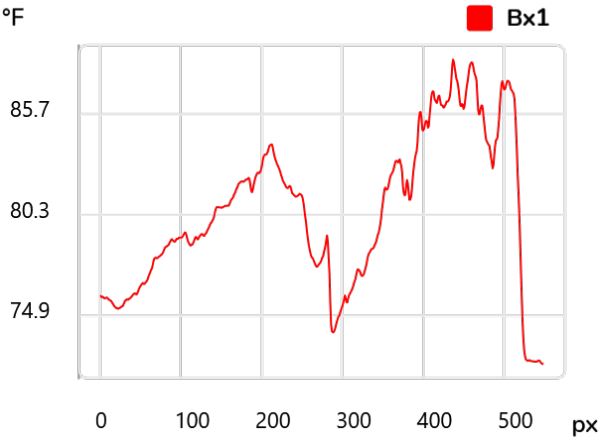

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Check connection on hot spot.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.62 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 59 / 271

Visual Photo





Equipment name : Styli Lab 201
Device name : 1020
Measurement Point : Memmert Curing Oven #1
Status OK

Measurements

Bx1	
Max	80.5 °F
Min	64.7 °F
Area	0.920 ft ²
Dt1	
Bx1.Max	15.8 °F
-Bx1.Min	
Sp1	73.7 °F
Sp2	72.9 °F

Thermogram 51 Created: 5/20/2026 8:30:40 AM

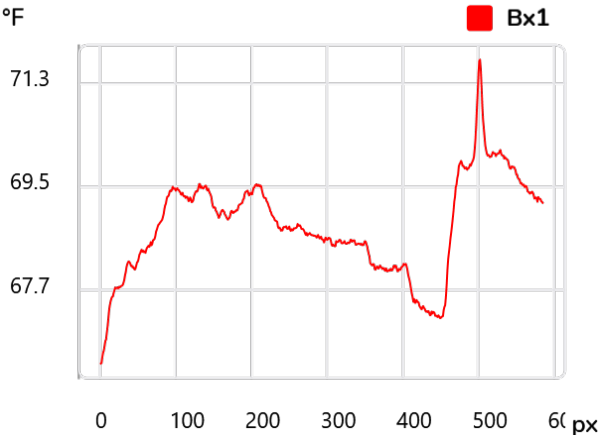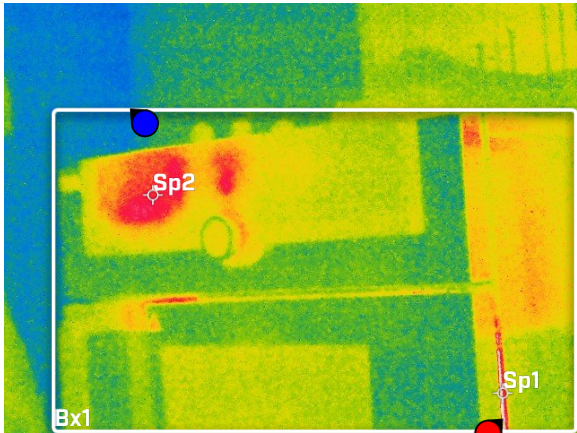

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 60 / 271

Visual Photo





Equipment name : Styli Lab 201
Device name : 1020
Measurement Point : Memmert Curing
Oven #1
Status OK

Measurements

Bx1	
Max	76.2 °F
Min	63.9 °F
Area	1.989 ft ²
Dt1	
Bx1.Max	12.3 °F
-Bx1.Min	
Sp1	73.4 °F

Thermogram 52 Created: 5/20/2026 8:31:28 AM

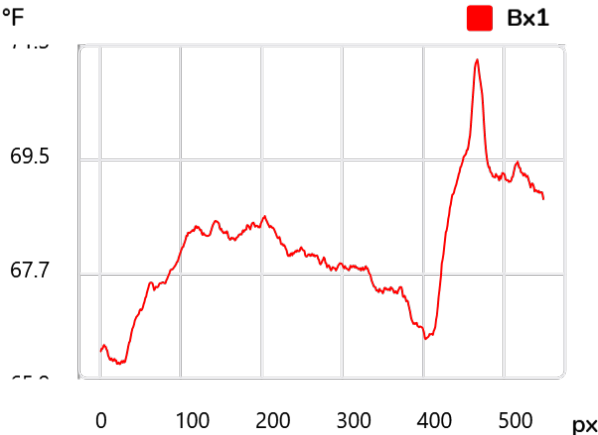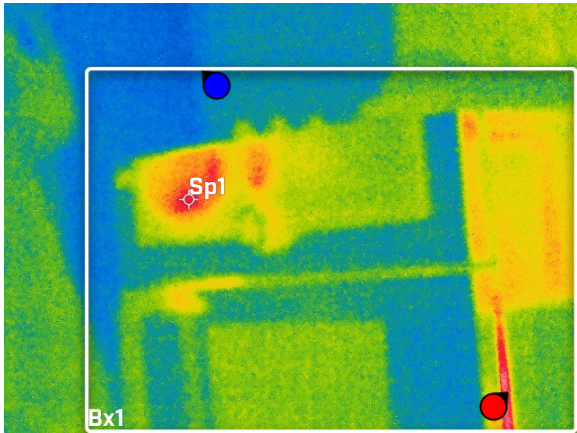

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity 0.95
Distance 4.70 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 61 / 271

Visual Photo





Equipment name : Styli Lab 201
Device name : 1020
Measurement Point : Memmert Curing
Oven #1
Status OK

Measurements

Bx1	
Max	78.1 °F
Min	65.5 °F
Area	2.820 ft ²
Dt1	
Bx1.Max	12.6 °F
-Bx1.Min	
Sp1	70.2 °F

Thermogram 53 Created: 5/20/2026 8:32:28 AM

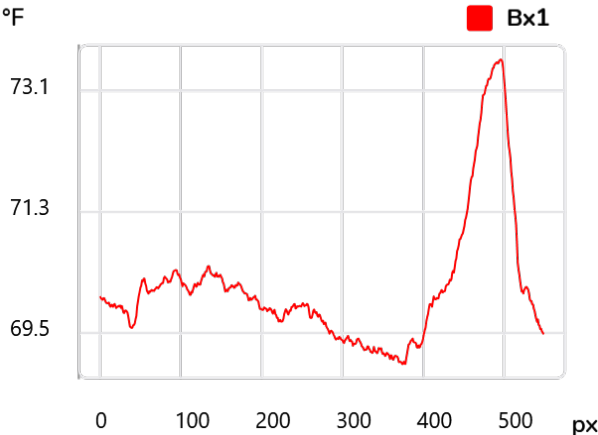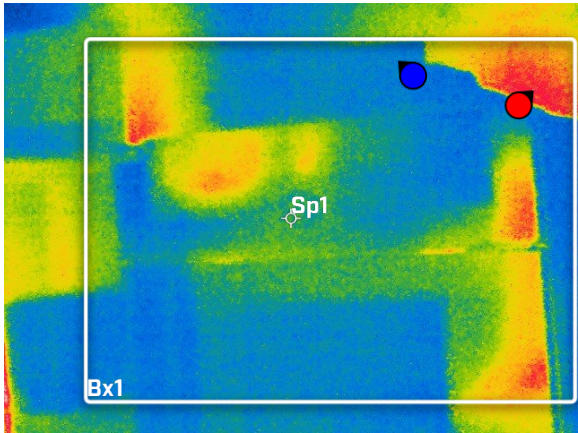

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	5.59 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 62 / 271

Visual Photo





Equipment name : Styli Lab 201
Device name : 1021
Measurement Point : Memmert Curing
Oven #2
Status OK

Measurements

Bx1	
Max	79.2 °F
Min	67.1 °F
Area	2.296 ft ²
Dt1	
Bx1.Max	12.1 °F
-Bx1.Min	
Sp1	78.0 °F

Thermogram 54 Created: 5/20/2026 8:32:54 AM

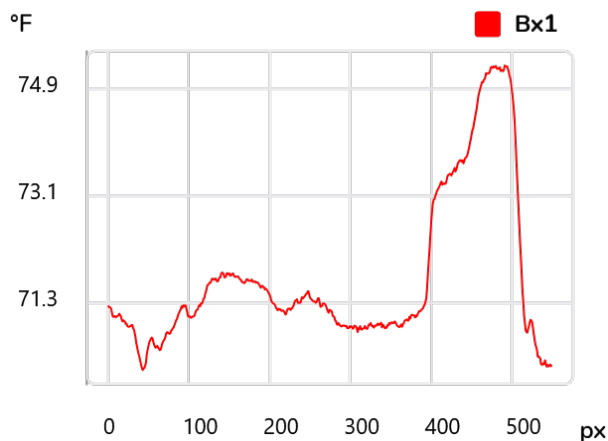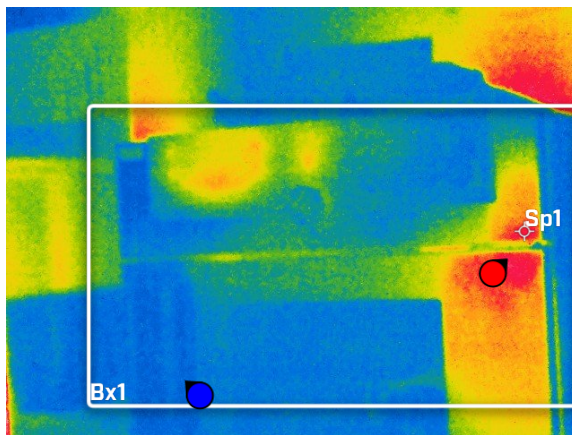

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	5.55 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 63 / 271

Visual Photo


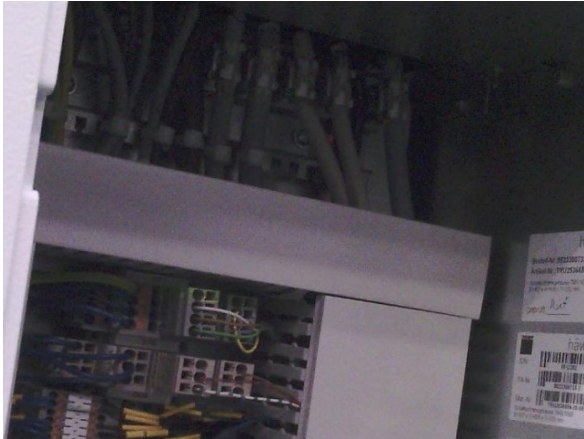


Equipment name : Styli Lab 201
Device name : 1022
Measurement Point : Trumark 5000 Laser
Status OK

Measurements

Value	
Bx1	
Max	82.1 °F
Min	70.7 °F
Area	0.467 ft²
Sp1	79.8 °F
Sp2	79.8 °F

Thermogram 55 Created: 5/20/2026 8:35:53 AM

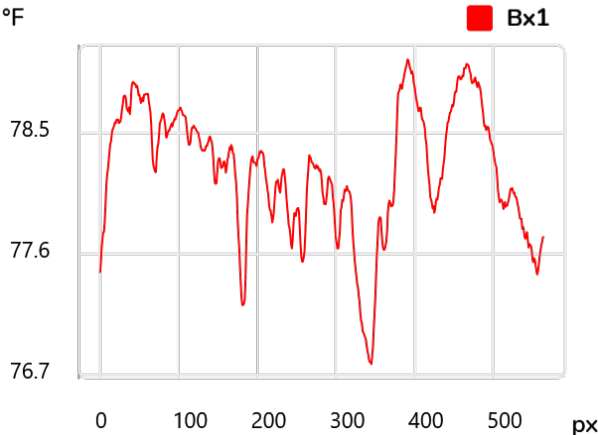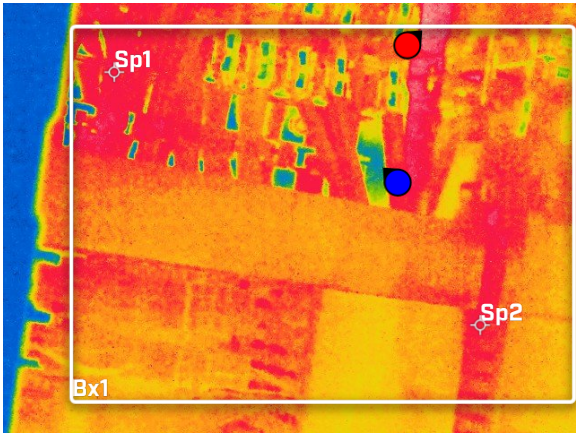

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	2.21 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 64 / 271

Visual Photo





Equipment name : Styli Lab 201
Device name : 1023
Measurement Point : Elma Ultrasonic Washer
Status OK

Measurements

Value	
Bx1	
Max	81.9 °F
Min	67.6 °F
Area	0.437 ft²
Sp1	78.0 °F

Thermogram 56 Created: 5/20/2026 8:38:31 AM

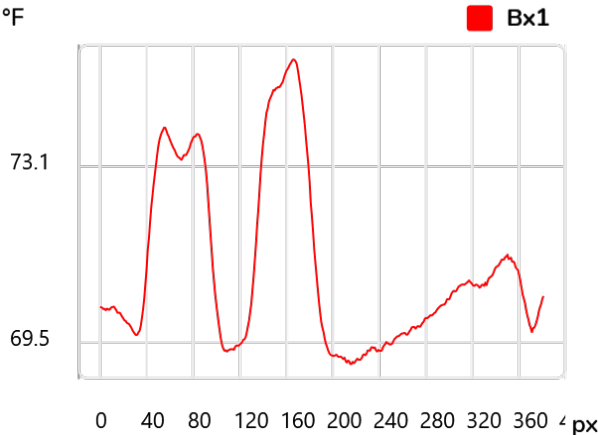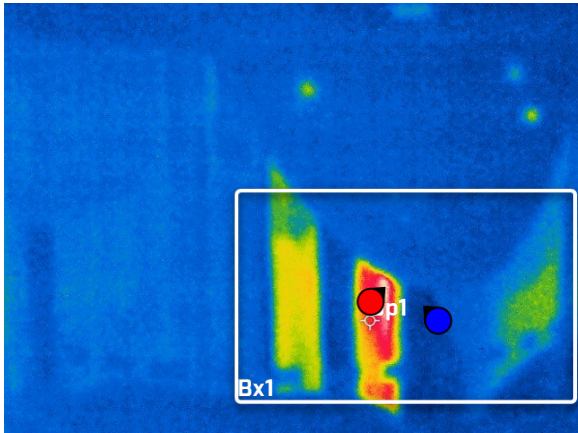

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.45 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 65 / 271

Visual Photo



Equipment name : Styli Lab 201

Device name : 1023



Measurement Point : Elma Ultrasonic Washer

Status OK

Measurements

Value	
Bx1	
Max	92.9 °F
Min	67.8 °F
Area	1.309 ft²
Sp1	70.8 °F

Thermogram 57 Created: 5/20/2026 8:40:44 AM

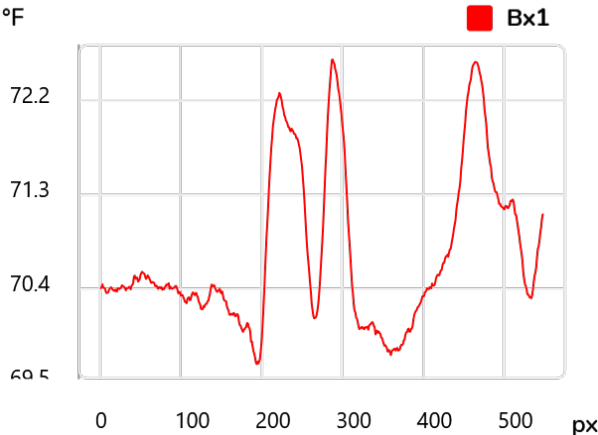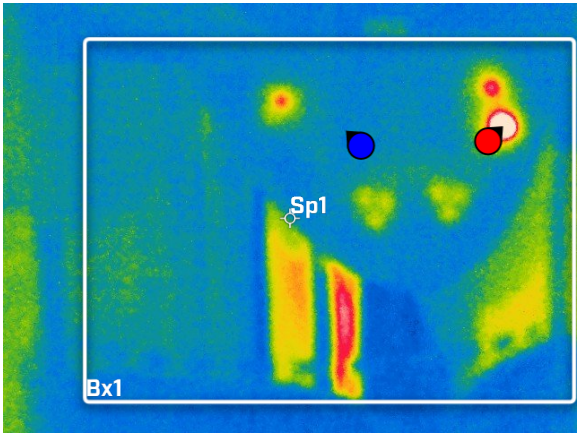

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	3.81 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 66 / 271

Visual Photo


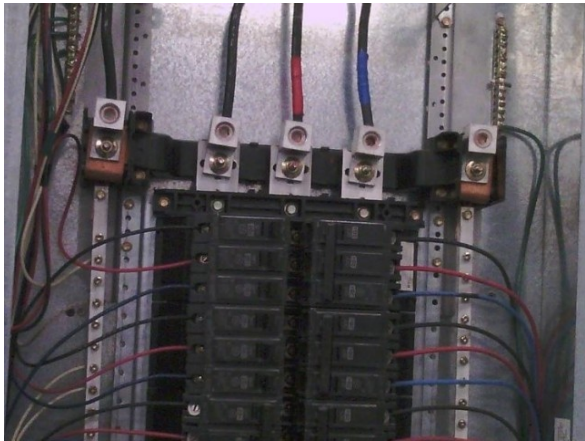


Equipment name : Styli Lab 201
Device name : 1024
Measurement Point : LP-4a
Status OK

Measurements

Bx1	
Max	81.2 °F
Min	68.4 °F
Area	1.687 ft ²
Dt1	
Bx1.Max	12.8 °F
-Bx1.Min	
Sp1	77.3 °F

Thermogram 58 Created: 5/15/2026 12:26:18 PM

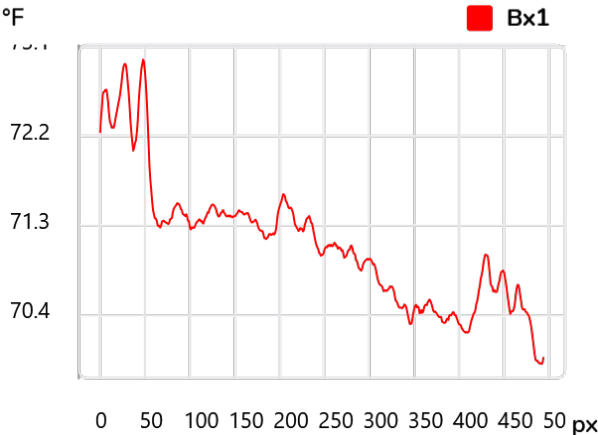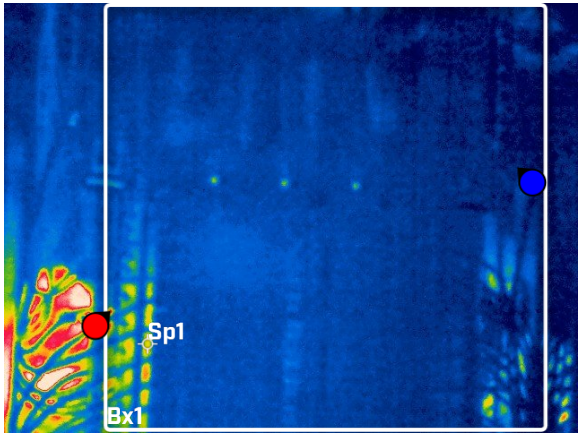

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	4.22 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 67 / 271

Visual Photo


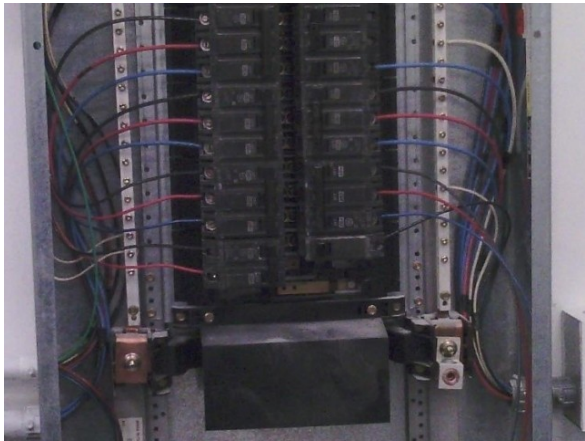


Equipment name : Styli Lab 201
Device name : 1024
Measurement Point : LP-4a
Status OK

Measurements

Bx1	
Max	85.5 °F
Min	69.2 °F
Area	1.929 ft ²
Dt1	
Bx1.Max	16.3 °F
-Bx1.Min	
Sp1	71.7 °F

Thermogram 59 Created: 5/15/2026 12:26:42 PM

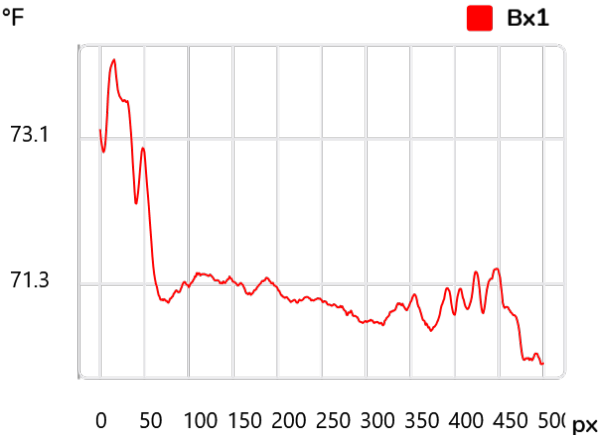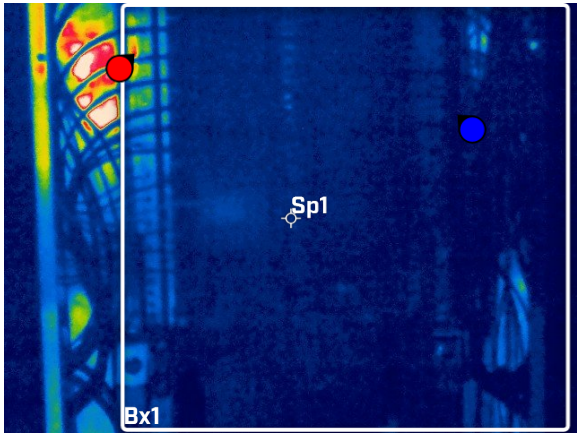

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	4.48 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 68 / 271

Visual Photo

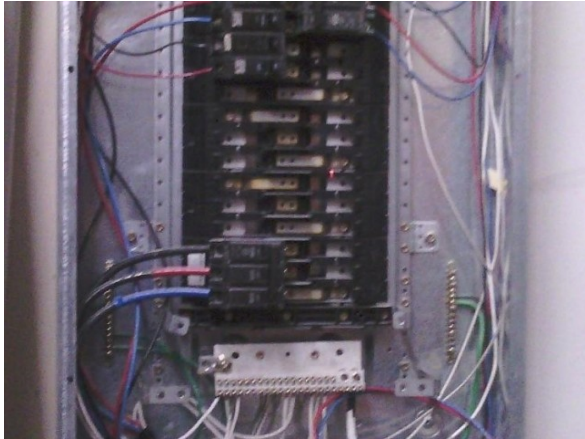

Equipment name : Mechanical Room 203

Device name : 1025



Measurement Point : L1

Status OK

Measurements

Bx1	
Max	80.4 °F
Min	66.9 °F
Area	1.433 ft²
Dt1	
Bx1.Max	13.5 °F
-Bx1.Min	
Sp1	74.6 °F

Thermogram 60 Created: 5/15/2026 10:00:50 AM

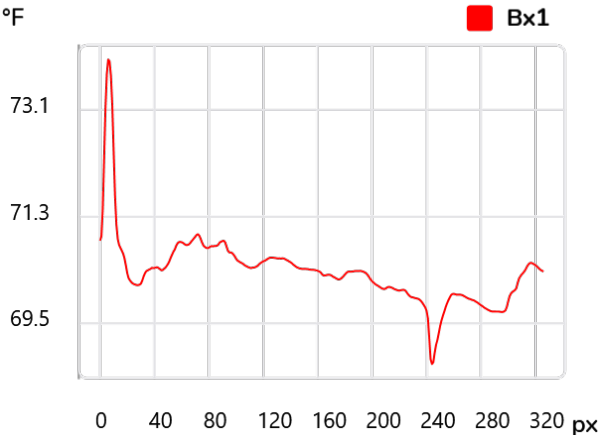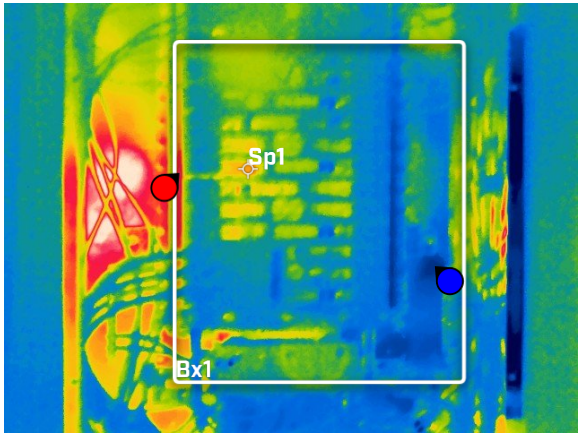

Camera information

Camera model FLIR E96

Lens FOL18

Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95

Distance 5.34 ft

Atmospheric temp. 68.0 °F


Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 69 / 271

Visual Photo

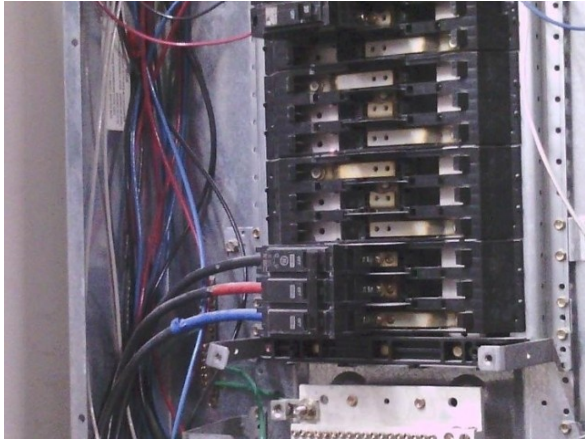

Equipment name : Mechanical Room 203

Device name : 1025



Measurement Point : L1

Status OK

Measurements

Bx1	
Max	74.1 °F
Min	69.3 °F
Area	0.589 ft ²
Dt1	
Bx1.Max	4.8 °F
-Bx1.Min	
Sp1	72.5 °F

Thermogram 61 Created: 5/15/2026 10:01:23 AM

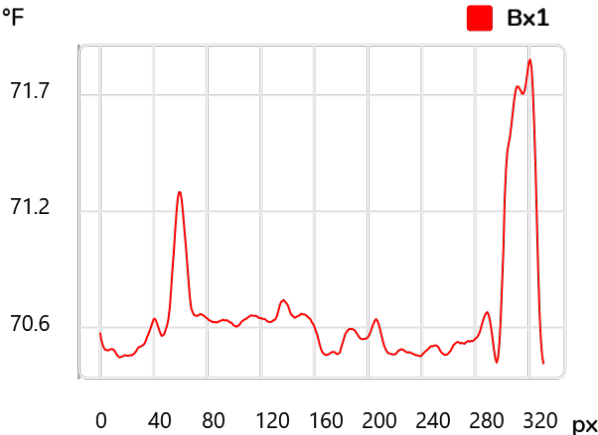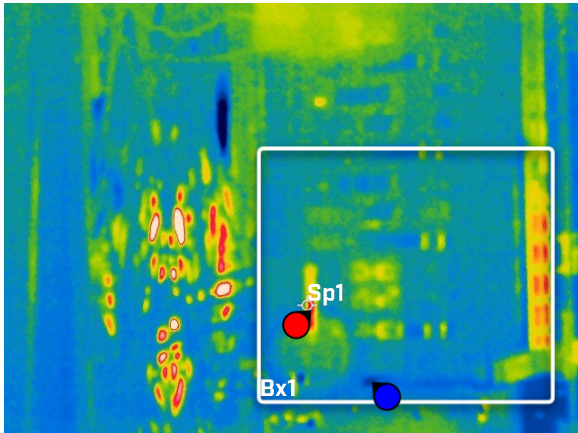

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.93 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 70 / 271

Visual Photo



Equipment name : Mechanical Room 203

Device name : 1026



Measurement Point : #1 Transformer

Status OK

Measurements

Bx1	
Max	82.0 °F
Min	71.8 °F
Area	1.631 ft ²
Dt1	
Bx1.Max	10.2 °F
-Bx1.Min	
Sp1	75.8 °F

Thermogram 62 Created: 5/15/2026 10:04:17 AM

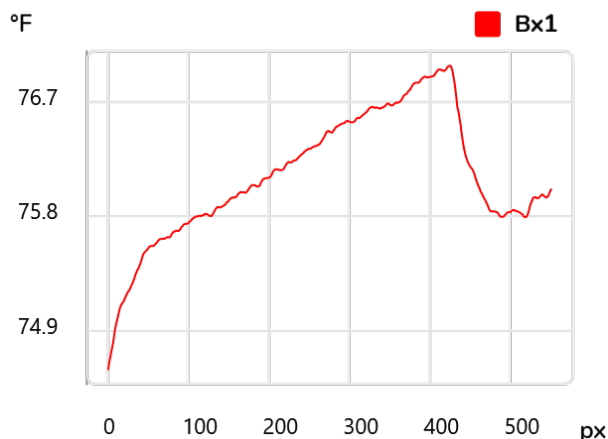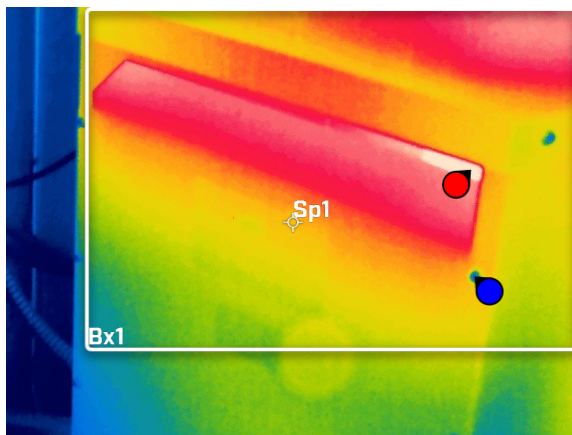

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	4.38 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 71 / 271

Visual Photo



Equipment name : Mechanical Room 203

Device name : 1026



Measurement Point : #1 Transformer

Status OK

Measurements

Bx1	
Max	81.8 °F
Min	70.6 °F
Area	2.811 ft ²
Dt1	
Bx1.Max	11.2 °F
-Bx1.Min	
Sp1	80.1 °F

Thermogram 63 Created: 5/15/2026 10:12:18 AM

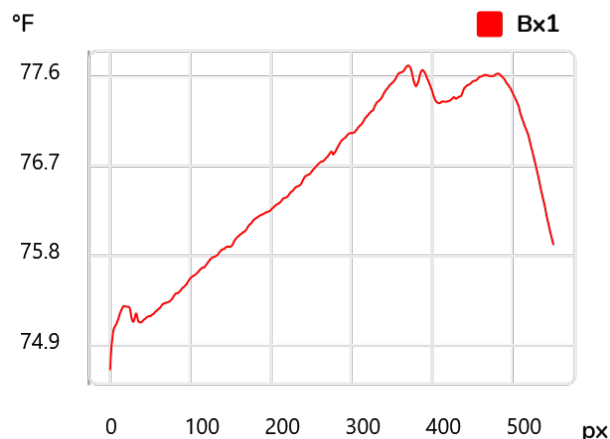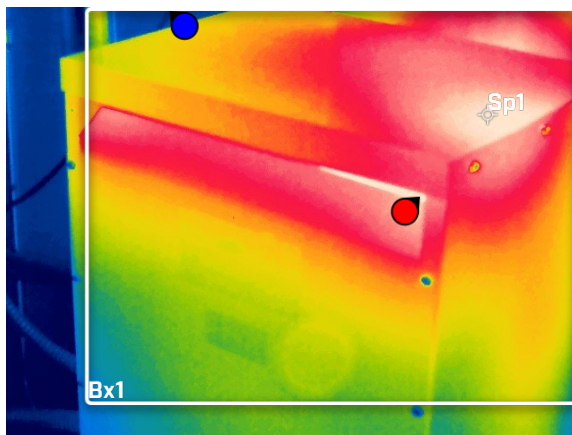

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	5.35 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 72 / 271

Visual Photo

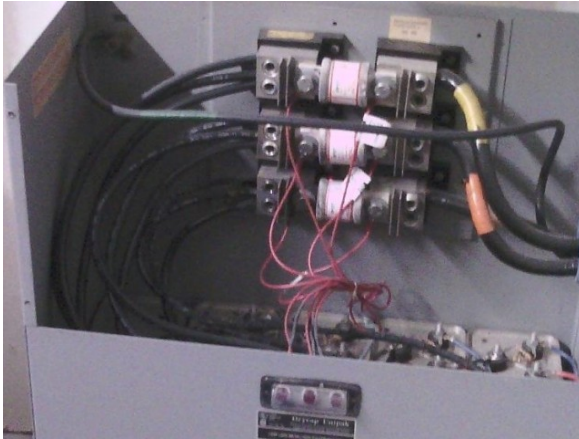

Equipment name : Mechanical Room 203

Device name : 1027

Measurement Point : #2 Transformer

Status Note

Measurements

Value

Bx1

Max 191.6 °F

Min 70.8 °F

Area 1.836 ft²



Sp1 131.2 °F

Sp2 137.3 °F

Sp3 99.4 °F

Thermogram 64

Created: 5/15/2026 10:30:13 AM

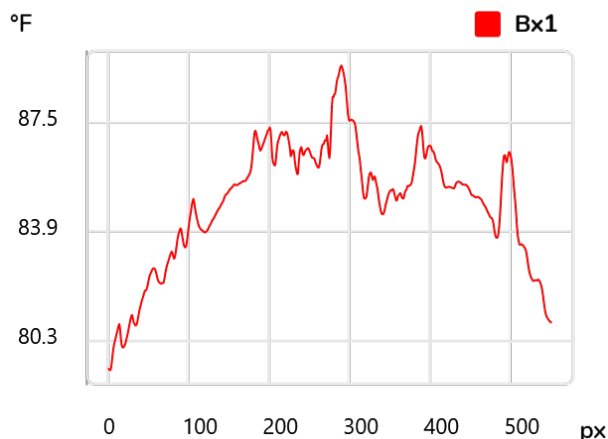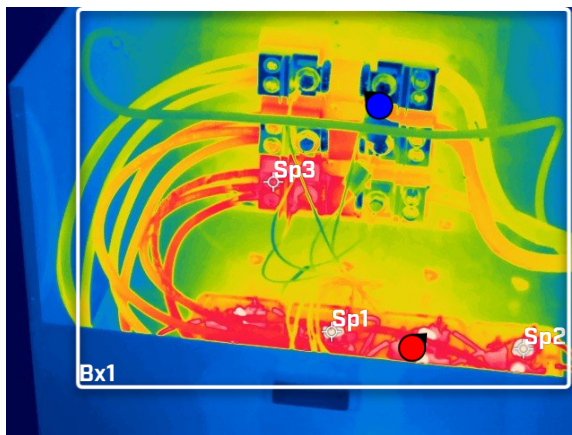

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Loose connection(s)

Recommended Action Inspect connections

Comment Inspect connections of lower phase. Could be loose connections or load imbalance.

Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 4.42 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%


FLIR00001-v1



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 73 / 271

Visual Photo

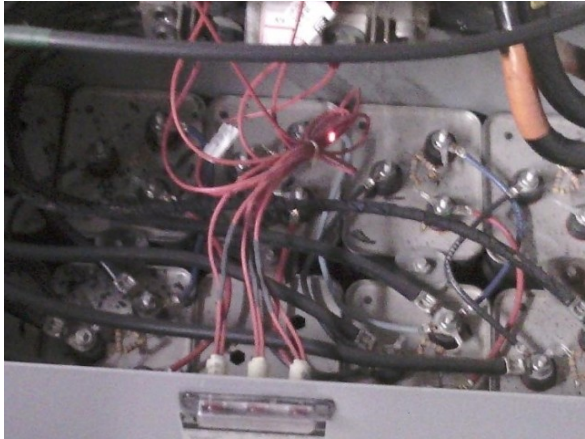



Equipment name : Mechanical Room 203
Device name : 1027
Measurement Point : #2 Transformer

Status Note

Measurements

Value	
Bx1	
Max	202.4 °F
Min	77.8 °F
Area	0.563 ft²
Sp1	186.0 °F
Sp2	184.1 °F
Sp3	189.5 °F

Thermogram 65 Created: 5/15/2026 10:32:40 AM

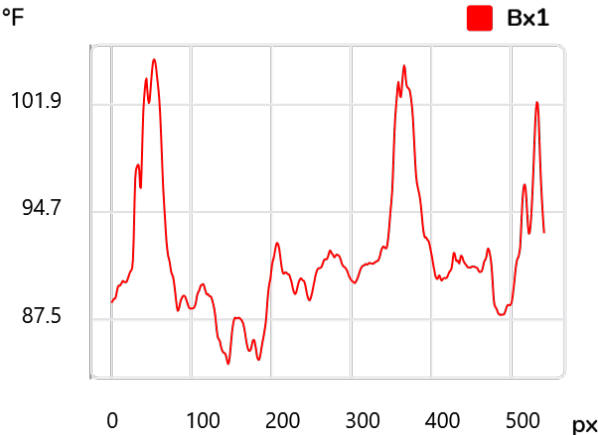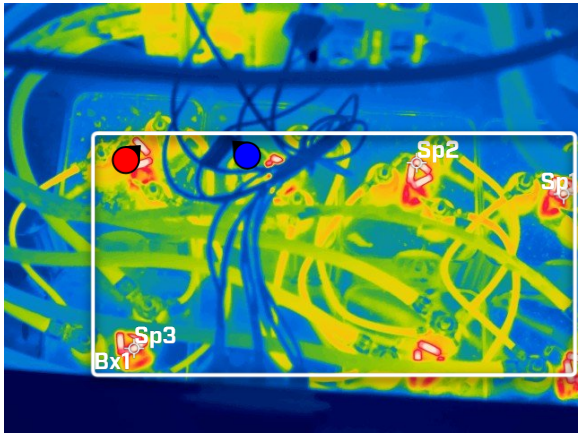

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Inspect connections of lower phase. Could be loose connections or load imbalance.
Priority 2-Intermediate/Investigate

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.08 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 74 / 271

Visual Photo




Equipment name : Mechanical Room 203

Device name : 1028

Measurement Point : Capacitor Disconnect


Status Note

Thermogram 66 Created: 5/15/2026 10:34:52 AM

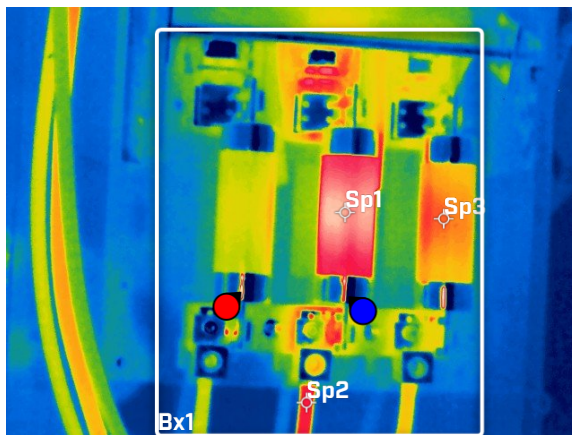

Measurements

Bx1	
Max	82.9 °F
Min	66.9 °F
Area	1.614 ft ²
Dt1	
Bx1.Max	16.1 °F
-Bx1.Min	
Sp1	79.8 °F
Sp2	77.5 °F
Sp3	76.4 °F

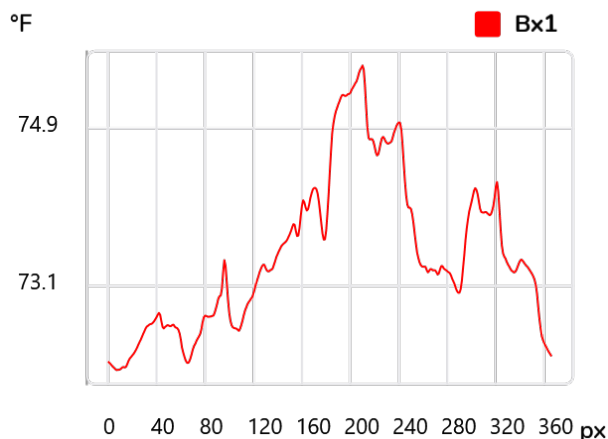

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action Monitor changes

Comment Continue to monitor. No immediate concern.

Priority 3 - Minor/Monitor

Parameters

Emissivity	0.95
Distance	4.90 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 75 / 271

Visual Photo



Equipment name : Mechanical Room 203

Device name : 1028

Measurement Point : Capacitor Disconnect

Status Note



Measurements

Value

Bx1

Max 79.6 °F
Min 69.0 °F
Area 2.777 ft²
Sp1 72.9 °F

Thermogram 67 Created: 5/15/2026 10:35:51 AM

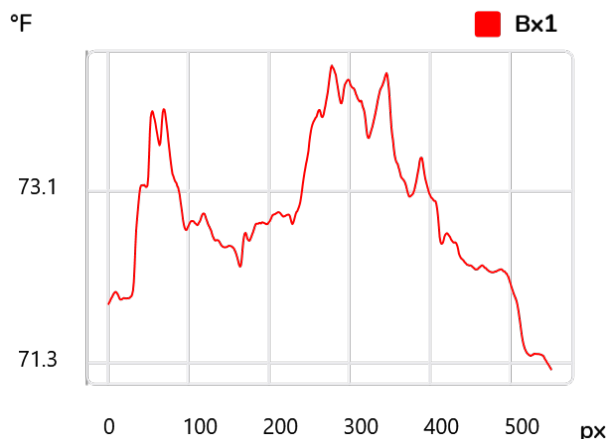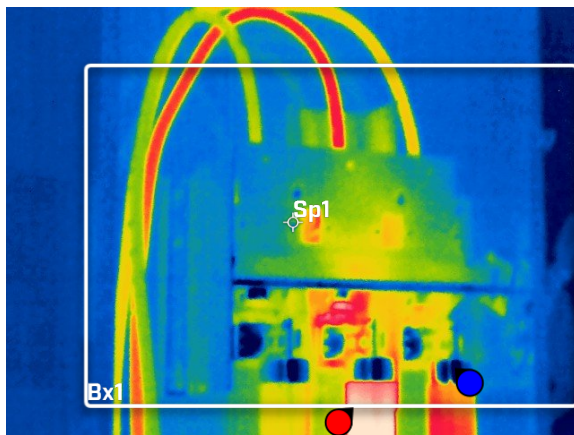

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action Monitor changes

Comment Continue to monitor. No immediate concern.

Priority 3 - Minor/Monitor

Parameters

Emissivity 0.95
Distance 5.72 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 76 / 271

Visual Photo



Equipment name : Mechanical Room 203

Device name : 1028



Measurement Point : Capacitor Disconnect

Status Note

Measurements

Bx1	
Max	92.5 °F
Min	66.9 °F
Area	0.824 ft²
Sp1	79.2 °F

Thermogram 68 Created: 5/15/2026 10:39:25 AM

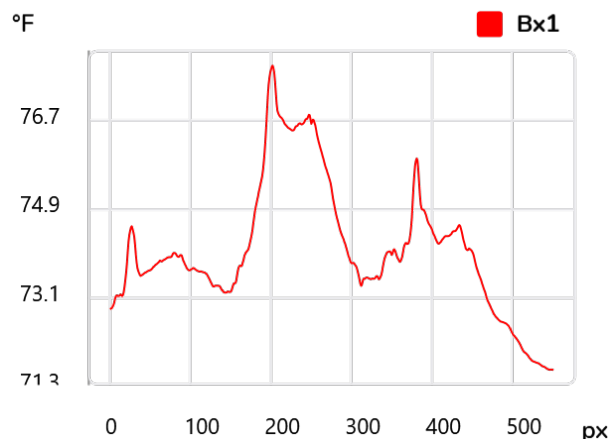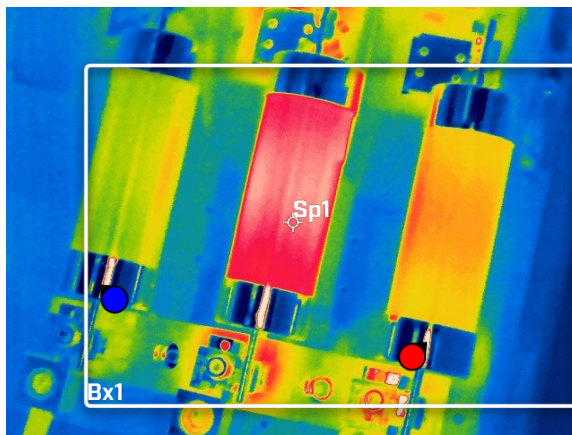

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action Monitor changes

Comment Continue to monitor. No immediate concern.

Priority 3 - Minor/Monitor

Parameters


Emissivity	0.95
Distance	3.12 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 77 / 271

Visual Photo

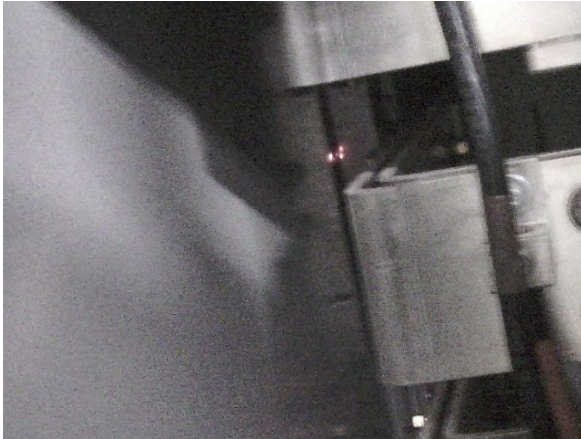

Equipment name : Mechanical Room 203

Device name : 1029



Measurement Point : MM13 Switchboard #1

Status OK

Measurements

Bx1	
Max	76.2 °F
Min	70.9 °F
Area	1.048 ft ²
Dt1	
Bx1.Max	5.3 °F
-Bx1.Min	
Sp1	71.4 °F

Thermogram 69 Created: 5/15/2026 11:58:45 AM

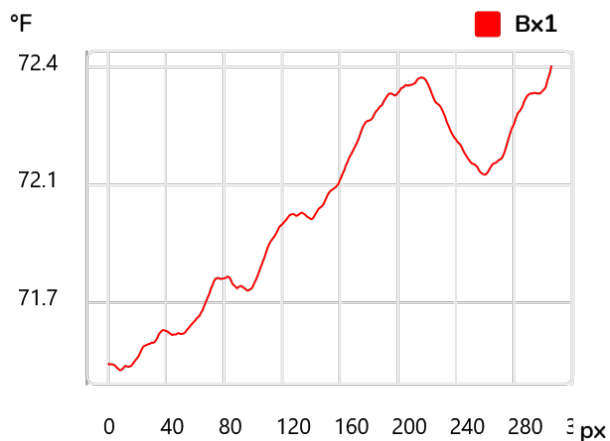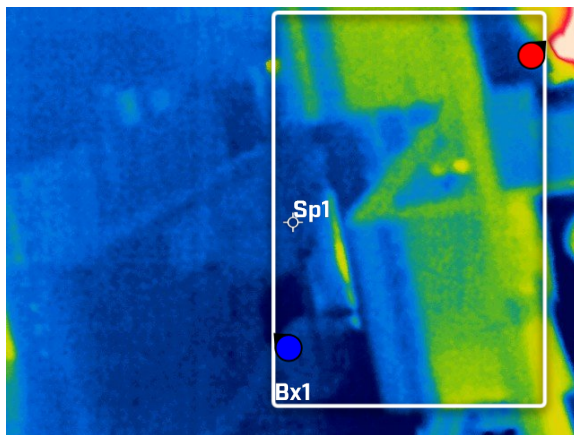

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	4.39 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 78 / 271

Visual Photo

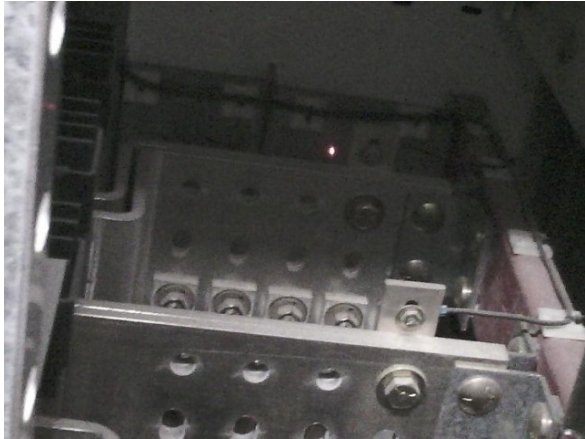

Equipment name : Mechanical Room 203

Device name : 1030


Measurement Point : MM13 Switchboard #2

Status OK

Measurements

Bx1	
Max	75.1 °F
Min	68.9 °F
Area	1.362 ft ²
Dt1	
Bx1.Max	6.1 °F
-Bx1.Min	
Sp1	71.1 °F

Thermogram 70 Created: 5/15/2026 12:02:26 PM

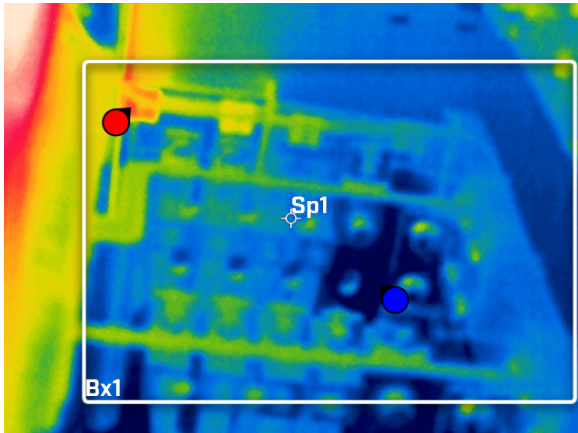

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 4.01 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 79 / 271

Visual Photo

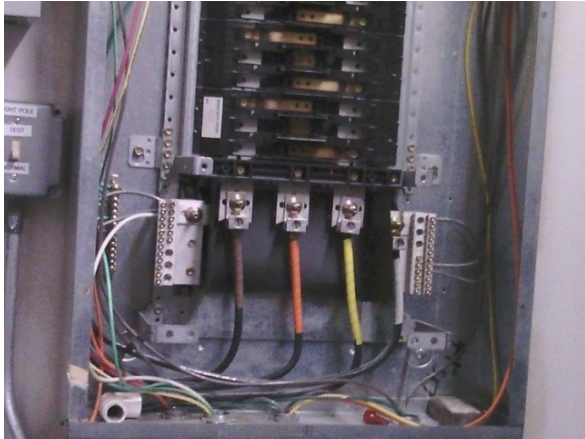

Equipment name : Mechanical Room 203

Device name : 1031



Measurement Point : H1

Status OK

Measurements

Bx1	
Max	77.2 °F
Min	67.1 °F
Area	1.795 ft ²
Dt1	
Bx1.Max	10.1 °F
-Bx1.Min	
Sp1	75.7 °F

Thermogram 71 Created: 5/15/2026 12:08:15 PM

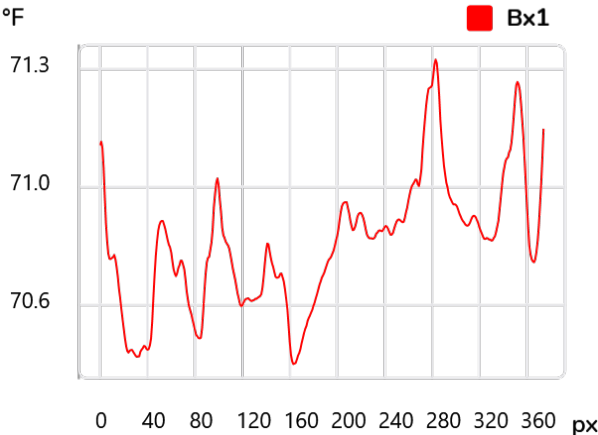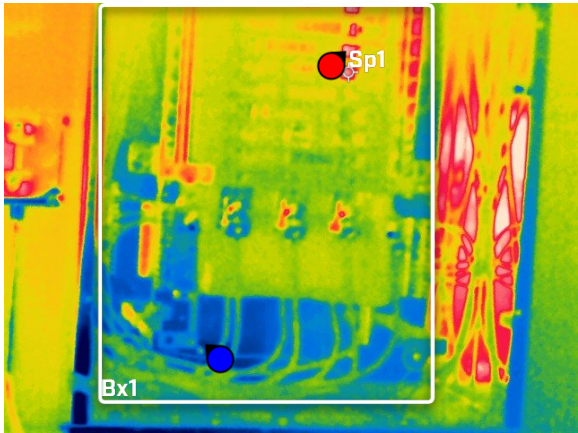

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96

Lens FOL18

Camera serial 90206013

Parameters

Emissivity 0.95

Distance 5.17 ft

Atmospheric temp. 68.0 °F


Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 80 / 271

Visual Photo

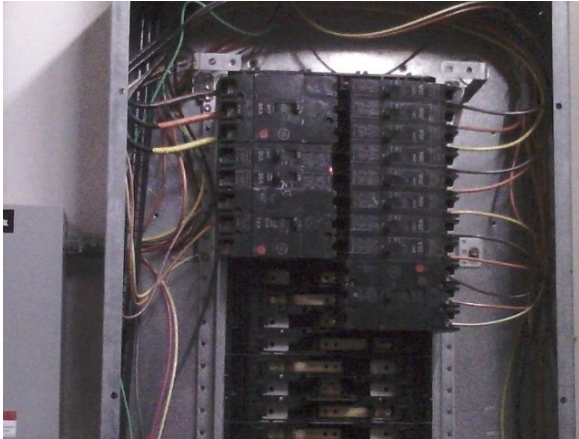

Equipment name : Mechanical Room 203

Device name : 1031



Measurement Point : H1

Status OK

Measurements

Bx1	
Max	82.1 °F
Min	69.3 °F
Area	2.340 ft ²
Sp1	71.6 °F

Thermogram 72 Created: 5/15/2026 12:08:33 PM

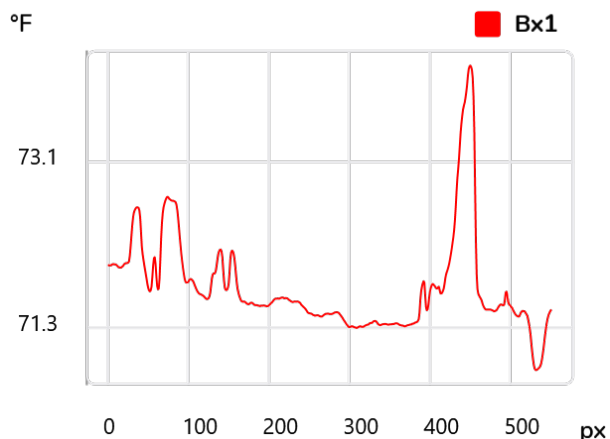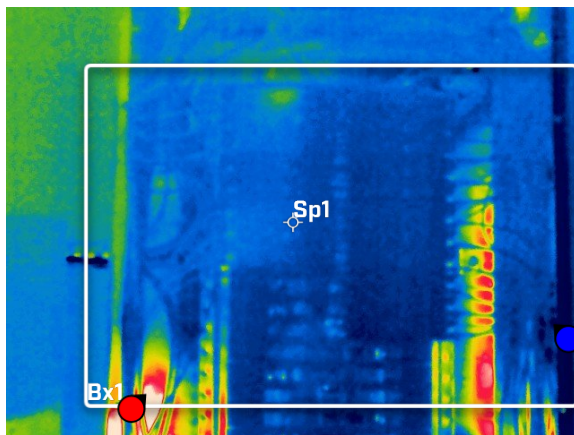

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	5.25 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 81 / 271

Visual Photo





Equipment name : Compressor #1
Device name : Compressor room
Measurement Point : Compressor #1
Status Note

Measurements

Bx1	
Max	115.4 °F
Min	81.4 °F
Area	0.514 ft ²
Dt1	
Bx1.Max	34.0 °F
-Bx1.Min	
Sp1	105.0 °F
Sp2	95.7 °F

Thermogram 73 Created: 5/19/2026 11:51:52 AM

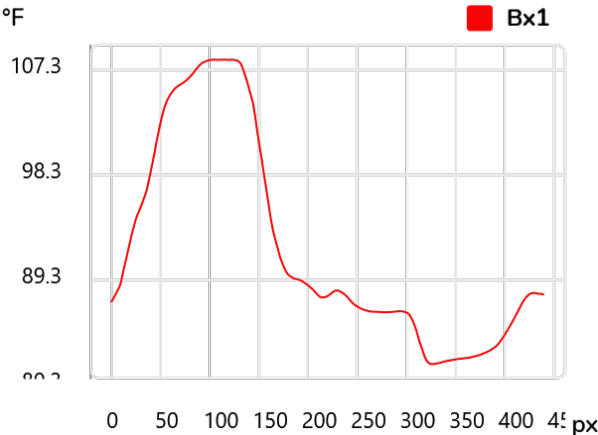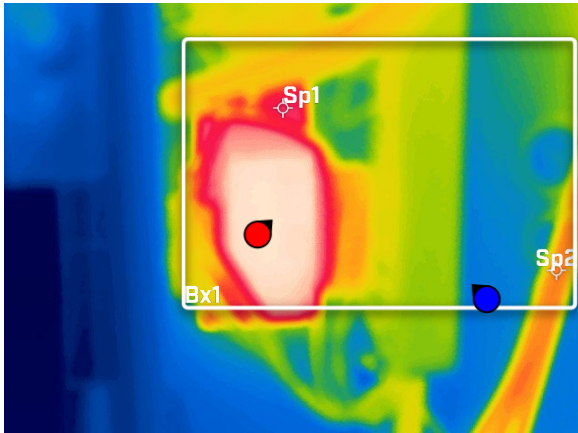

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Verify connections
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 3.10 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 82 / 271

Visual Photo

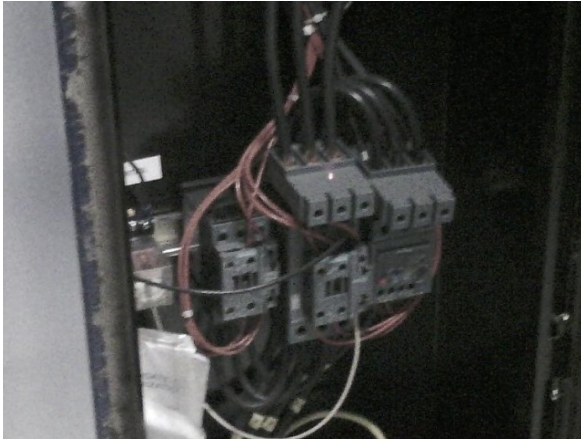

Equipment name : Compressor #1
Device name : Compressor room
Measurement Point : Compressor #1
Status Note

Measurements

Value

Bx1

Max 117.4 °F



Min 76.3 °F

Area 0.721 ft²

Sp1 113.2 °F

Sp2 105.3 °F

Thermogram 74 Created: 5/19/2026 11:52:45 AM

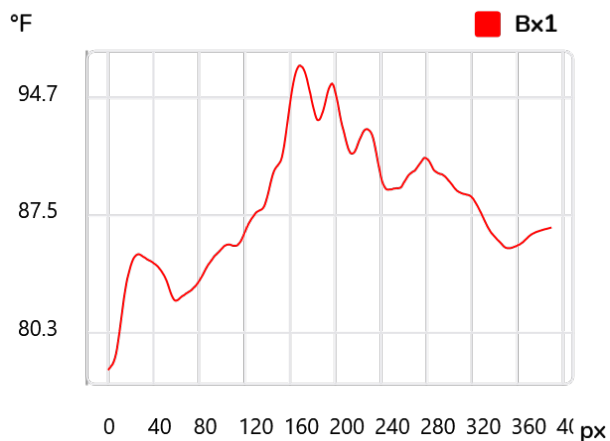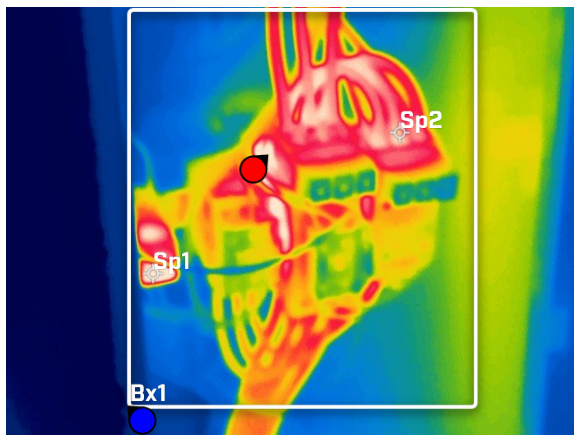

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Loose connection(s)

Recommended Action Inspect connections

Comment Verify connections

Priority 2-Intermediate/Investigate

Parameters


Emissivity 0.95
Distance 3.21 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 83 / 271

Visual Photo

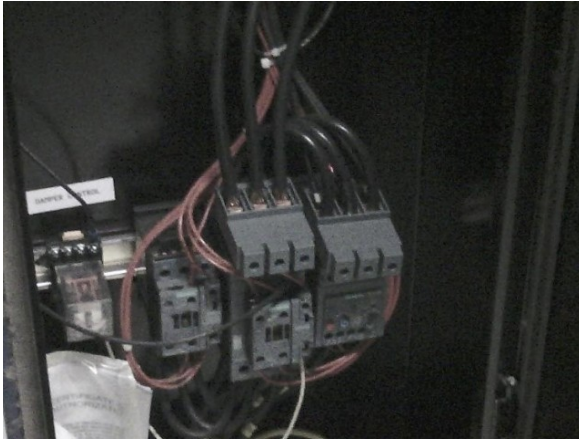

Equipment name : Compressor #1
Device name : Compressor room
Measurement Point : Compressor #1
Status Note

Measurements

Value

Bx1

Max 126.4 °F

Min 75.4 °F



Area 0.701 ft²

Sp1 99.7 °F

Sp2 107.3 °F

Thermogram 75

Created: 5/19/2026 11:56:02 AM

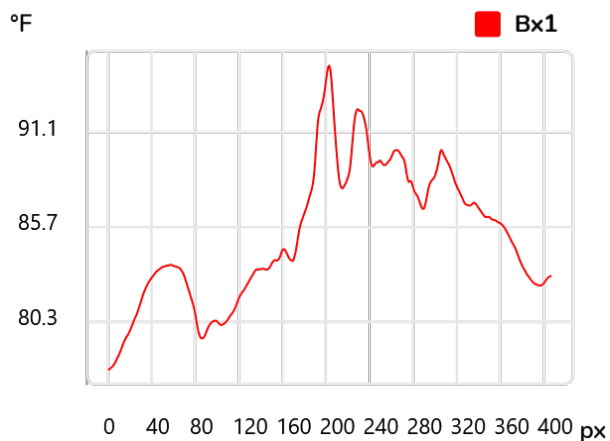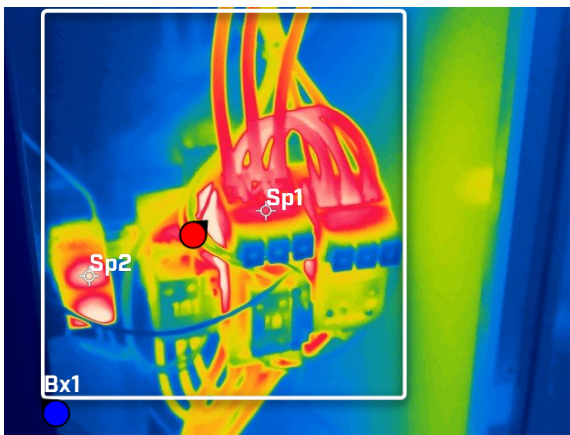

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Loose connection(s)

Recommended Action Inspect connections

Comment Verify connections

Priority 2-Intermediate/Investigate

Parameters


Emissivity 0.95
Distance 3.14 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 84 / 271

Visual Photo

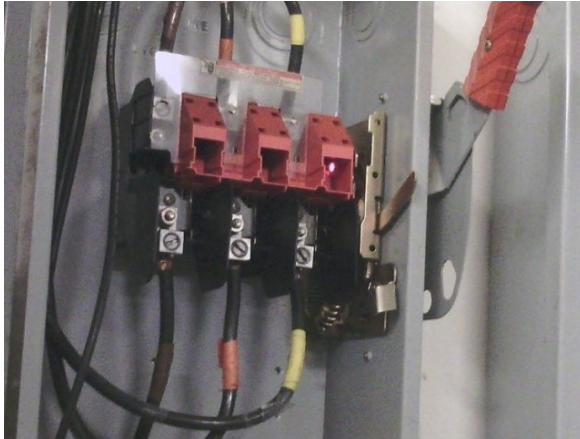

Equipment name : Compressor #1
Device name : Compressor room
Measurement Point : Compressor #1
Status Note

Measurements



Value

Bx1

Max 109.5 °F
Min 76.8 °F
Area 0.629 ft²
Sp1 96.6 °F
Sp2 95.3 °F
Sp3 98.3 °F

Thermogram 76

Created: 5/19/2026 12:08:54 PM

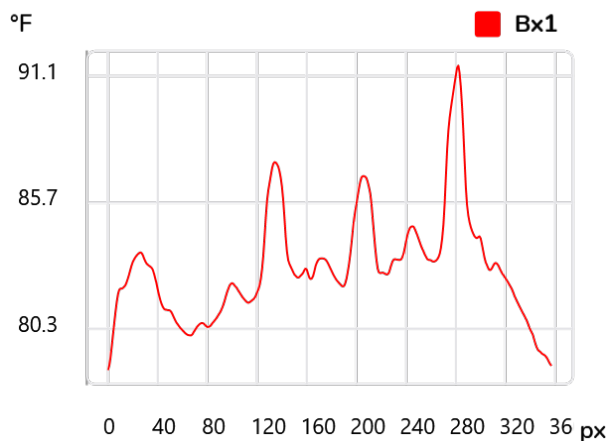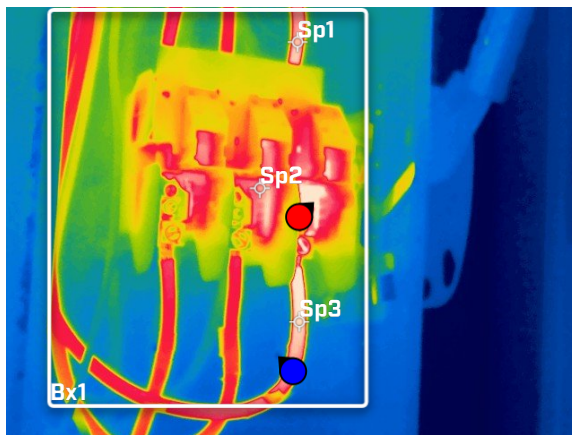

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Verify connections
Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.14 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 85 / 271

Visual Photo



Equipment name : Compressor #1

Device name : Compressor room



Measurement Point : Compressor #1

Status Note

Measurements

Value	
Bx1	
Max	114.1 °F
Min	80.1 °F
Area	0.120 ft²
Sp1	112.7 °F
Sp2	111.5 °F

Thermogram 77 Created: 5/20/2026 12:08:01 PM

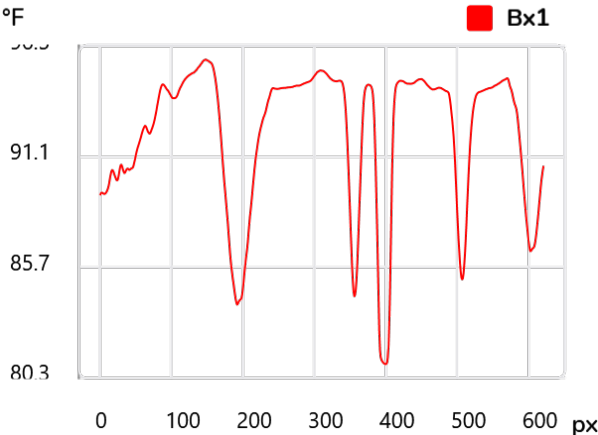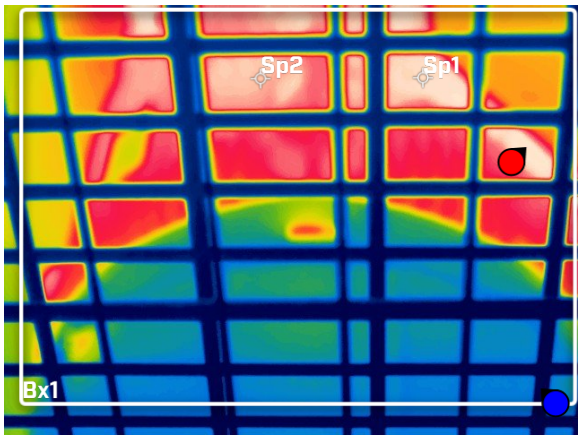

Text Annotations

Issue Loose connection(s)

Recommended Action Inspect connections

Comment Verify connections

Priority 2-Intermediate/Investigate

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	1.04 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 86 / 271

Visual Photo

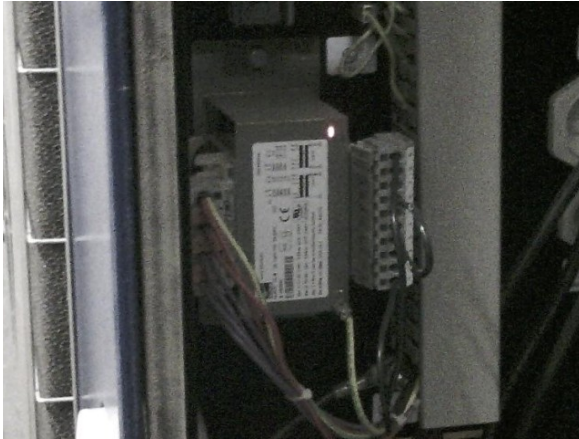

Equipment name : Compressor #2
Device name : Compressor room
Measurement Point : Compressor #2
Status OK

Measurements

Value

Bx1

Max 112.9 °F




Min 78.7 °F

Area 0.205 ft²

Sp1 103.5 °F

Thermogram 78

Created: 5/19/2026 12:01:19 PM

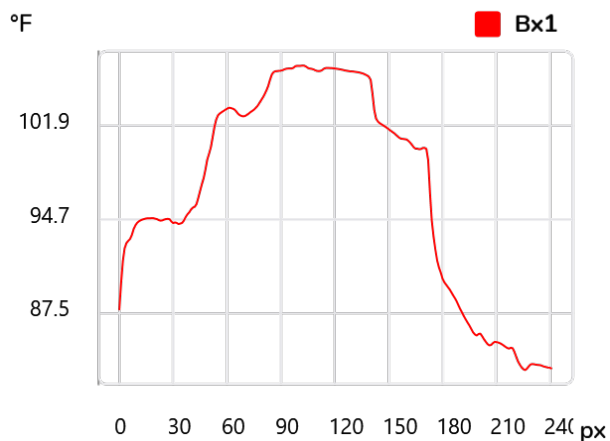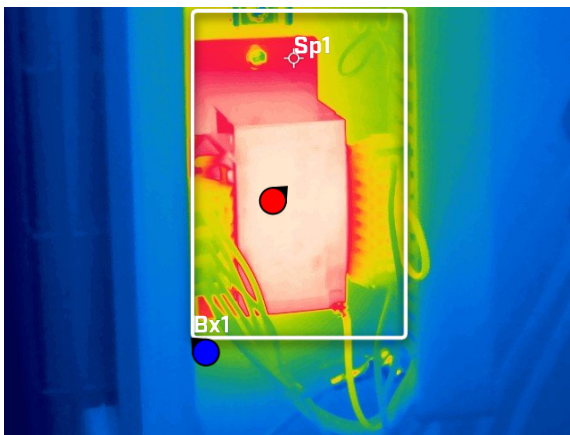

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity 0.95
Distance 2.40 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 87 / 271

Visual Photo

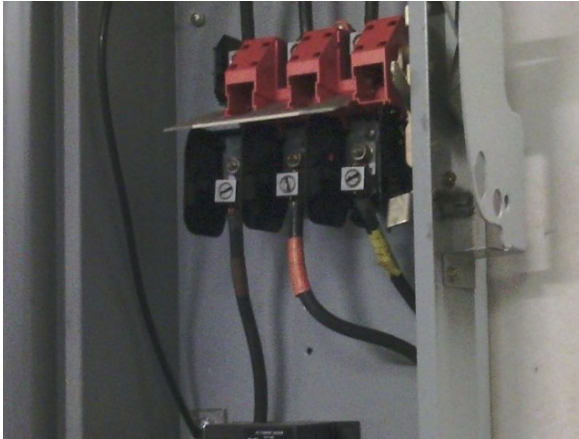

Equipment name : Compressor #2
Device name : Compressor room
Measurement Point : Compressor #2
Status OK



Measurements

Value

Bx1

Max 79.3 °F
Min 73.4 °F
Area 0.322 ft²
Sp1 77.8 °F

Thermogram 79 Created: 5/19/2026 12:10:47 PM

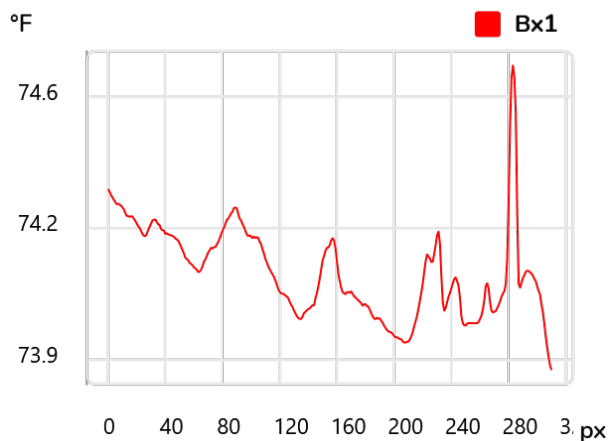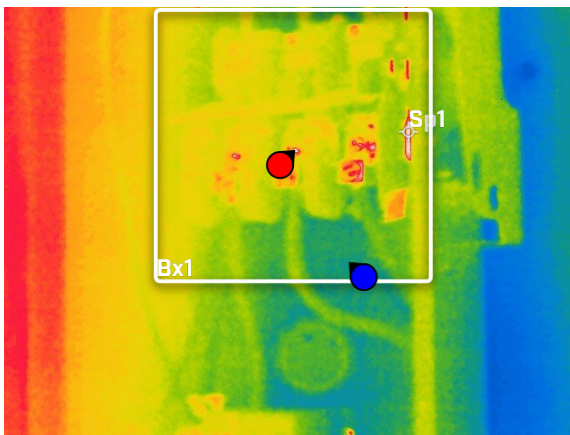

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.91 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 88 / 271

Visual Photo



Equipment name : Compressor #2
Device name : Compressor room
Measurement Point : Compressor #2
Status OK

Measurements



Value

Bx1

Max 82.2 °F
Min 73.6 °F
Area 0.728 ft²
Sp1 78.4 °F
Sp2 76.7 °F

Thermogram 80

Created: 5/20/2026 11:56:54 AM

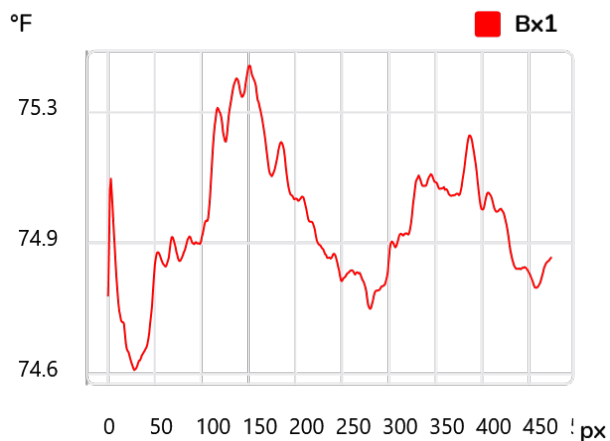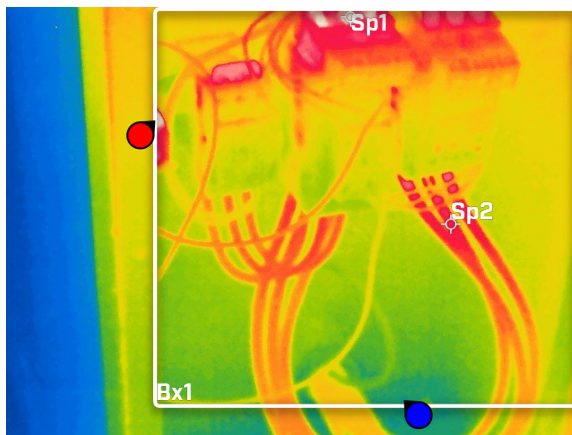

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 2.93 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 89 / 271

Visual Photo



Equipment name : Compressor #2
Device name : Compressor room
Measurement Point : Compressor #2
Status OK

Measurements

Value

Bx1




Max 94.7 °F

Min 77.2 °F

Sp1 89.7 °F

Thermogram 81

Created: 5/20/2026 11:58:29 AM

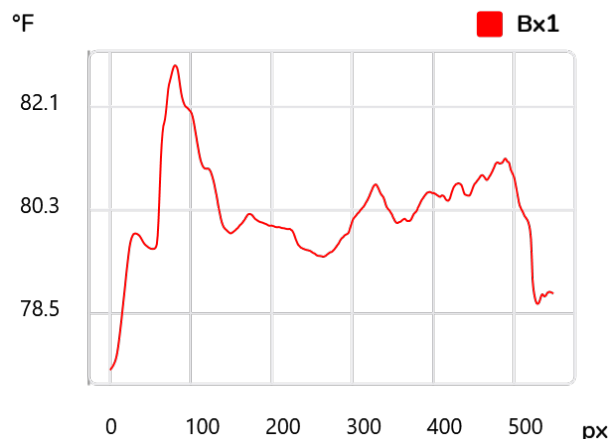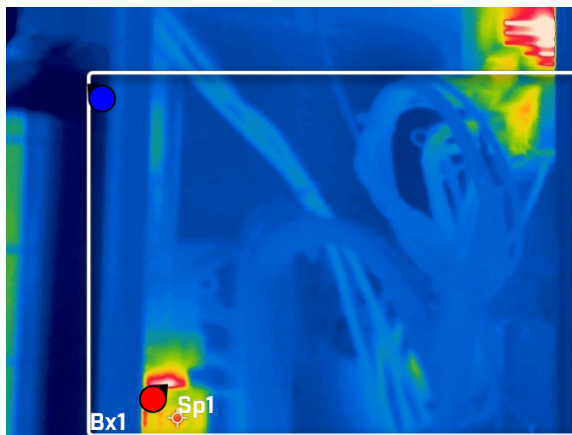

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.48 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 90 / 271

Visual Photo





Equipment name : Compressor #2
Device name : Compressor room
Measurement Point : Compressor #2
Status OK

Measurements

Bx1	
Max	97.4 °F
Min	79.3 °F
Area	0.076 ft²
Dt1	
Bx1.Max	18.1 °F
-Bx1.Min	
Sp1	91.6 °F
Sp2	86.8 °F

Thermogram 82 Created: 5/20/2026 12:02:13 PM

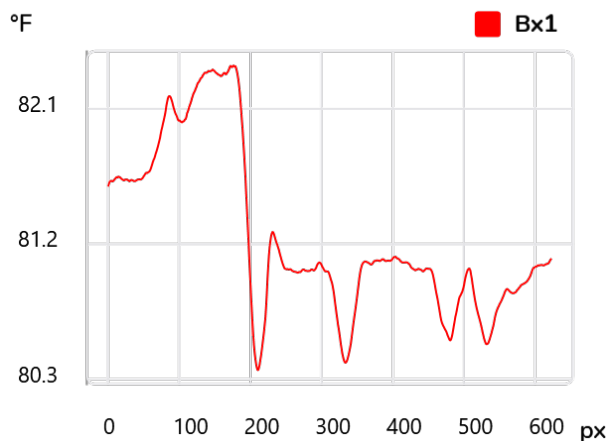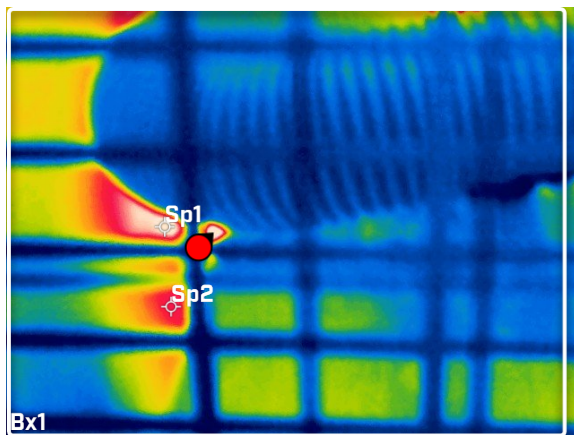

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	0.80 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 91 / 271

Visual Photo





Equipment name : Compressor #2
Device name : Compressor room
Measurement Point : Compressor #2
Status OK

Measurements

Bx1	
Max	91.8 °F
Min	81.4 °F
Area	0.174 ft ²
Dt1	
Bx1.Max	10.4 °F
-Bx1.Min	
Sp1	87.4 °F

Thermogram 83 Created: 5/20/2026 12:03:03 PM

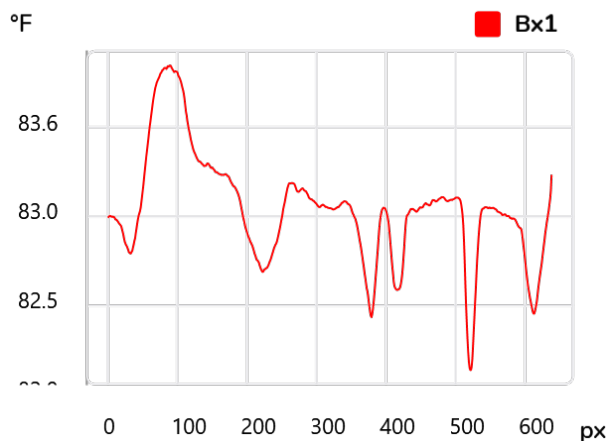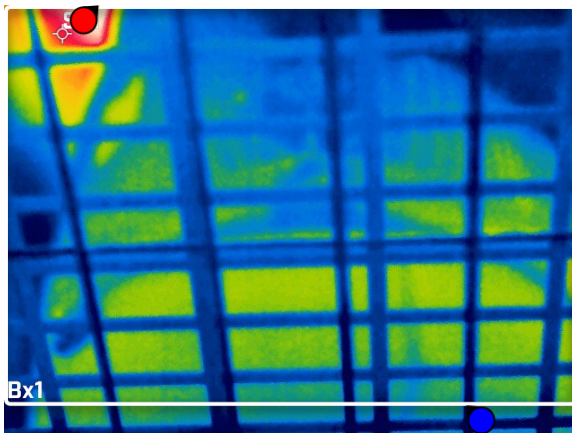

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity	0.95
Distance	1.23 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 92 / 271


Visual Photo




Equipment name : Compressor #2
Device name : Compressor room
Measurement Point : Compressor #2
Status OK

Measurements

Thermogram 84 Created: 5/20/2026 12:04:21 PM

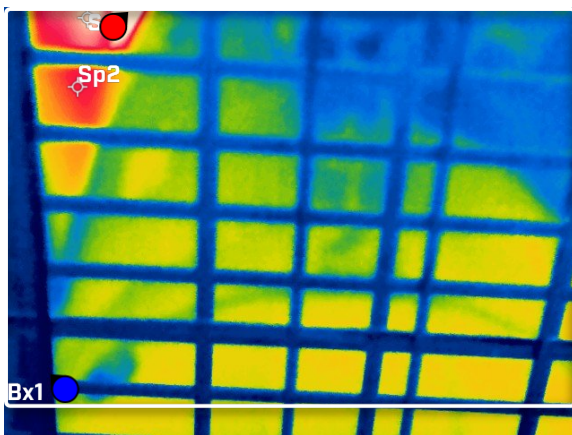

Value	
Bx1	
Max	109.5 °F
Min	82.1 °F
Area	0.149 ft²
Sp1	96.1 °F
Sp2	90.1 °F

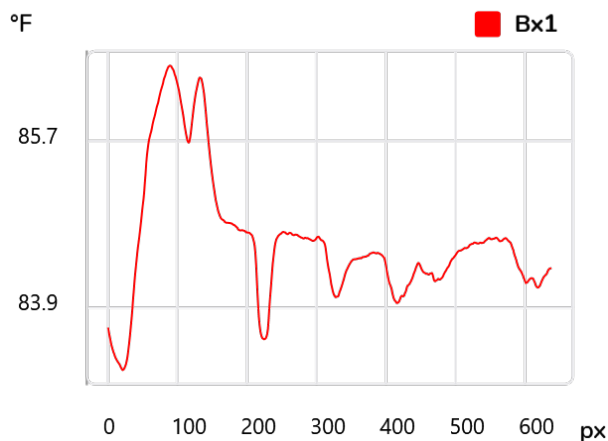

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	1.14 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 93 / 271

Visual Photo





Equipment name : Dryer #1
Device name : Compressor room
Measurement Point : Dryer #1
Status OK

Measurements

Value	
Bx1	
Max	89.6 °F
Min	75.8 °F
Area	0.328 ft²
Sp1	85.5 °F
Sp2	86.9 °F
Sp3	85.4 °F

Thermogram 85 Created: 5/19/2026 12:17:21 PM

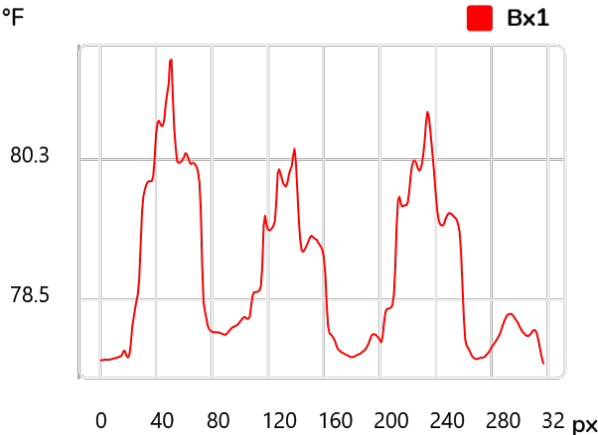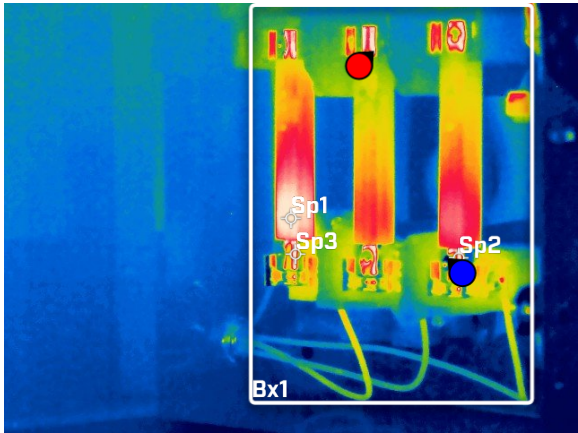

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.40 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 94 / 271

Visual Photo





Equipment name : Dryer #1
Device name : Compressor room
Measurement Point : Dryer #1
Status OK

Measurements

Bx1	
Max	103.0 °F
Min	63.7 °F
Area	0.308 ft²
Dt1	
Bx1.Max	39.4 °F
-Bx1.Min	
Sp1	86.3 °F

Thermogram 86 Created: 5/19/2026 12:19:32 PM

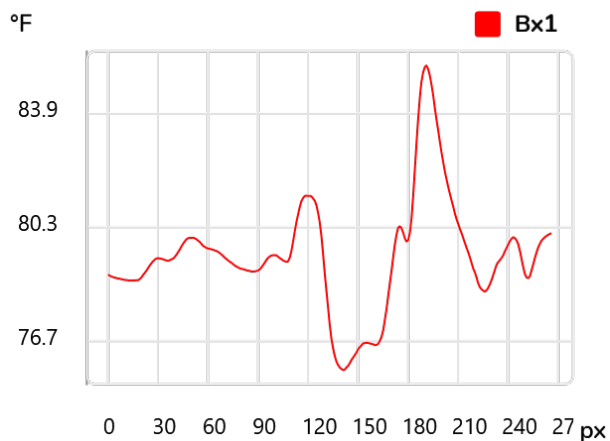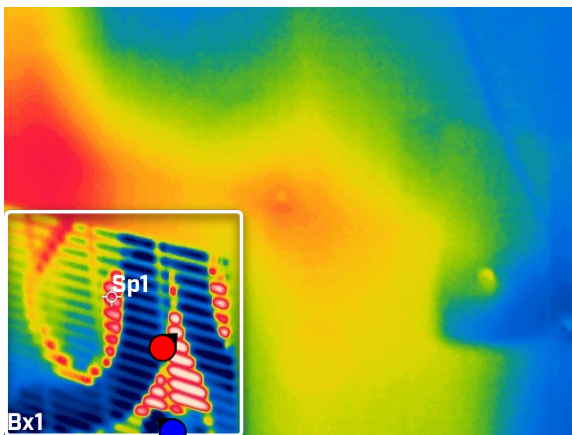

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	3.37 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 95 / 271

Visual Photo





Equipment name : Dryer #1
Device name : Compressor room
Measurement Point : Dryer #1
Status OK

Measurements

Value	
Bx1	
Max	91.6 °F
Min	76.3 °F
Area	0.483 ft²
Sp1	87.1 °F
Sp2	86.5 °F
Sp3	84.9 °F

Thermogram 87 Created: 5/19/2026 12:20:31 PM

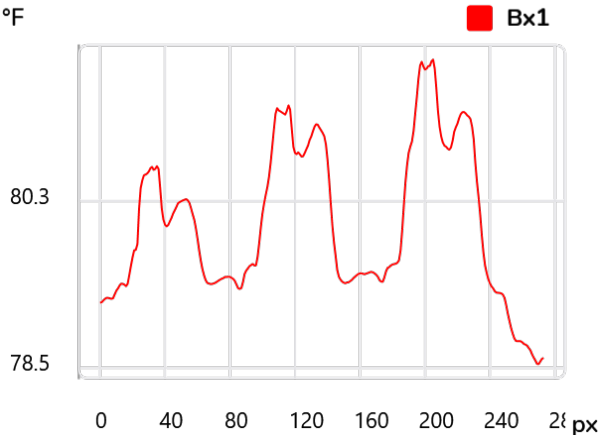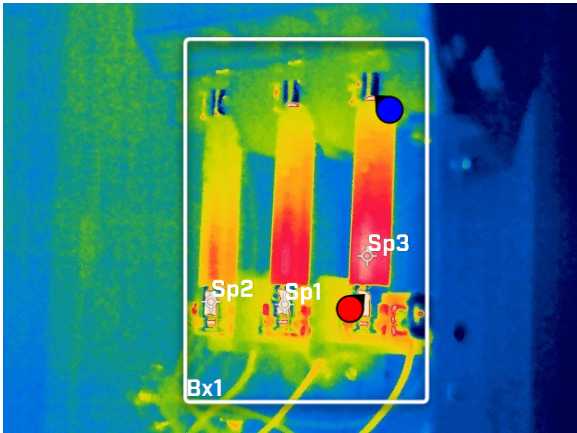

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 96 / 271

Visual Photo





Equipment name : Dryer #1
Device name : Compressor room
Measurement Point : Dryer #1
Status OK

Measurements

Value	
Bx1	
Max	105.8 °F
Min	44.7 °F
Area	0.683 ft²
Sp1	101.2 °F

Thermogram 88 Created: 5/19/2026 12:21:23 PM

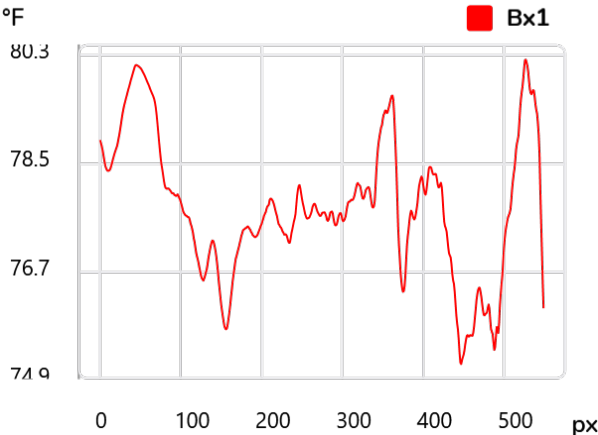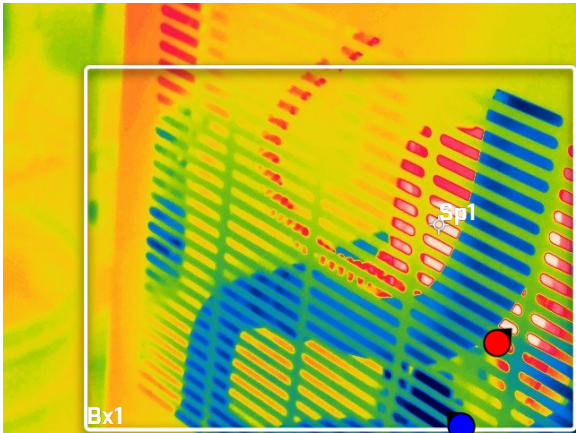

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	2.75 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 97 / 271

Visual Photo





Equipment name : Dryer #1
Device name : Compressor room
Measurement Point : Dryer #1
Status OK

Measurements

Value	
Bx1	
Max	110.5 °F
Min	65.5 °F
Area	0.055 ft²
Sp1	106.3 °F

Thermogram 89 Created: 5/21/2026 1:28:21 PM

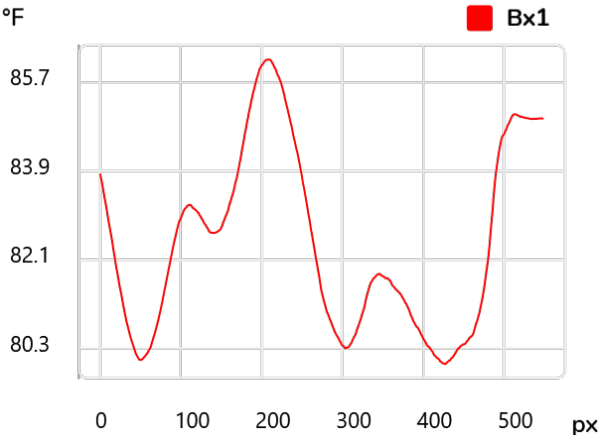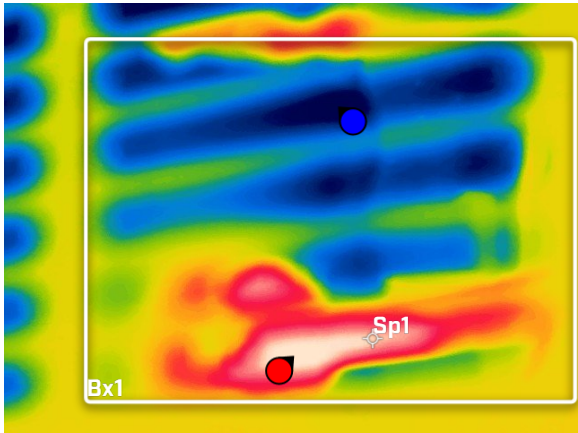

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	0.78 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 98 / 271

Visual Photo



Equipment name : Dryer #1
Device name : Compressor room
Measurement Point : Dryer #1
Status OK

Measurements

Value

Bx1



Max 111.4 °F

Min 93.0 °F

Area 0.152 ft²

Sp1 105.9 °F

Thermogram 90 Created: 5/21/2026 1:29:14 PM

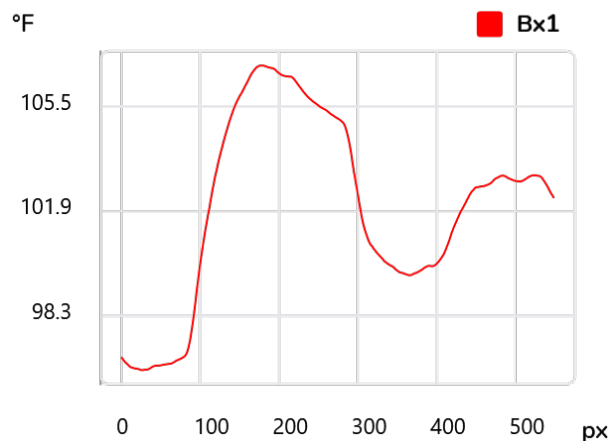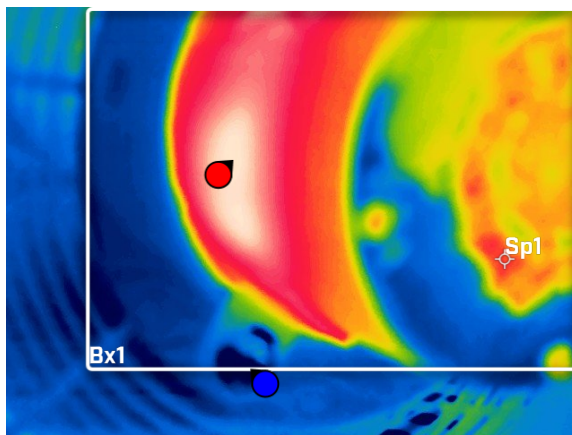

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 1.31 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 99 / 271

Visual Photo





Equipment name : Dryer #2
Device name : Compressor room
Measurement Point : Dryer #2
Status OK

Measurements

Bx1	
Max	94.6 °F
Min	78.5 °F
Area	0.401 ft ²
Dt1	
Bx1.Max	16.1 °F
-Bx1.Min	
Sp1	91.8 °F
Sp2	91.1 °F

Thermogram 91 Created: 5/21/2026 1:24:56 PM

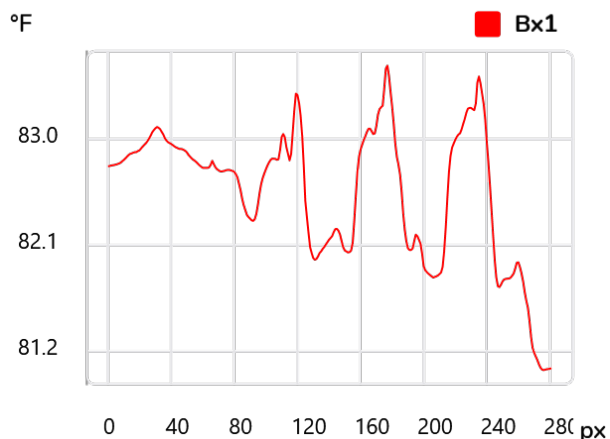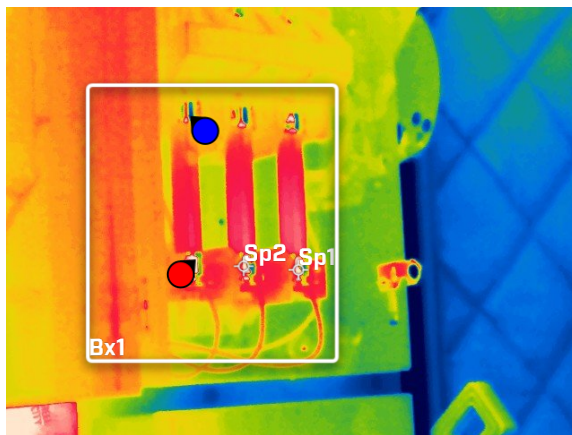

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.37 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 100 / 271

Visual Photo





Equipment name : Dryer #2
Device name : Compressor room
Measurement Point : Dryer #2
Status OK

Measurements

Bx1	
Max	109.3 °F
Min	73.5 °F
Area	0.470 ft²
Dt1	
Bx1.Max	35.8 °F
-Bx1.Min	
Sp1	108.3 °F

Thermogram 92 Created: 5/21/2026 1:26:26 PM

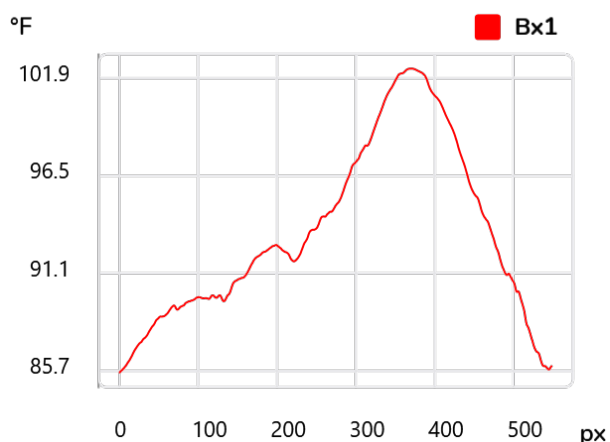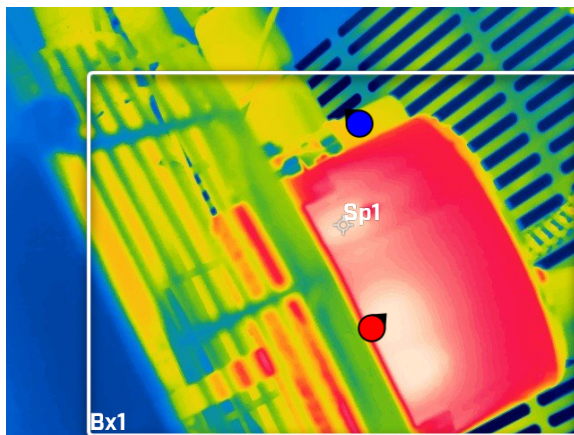

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	2.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 101 / 271

Visual Photo

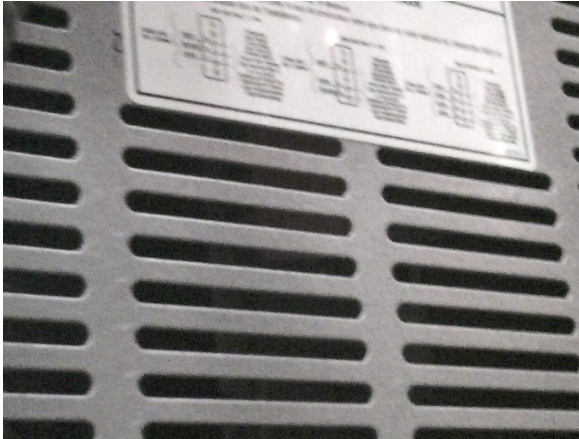

Equipment name : Dryer #2
Device name : Compressor room
Measurement Point : Dryer #2
Status OK



Measurements

Value

Bx1

Max 96.2 °F
Min 58.2 °F
Area 0.230 ft²
Sp1 91.1 °F

Thermogram 93 Created: 5/21/2026 1:26:58 PM

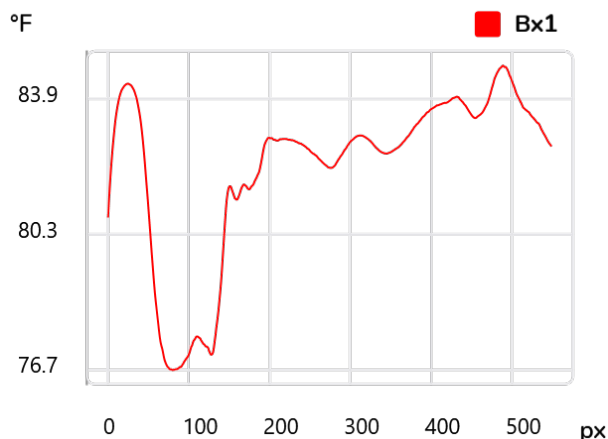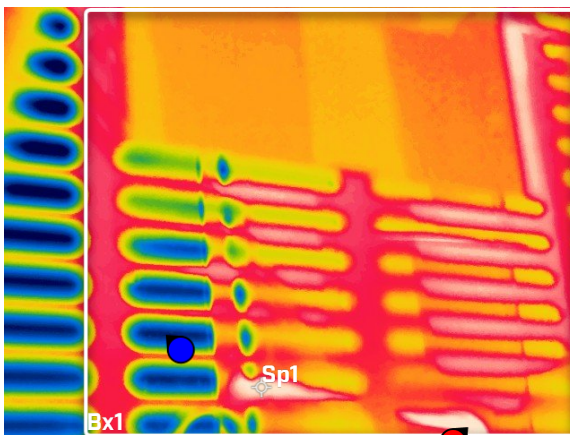

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 1.48 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 102 / 271

Visual Photo



Equipment name : RTU #1
Device name : Roof Top Units
Measurement Point : #1
Status OK

Measurements

Value

Bx1

Max 103.5 °F



Min 89.4 °F

Area 0.388 ft²

Sp1 99.3 °F

Thermogram 94

Created: 5/27/2026 1:11:22 PM

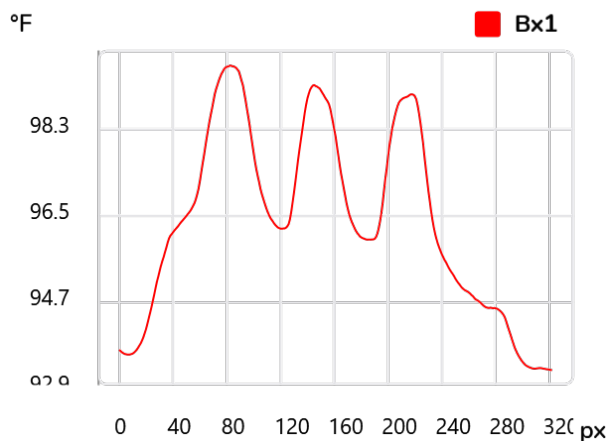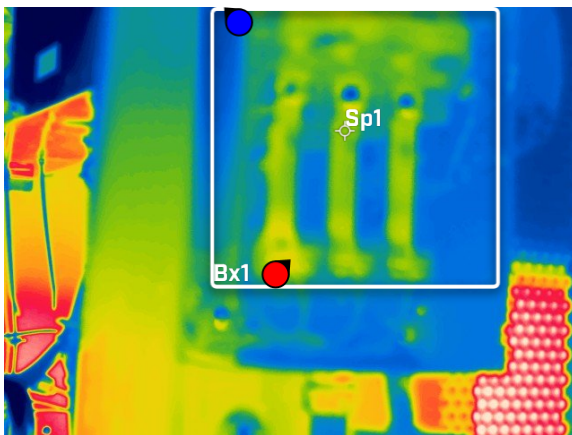

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.09 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 103 / 271

Visual Photo



Equipment name : RTU #1
Device name : Roof Top Units
Measurement Point : #1
Status OK

Measurements

Value

Bx1



Max 195.6 °F

Min 67.1 °F

Area 6.382 ft²

Sp1 179.0 °F

Thermogram 95 Created: 5/27/2026 1:12:43 PM

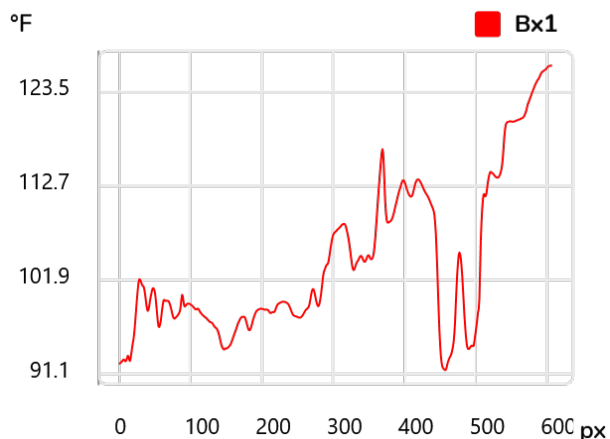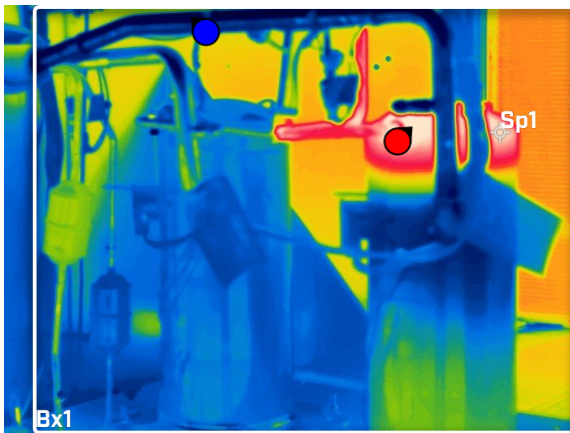

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 7.40 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 104 / 271

Visual Photo





Equipment name : RTU #1
Device name : Roof Top Units
Measurement Point : #1
Status OK

Measurements

Value	
Bx1	
Max	125.2 °F
Min	68.8 °F
Area	0.794 ft²
Sp1	115.6 °F

Thermogram 96 Created: 5/27/2026 1:18:57 PM

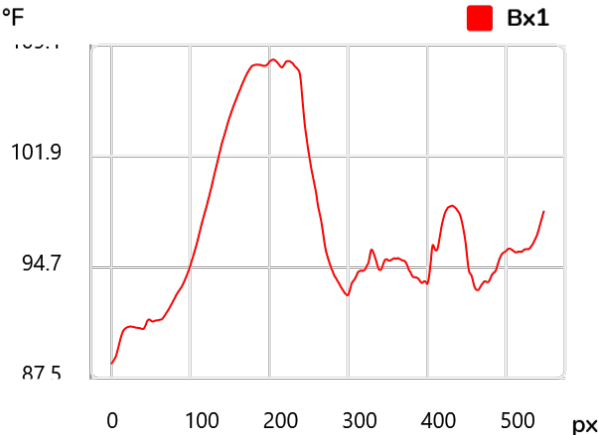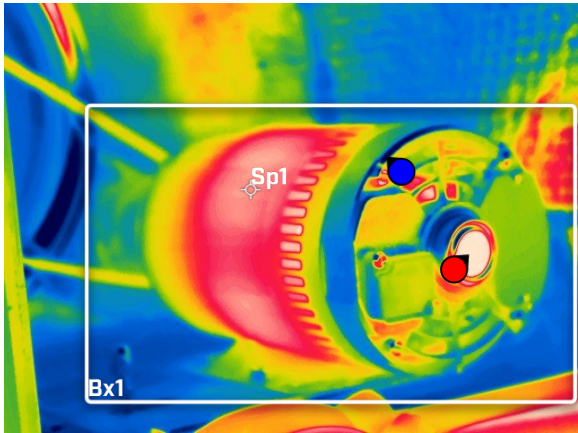

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection


Report 1654-000
Date 6/12/2026
Page 105 / 271

Visual Photo




Equipment name : RTU #2
Device name : Roof Top Units
Measurement Point : #2
Status OK

Thermogram 97 Created: 6/4/2026 8:08:17 AM

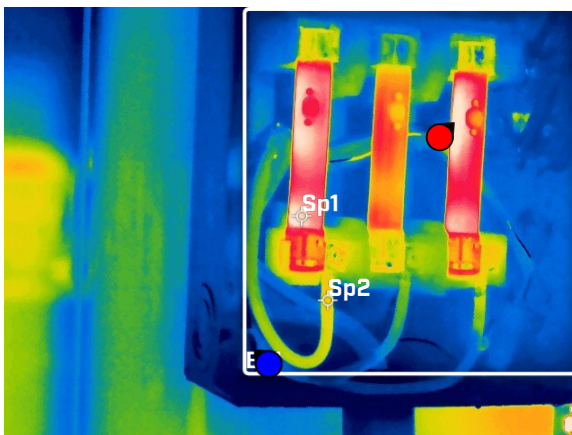

Measurements

Bx1	
Max	82.8 °F
Min	63.4 °F
Area	0.428 ft ²
Dt1	
Bx1.Max -Bx1.Min	19.4 °F
Sp1	80.6 °F
Sp2	72.8 °F

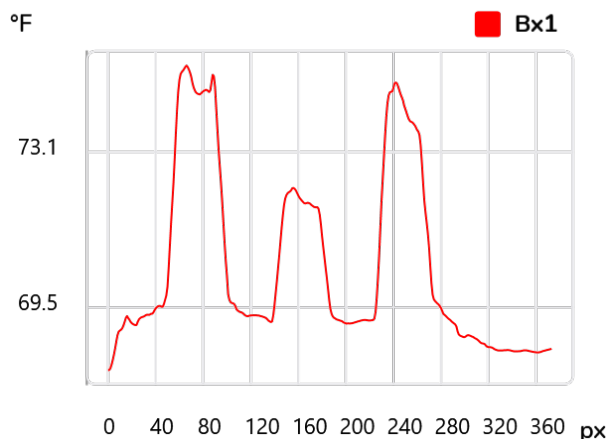

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 5.9,4.5,5.6amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.64 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 106 / 271

Visual Photo



Equipment name : RTU #2
Device name : Roof Top Units
Measurement Point : #2
Status OK

Measurements

Value

Bx1

Max 143.9 °F



Min 56.1 °F

Area 0.572 ft²

Sp1 139.4 °F

Thermogram 98

Created: 6/4/2026 8:11:32 AM

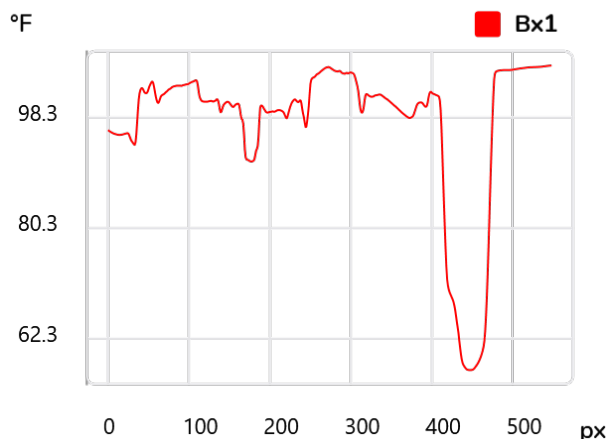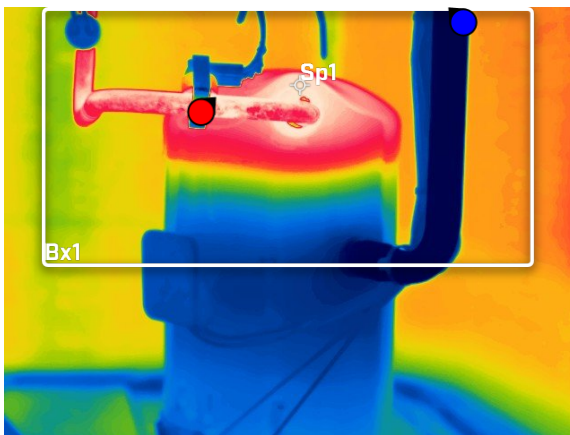

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 5.9,4.5,5.6amps

Priority None

Parameters

Emissivity 0.95
Distance 3.00 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 107 / 271

Visual Photo



Equipment name : RTU #2
Device name : Roof Top Units
Measurement Point : #2
Status OK

Measurements

Value

Bx1

Max 111.3 °F



Min 53.5 °F

Area 0.588 ft²

Sp1 106.1 °F

Thermogram 99

Created: 6/4/2026 8:12:07 AM

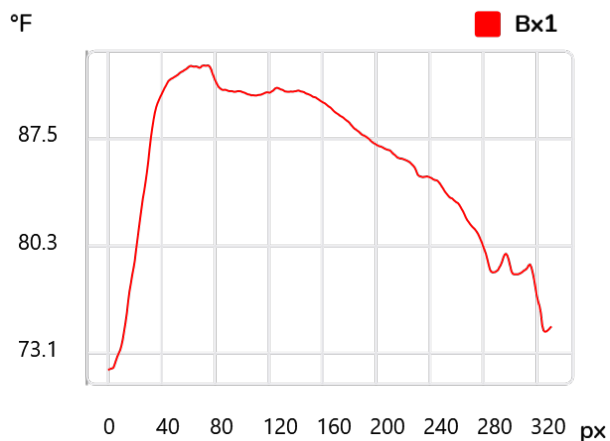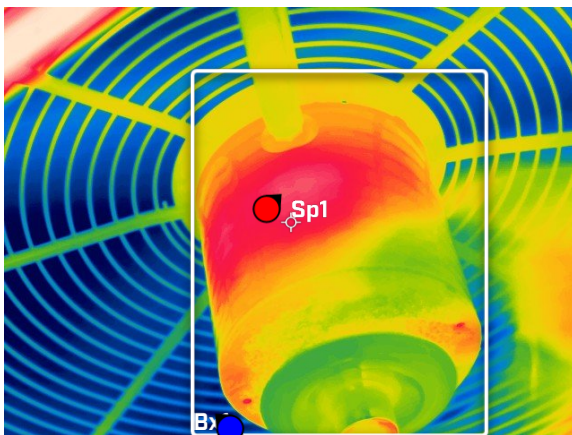

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 5.9,4.5,5.6amps

Priority None

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 108 / 271

Visual Photo



Equipment name : RTU #2
Device name : Roof Top Units
Measurement Point : #2
Status OK



Measurements

Value

Bx1

Max 80.5 °F
Min 68.9 °F
Area 0.293 ft²
Sp1 76.0 °F
Sp2 72.7 °F

Thermogram 100 Created: 6/4/2026 8:23:54 AM

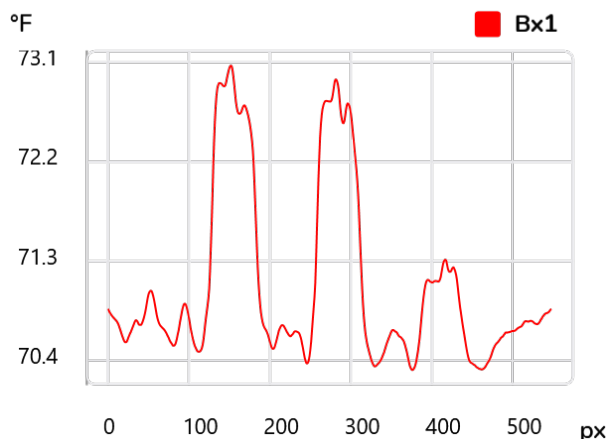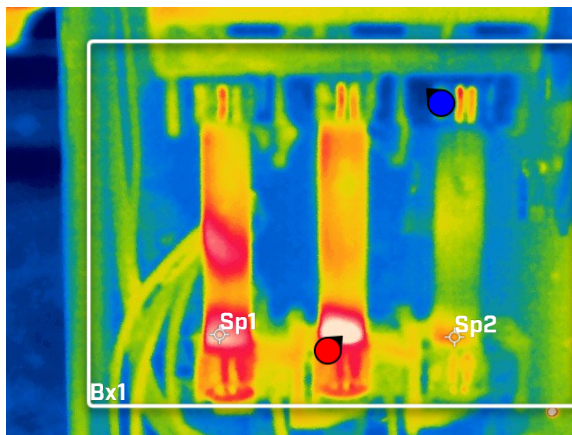

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 5.9,4.5,5.6amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 1.80 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 109 / 271

Visual Photo



Equipment name : RTU #2
Device name : Roof Top Units
Measurement Point : #2
Status OK

Measurements

Value

Bx1



Max 131.6 °F

Min 66.2 °F

Area 1.483 ft²

Sp1 83.3 °F

Thermogram 101 Created: 6/4/2026 8:26:09 AM

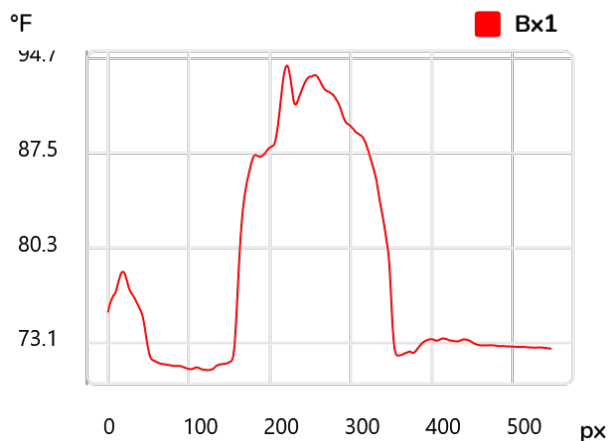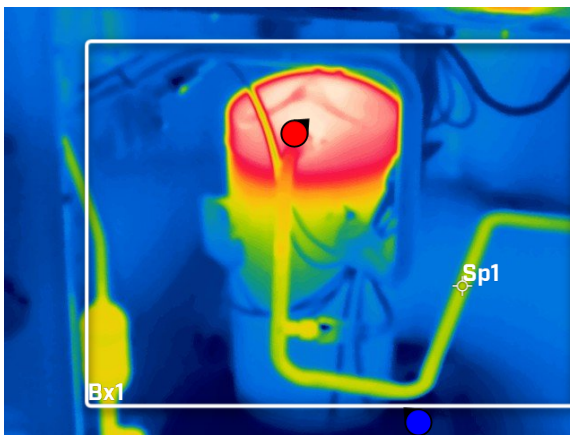

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 5.9,4.5,5.6amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.05 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 110 / 271

Visual Photo



Equipment name : RTU #2
Device name : Roof Top Units
Measurement Point : #2
Status OK

Measurements

Value

Bx1



Max 102.5 °F

Min 58.3 °F

Area 0.283 ft²

Sp1 97.8 °F

Thermogram 102 Created: 6/4/2026 8:27:50 AM

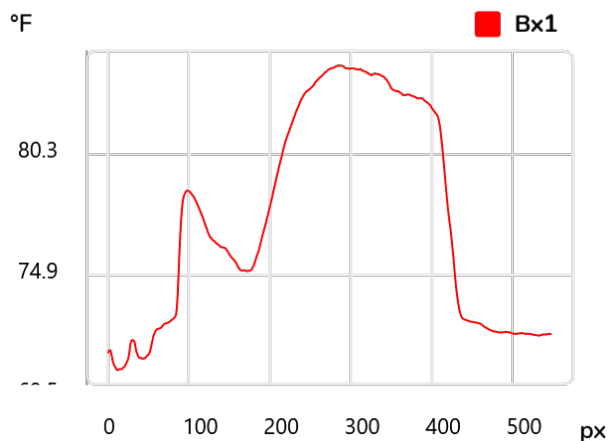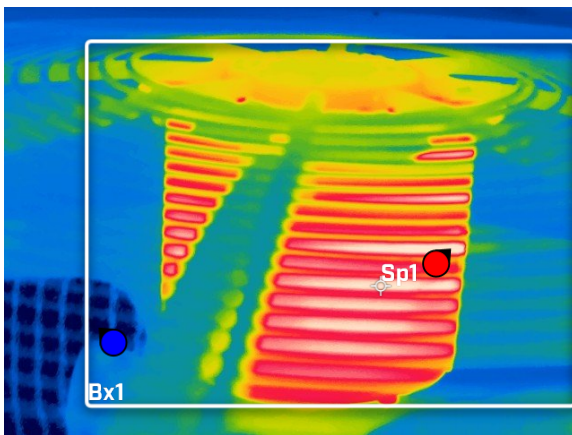

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 5.9,4.5,5.6amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 1.77 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 111 / 271

Visual Photo

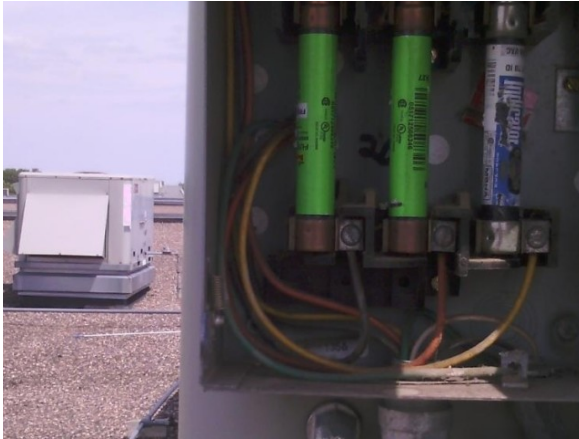

Equipment name : RTU #3
Device name : Roof Top Units
Measurement Point : #3
Status OK

Measurements

Value

Bx1

Max 120.1 °F



Min 63.1 °F

Area 0.498 ft²

Sp1 110.4 °F

Sp2 101.3 °F

Thermogram 103 Created: 6/3/2026 2:46:46 PM

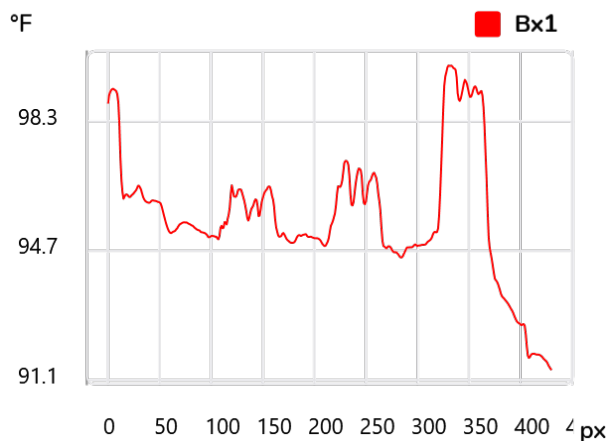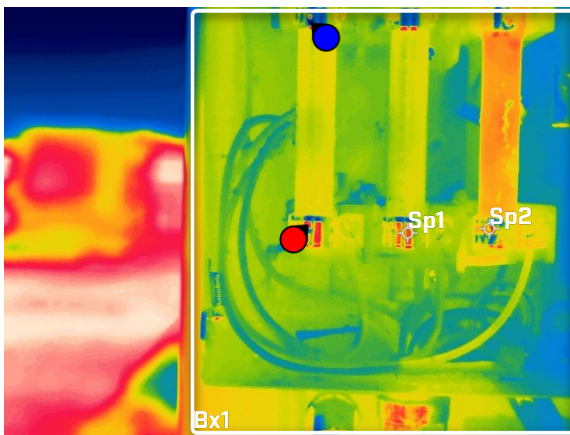

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 8.7,6.1,7.4amps

Priority None

Parameters

Emissivity 0.95
Distance 2.47 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 112 / 271

Visual Photo



Equipment name : RTU #3
Device name : Roof Top Units
Measurement Point : #3
Status OK

Measurements

Value

Bx1



Max 183.9 °F

Min 43.6 °F

Area 0.348 ft²

Sp1 177.1 °F

Thermogram 104 Created: 6/3/2026 3:47:08 PM

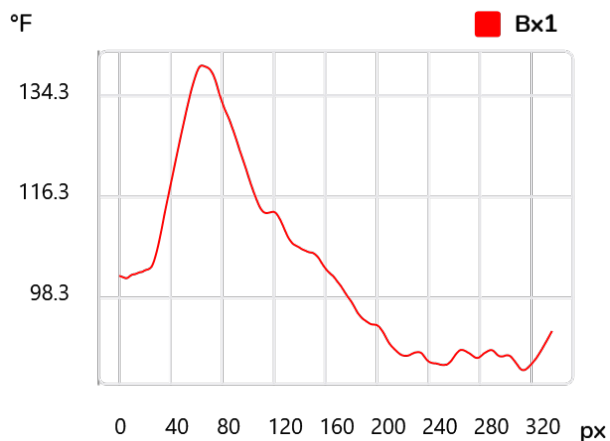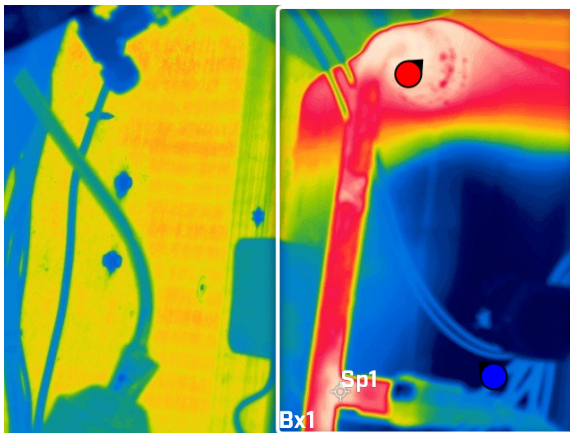

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 8.7,6.1,7.4amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.32 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 113 / 271

Visual Photo



Equipment name : RTU #3
Device name : Roof Top Units
Measurement Point : #3
Status OK

Measurements

Value

Bx1



Max 155.1 °F

Min 84.9 °F

Area 0.974 ft²

Sp1 154.4 °F

Thermogram 105 Created: 6/3/2026 3:48:03 PM

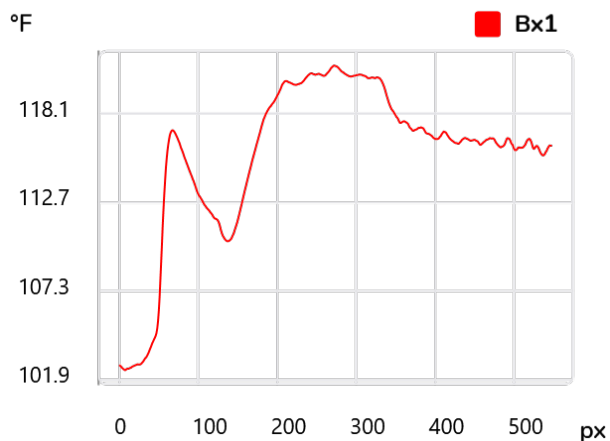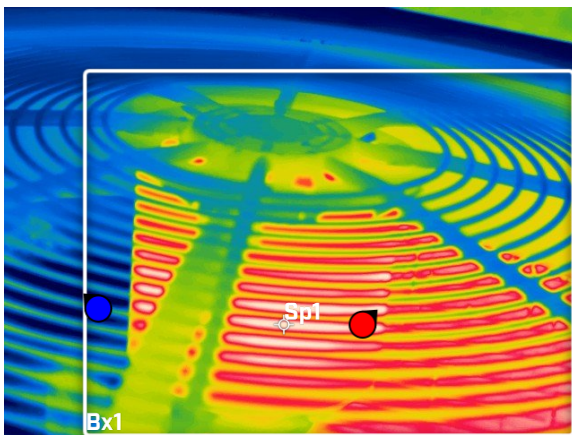

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 8.7,6.1,7.4amps

Priority None

Parameters

Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 114 / 271

Visual Photo



Equipment name : RTU #4
Device name : Roof Top Units
Measurement Point : #4
Status OK

Measurements

Value

Bx1

Max 135.1 °F



Min 92.5 °F

Area 0.896 ft²

Sp1 124.6 °F

Sp2 124.9 °F

Thermogram 106 Created: 5/27/2026 1:26:52 PM

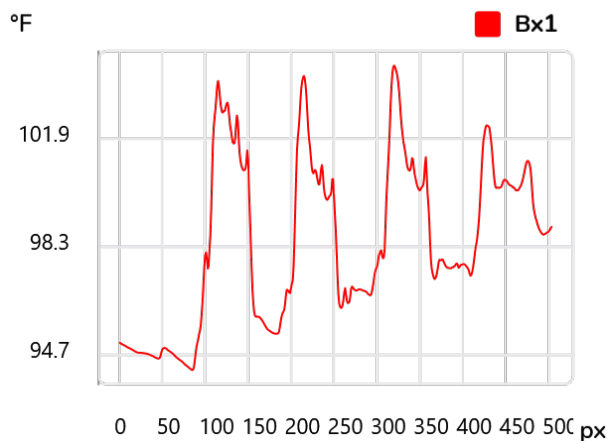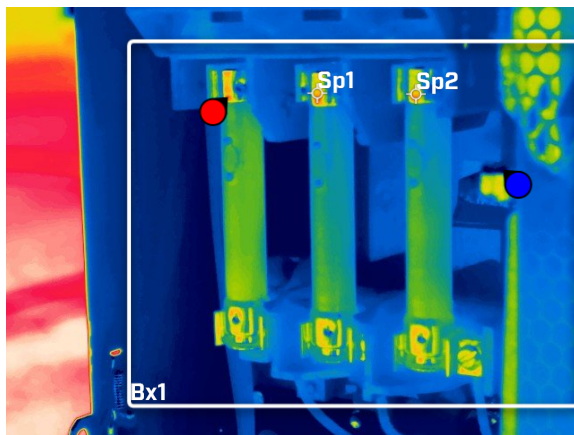

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 10.4,8.5,9.2amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 115 / 271

Visual Photo



Equipment name : RTU #4
Device name : Roof Top Units
Measurement Point : #4
Status OK

Measurements

Value

Bx1



Max 188.8 °F

Min 56.2 °F

Area 2.048 ft²

Sp1 184.4 °F

Thermogram 107 Created: 5/27/2026 1:28:01 PM

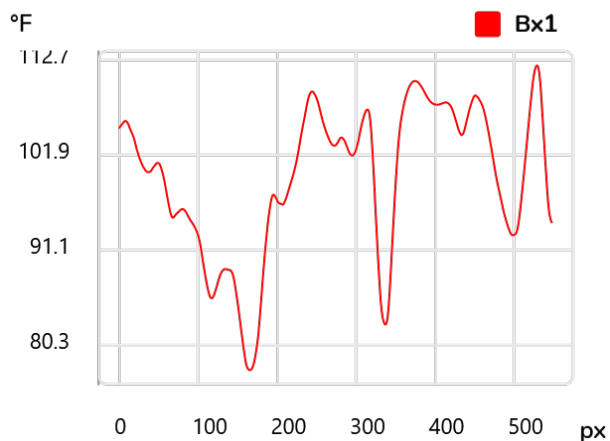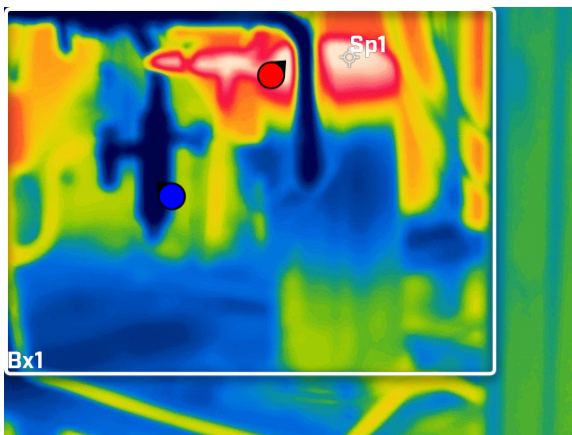

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 10.4,8.5,9.2amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 4.76 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 116 / 271

Visual Photo

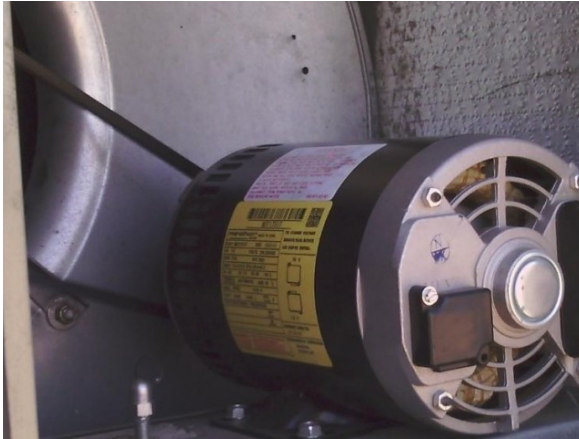

Equipment name : RTU #4
Device name : Roof Top Units
Measurement Point : #4
Status OK

Measurements

Value

Bx1



Max 133.9 °F

Min 49.2 °F

Area 0.545 ft²

Sp1 96.8 °F

Thermogram 108 Created: 5/27/2026 1:33:27 PM

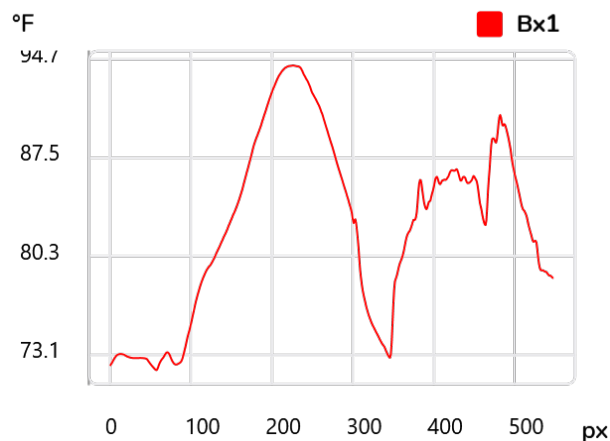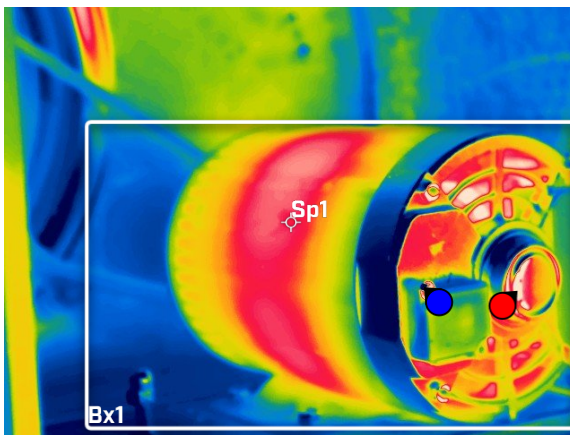

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 10.4,8.5,9.2amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.68 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 117 / 271

Visual Photo





Equipment name : RTU #4
Device name : Roof Top Units
Measurement Point : #4
Status OK

Measurements

Bx1	
Max	122.1 °F
Min	79.4 °F
Area	0.407 ft²
Dt1	
Bx1.Max	42.7 °F
-Bx1.Min	
Sp1	117.1 °F
Sp2	109.2 °F

Thermogram 109 Created: 6/3/2026 2:46:11 PM

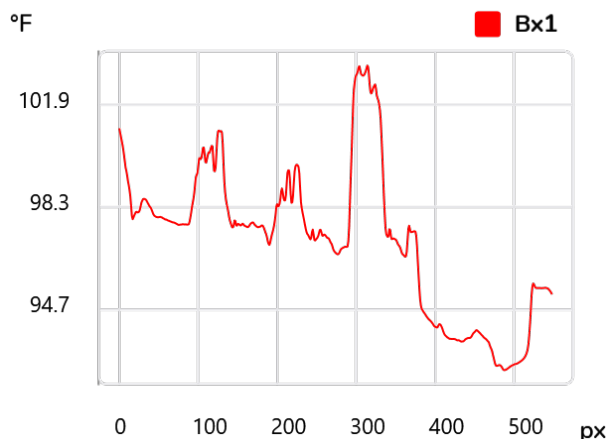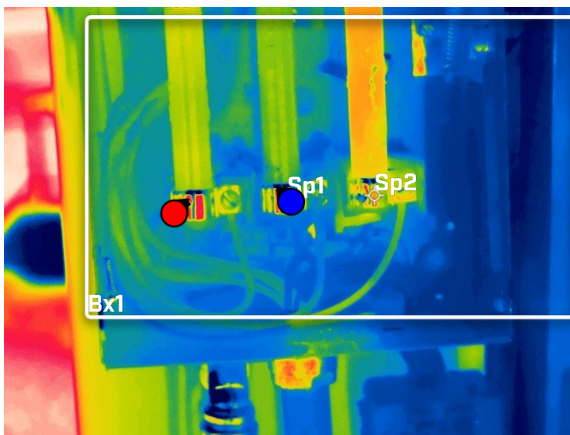

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 10.4,8.5,9.2amps

Priority None

Parameters

Emissivity	0.95
Distance	2.34 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 118 / 271

Visual Photo



Equipment name : RTU #5
Device name : Roof Top Units
Measurement Point : #5
Status OK

Measurements

Value

Bx1

Max 107.1 °F



Min 77.2 °F

Area 0.195 ft²

Sp1 102.4 °F

Sp2 100.8 °F

Thermogram 110 Created: 6/3/2026 3:36:28 PM

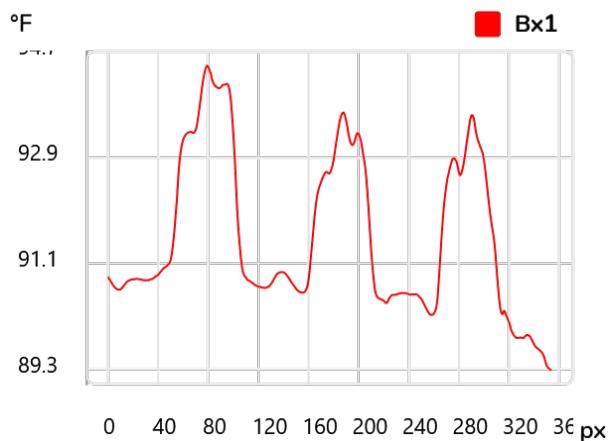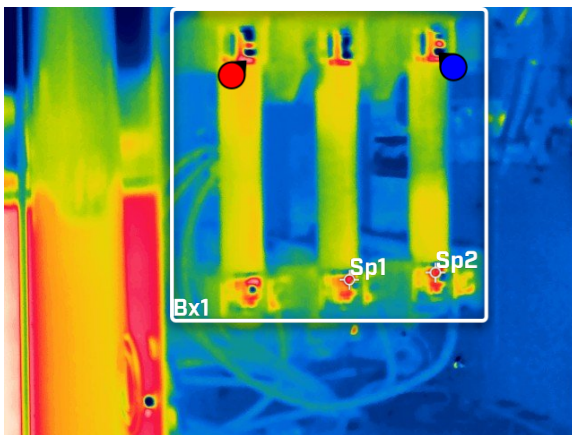

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 5,4.8,5.6

Priority None

Parameters


Emissivity 0.95
Distance 1.97 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 119 / 271

Visual Photo

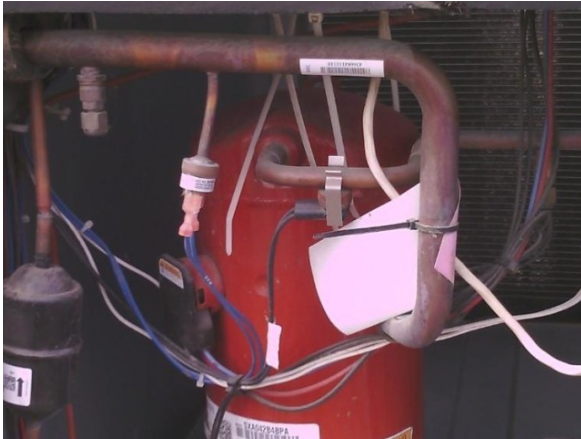

Equipment name : RTU #5
Device name : Roof Top Units
Measurement Point : #5
Status OK

Measurements

Value

Bx1



Max 166.2 °F

Min 53.6 °F

Area 0.842 ft²

Sp1 96.1 °F

Thermogram 111 Created: 6/3/2026 3:40:03 PM

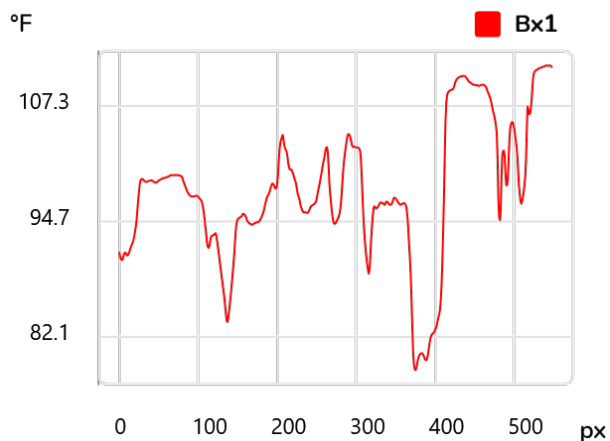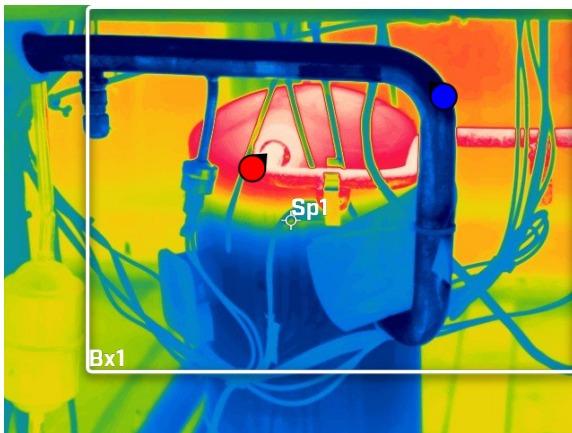

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 5,4.8,5.6amps

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.05 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 120 / 271

Visual Photo





Equipment name : RTU #5
Device name : Roof Top Units
Measurement Point : #5
Status OK

Measurements

Value	
Bx1	
Max	145.3 °F
Min	71.0 °F
Area	0.974 ft²
Sp1	138.2 °F

Thermogram 112 Created: 6/3/2026 3:40:38 PM

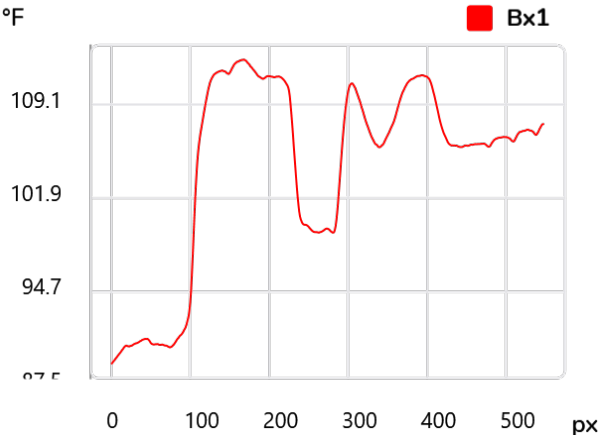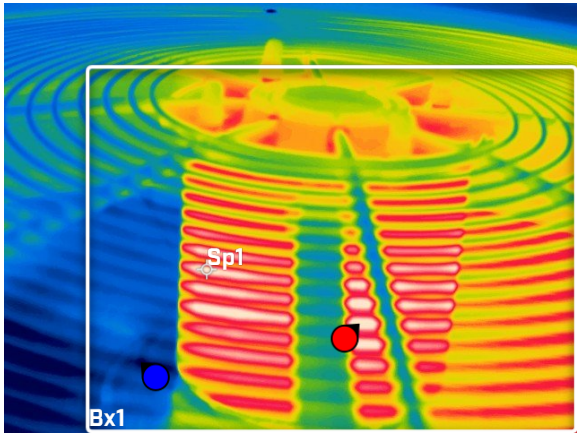

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment 5,4.8,5.6 amps
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 121 / 271

Visual Photo





Equipment name : RTU #7
Device name : Roof Top Units
Measurement Point : #7
Status OK

Measurements

Value	
Bx1	
Max	104.4 °F
Min	84.3 °F
Area	0.538 ft²
Sp1	102.0 °F

Thermogram 113 Created: 6/3/2026 3:20:20 PM

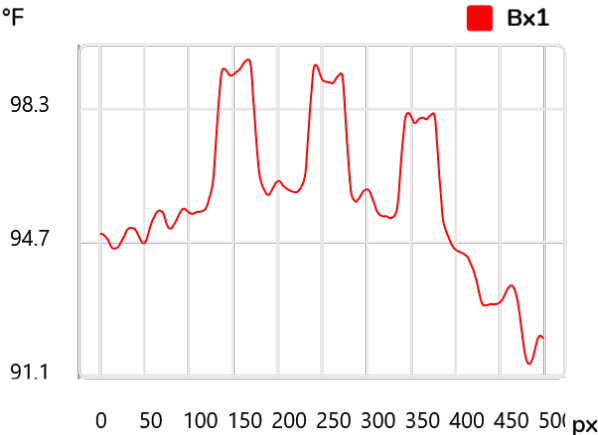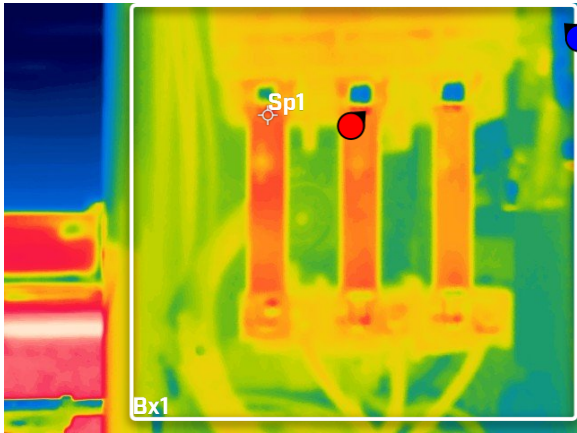

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 2.40 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 122 / 271

Visual Photo

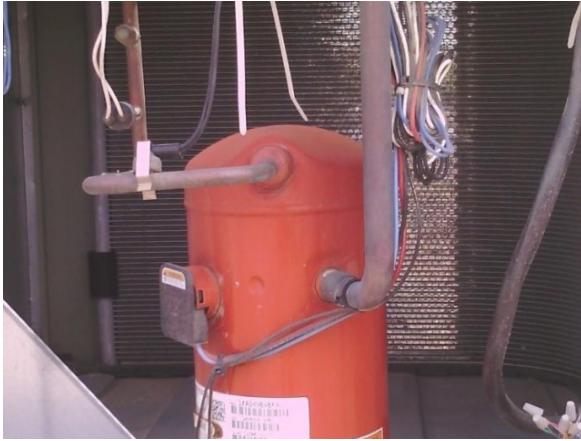

Equipment name : RTU #7
Device name : Roof Top Units
Measurement Point : #7
Status OK

Measurements

Value

Bx1



Max 154.2 °F

Min 29.3 °F

Area 1.330 ft²

Sp1 150.4 °F

Thermogram 114 Created: 6/3/2026 3:21:53 PM

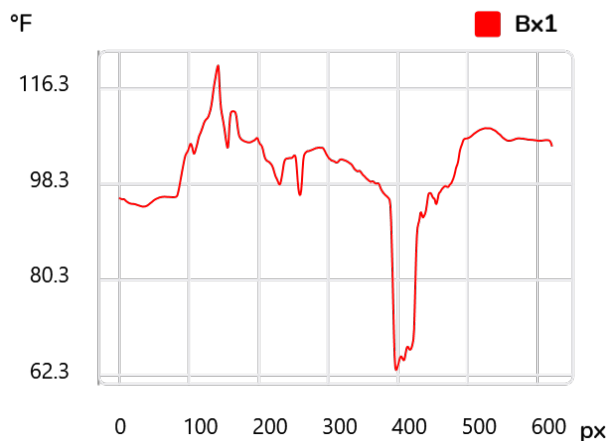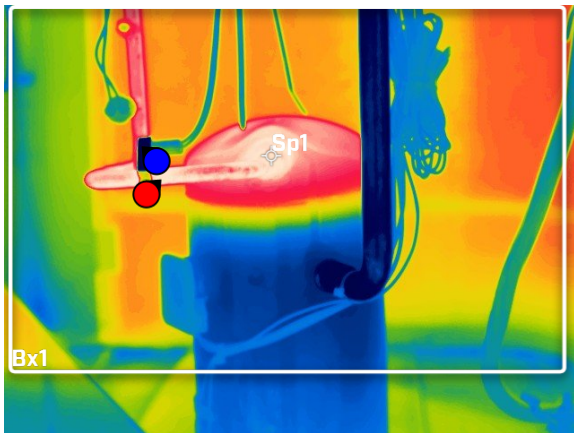

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.60 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 123 / 271

Visual Photo



Equipment name : RTU #7
Device name : Roof Top Units
Measurement Point : #7
Status OK



Measurements

Value

Bx1

Max 149.6 °F
Min 29.3 °F
Area 0.708 ft²
Sp1 100.4 °F

Thermogram 115 Created: 6/3/2026 3:22:33 PM

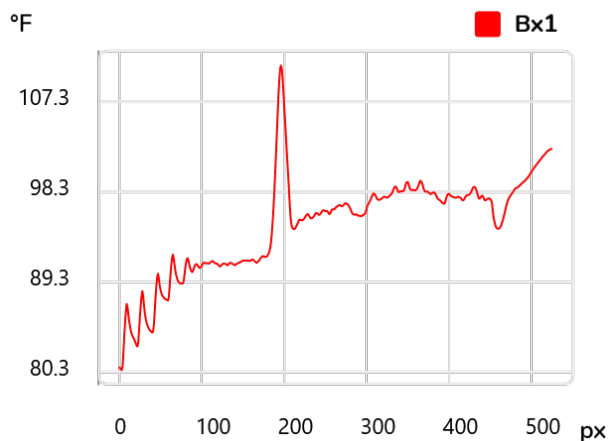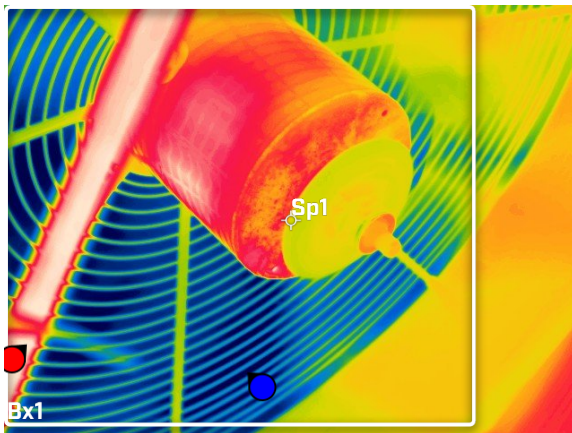

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity 0.95
Distance 2.68 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 124 / 271

Visual Photo


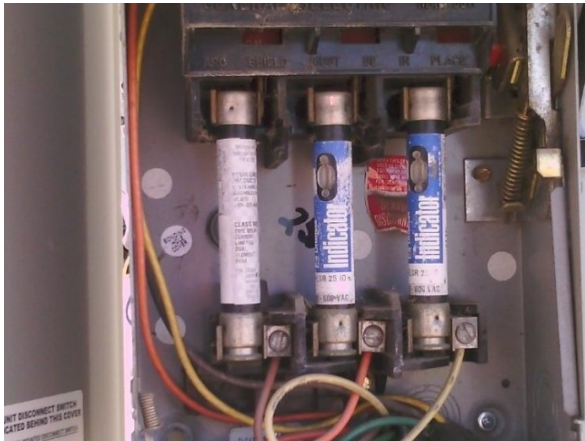


Equipment name : RTU #11
Device name : Roof Top Units
Measurement Point : #11
Status Note

Measurements

Value	
Bx1	
Max	121.4 °F
Min	92.9 °F
Area	0.398 ft²
Sp1	109.4 °F

Thermogram 116 Created: 5/27/2026 3:25:13 PM

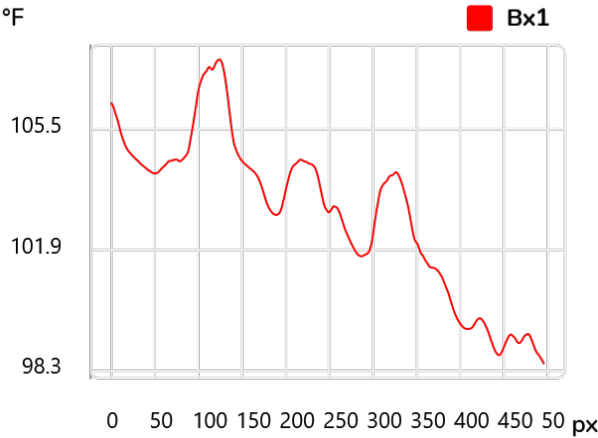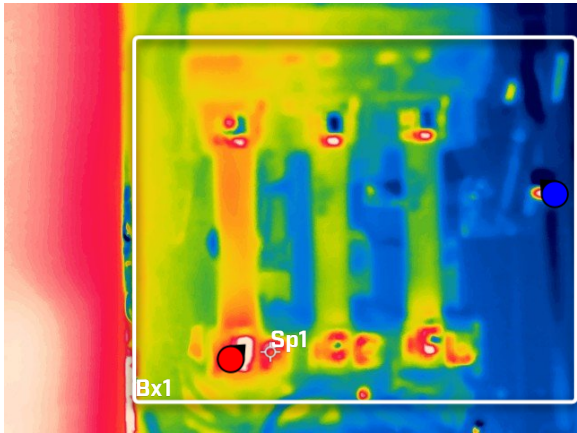

Text Annotations

Issue Loose connection(s)
Recommended Action Inspect connections
Comment Look for loose fuse connection. Monitor fuse function.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.21 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 125 / 271

Visual Photo



Equipment name : RTU #11
Device name : Roof Top Units
Measurement Point : #11
Status Note

Measurements

Value

Bx1

Max 184.1 °F



Min 44.4 °F

Area 2.043 ft²

Sp1 100.1 °F

Sp2 170.1 °F

Thermogram 117 Created: 5/27/2026 3:26:26 PM

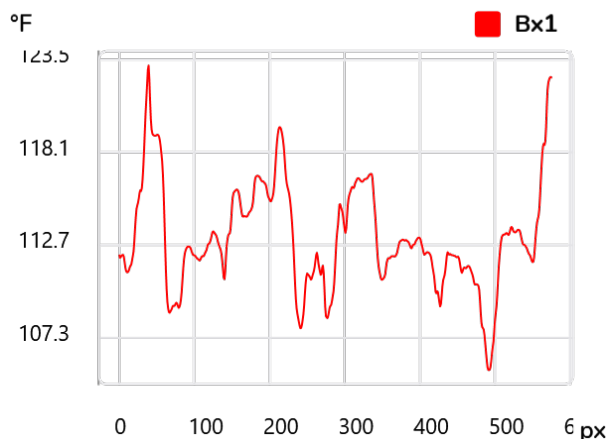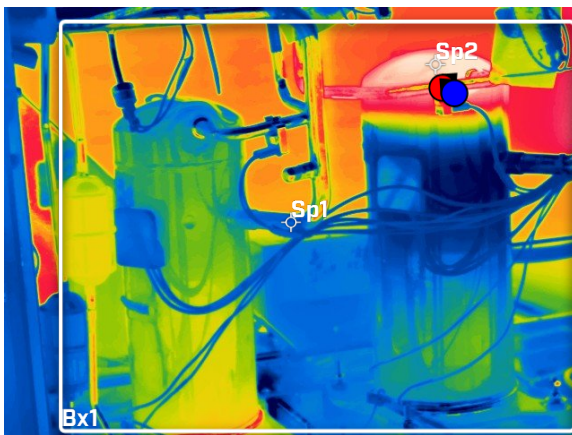

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Loose connection(s)

Recommended Action Inspect connections

Comment Look for loose fuse connection. Monitor fuse function.

Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 4.38 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 126 / 271

Visual Photo





Equipment name : RTU #11
Device name : Roof Top Units
Measurement Point : #11
Status Note

Measurements

Bx1	
Max	118.6 °F
Min	28.1 °F
Dt1	
Bx1.Max	90.6 °F
-Bx1.Min	
Sp1	117.6 °F

Thermogram 118 Created: 5/27/2026 3:28:29 PM

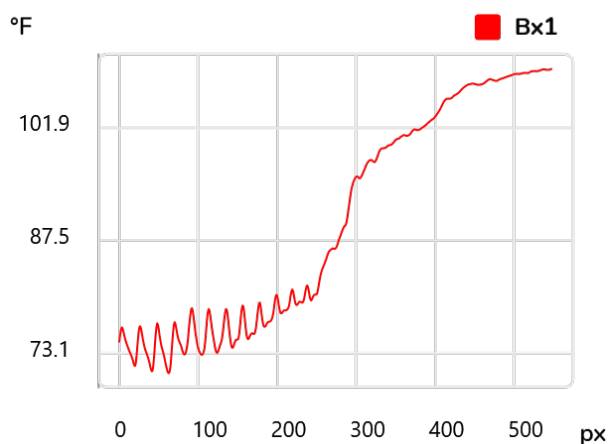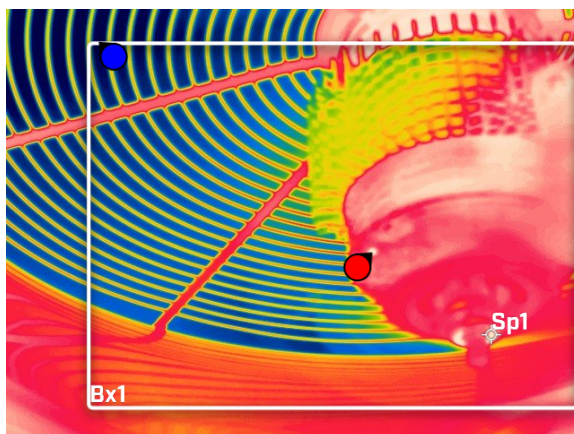

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Loose connection(s)

Recommended Action Inspect connections

Comment Look for loose fuse connection. Monitor fuse function.

Priority 2-Intermediate/Investigate

Parameters

Emissivity	0.95
Distance	3.27 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 127 / 271

Visual Photo



Equipment name : RTU #15
Device name : Roof Top Units
Measurement Point : #15
Status OK

Measurements

Value

Bx1



Max 131.1 °F

Min 62.2 °F

Area 0.675 ft²

Sp1 108.8 °F

Thermogram 119 Created: 5/27/2026 3:39:59 PM

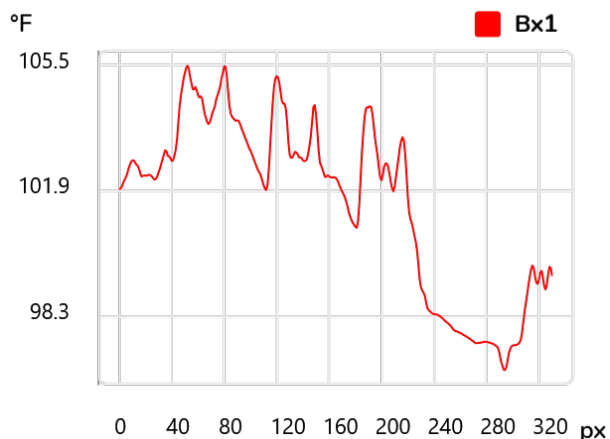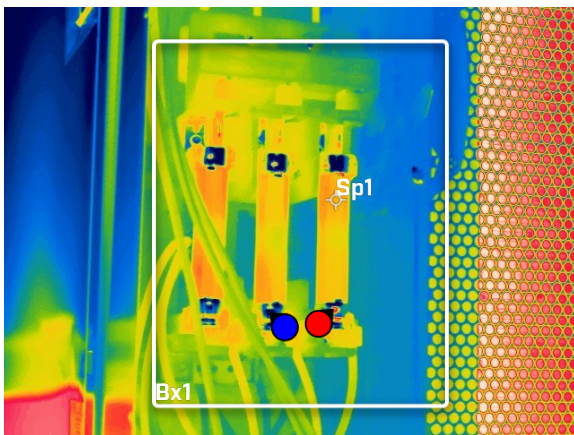

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.52 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 128 / 271

Visual Photo





Equipment name : RTU #15
Device name : Roof Top Units
Measurement Point : #15
Status OK

Measurements

Value	
Bx1	
Max	174.7 °F
Min	55.7 °F
Area	3.876 ft²
Sp1	167.3 °F

Thermogram 120 Created: 5/27/2026 3:42:28 PM

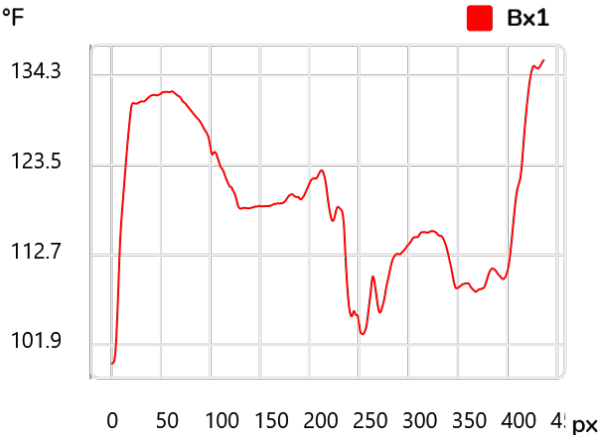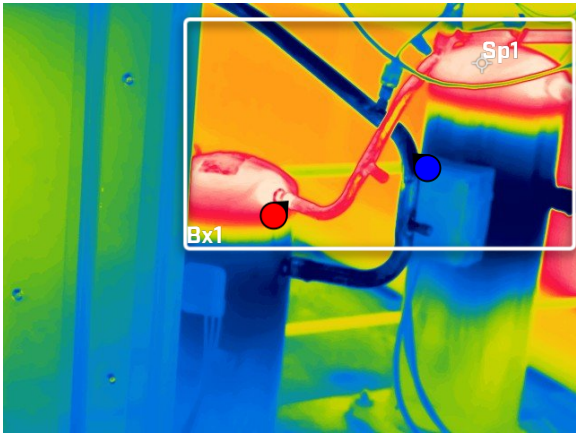

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters


Emissivity 0.95
Distance 9.22 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 129 / 271

Visual Photo

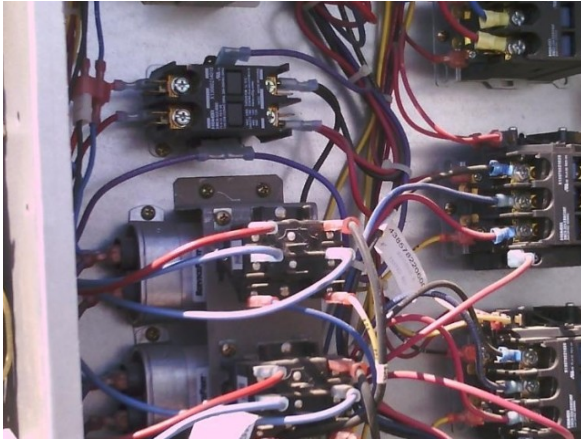

Equipment name : RTU #15
Device name : Roof Top Units
Measurement Point : #15
Status OK

Measurements

Value

Bx1

Max 156.2 °F



Min 71.1 °F

Area 0.727 ft²

Sp1 145.7 °F

Sp2 143.6 °F

Thermogram 121 Created: 5/27/2026 3:43:46 PM

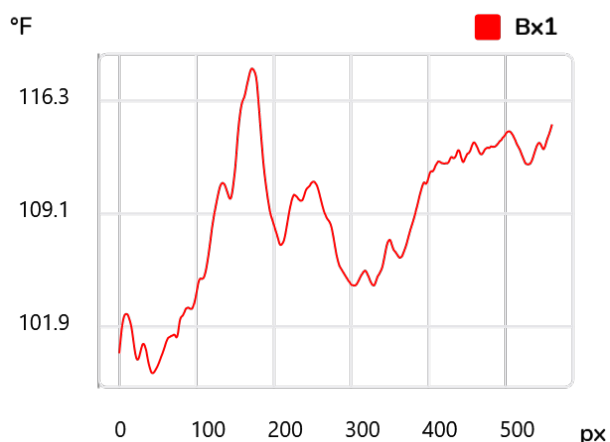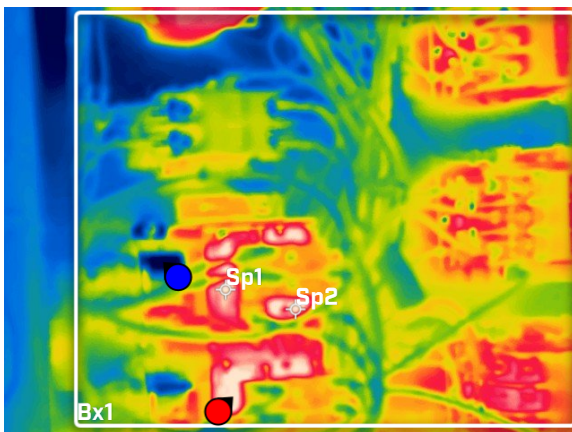

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 2.64 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 130 / 271

Visual Photo



Equipment name : RTU #15
Device name : Roof Top Units
Measurement Point : #15
Status OK

Measurements

Value

Bx1



Max 119.4 °F

Min 49.0 °F

Area 1.890 ft²

Sp1 100.4 °F

Thermogram 122 Created: 5/27/2026 3:49:28 PM

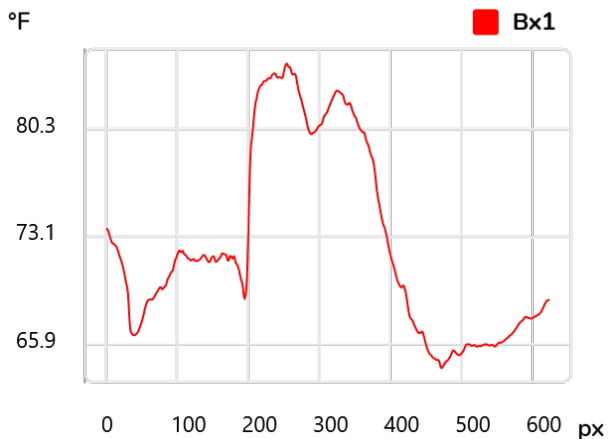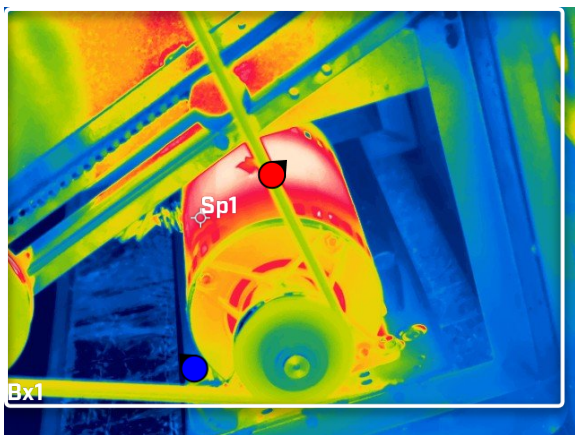

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 4.11 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 131 / 271

Visual Photo



Equipment name : RTU #17

Device name : Roof Top Units



Measurement Point : #17

Status Note

Measurements

Bx1	
Max	118.9 °F
Min	83.2 °F
Area	0.575 ft²
Dt1	
Bx1.Max	35.6 °F
-Bx1.Min	
Sp1	116.2 °F
Sp2	117.5 °F

Thermogram 123 Created: 5/27/2026 4:01:13 PM

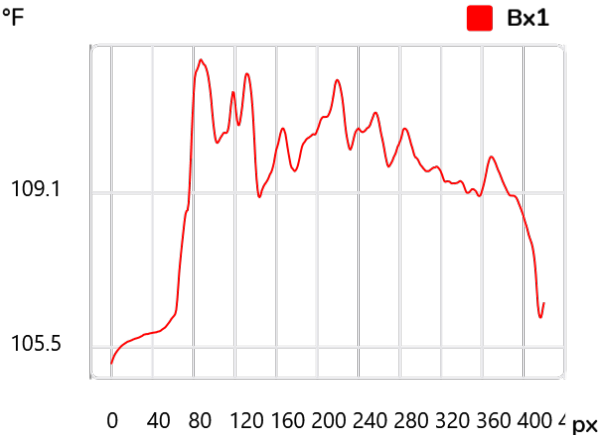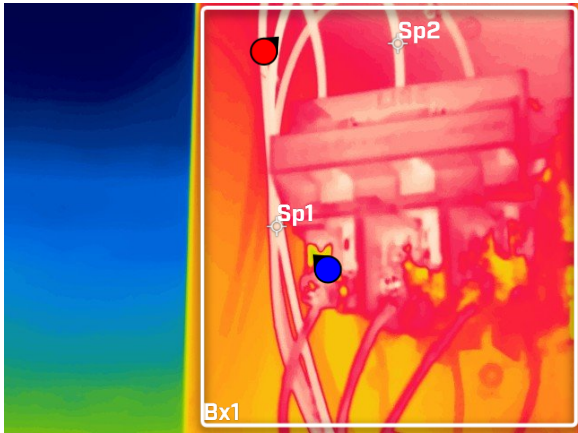

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Clean equipment

Comment Clean with compressed air

Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96

Lens FOL18

Camera serial 90206013

Parameters

Emissivity 0.95

Distance 2.70 ft

Atmospheric temp. 68.0 °F

Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 132 / 271

Visual Photo





Equipment name : RTU #17
Device name : Roof Top Units
Measurement Point : #17
Status Note

Measurements

Bx1	
Max	192.1 °F
Min	59.6 °F
Area	1.998 ft ²
Dt1	
Bx1.Max	132.6 °F
-Bx1.Min	
Sp1	91.9 °F

Thermogram 124 Created: 5/27/2026 4:04:31 PM

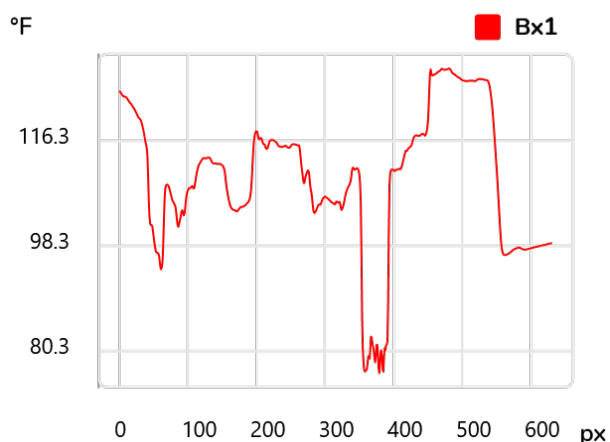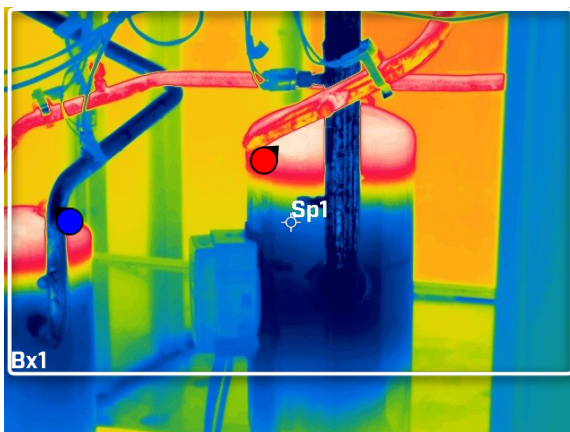

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air
Priority 2-Intermediate/Investigate

Parameters

Emissivity	0.95
Distance	4.38 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 133 / 271

Visual Photo





Equipment name : RTU #17
Device name : Roof Top Units
Measurement Point : #17
Status Note

Measurements

Bx1	
Max	192.8 °F
Min	58.0 °F
Area	1.469 ft ²
Dt1	
Bx1.Max	134.8 °F
-Bx1.Min	
Sp1	155.7 °F

Thermogram 125 Created: 5/27/2026 4:06:04 PM

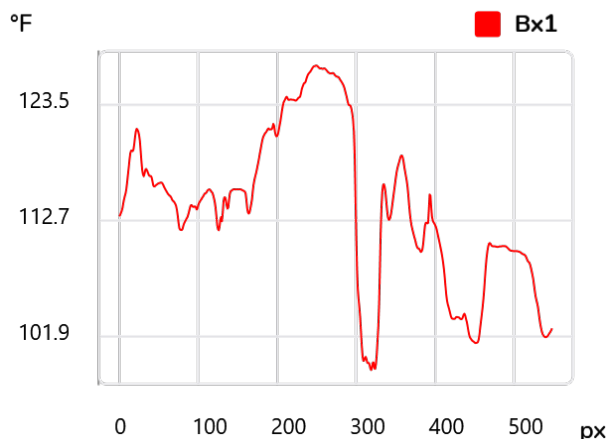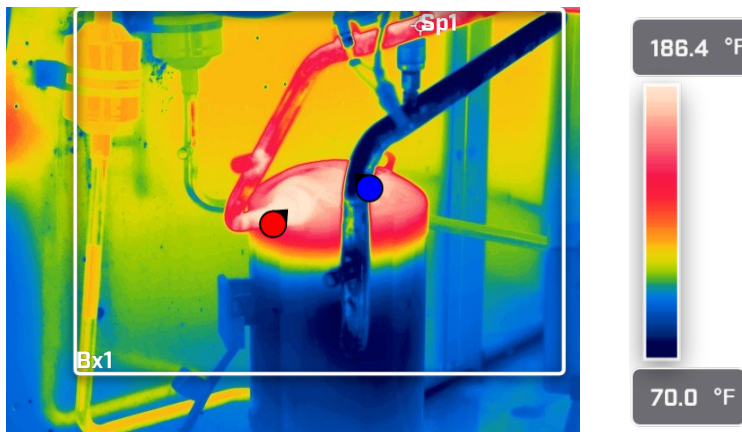

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air
Priority 2-Intermediate/Investigate

Parameters


Emissivity 0.95
Distance 4.03 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 134 / 271

Visual Photo

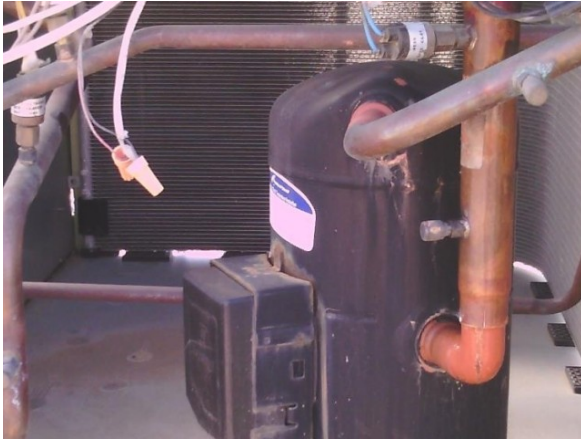

Equipment name : RTU #17
Device name : Roof Top Units
Measurement Point : #17
Status Note

Measurements

Value

Bx1



Max 190.6 °F

Min 57.9 °F

Area 0.054 ft²

Sp1 166.1 °F

Thermogram 126 Created: 5/27/2026 4:06:25 PM

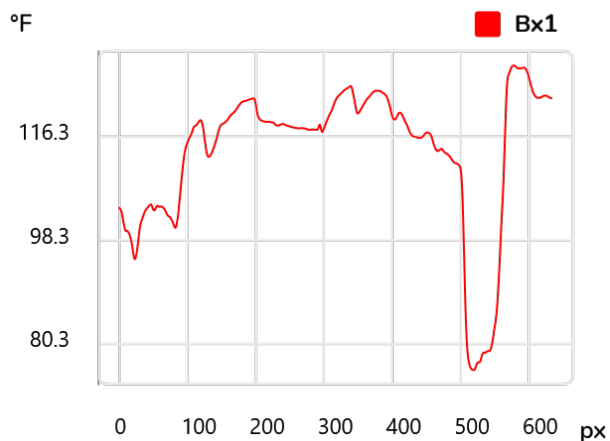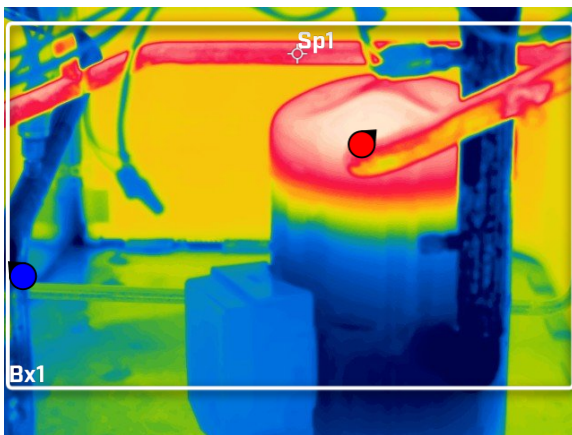

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Clean equipment

Comment Clean with compressed air

Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 0.72 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 135 / 271

Visual Photo





Equipment name : RTU #17
Device name : Roof Top Units
Measurement Point : #17
Status Note

Measurements

Value	
Bx1	
Max	123.0 °F
Min	48.3 °F
Area	1.619 ft²
Sp1	122.1 °F
Sp2	98.3 °F

Thermogram 127 Created: 5/27/2026 4:08:55 PM

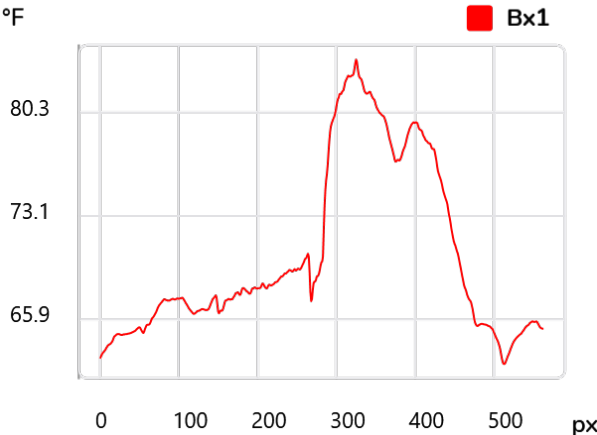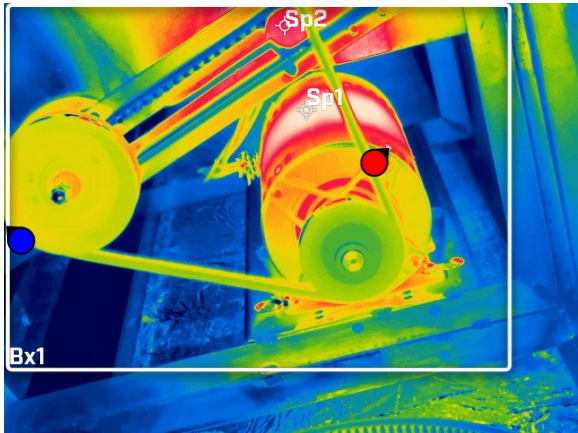

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air
Priority 2-Intermediate/Investigate

Parameters

Emissivity	0.95
Distance	4.18 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 136 / 271

Visual Photo



Equipment name : RTU #18
Device name : Roof Top Units
Measurement Point : #18
Status Note

Measurements

Value

Bx1



Max 105.3 °F

Min 78.0 °F

Area 0.427 ft²

Sp1 99.0 °F

Thermogram 128 Created: 6/3/2026 3:06:59 PM

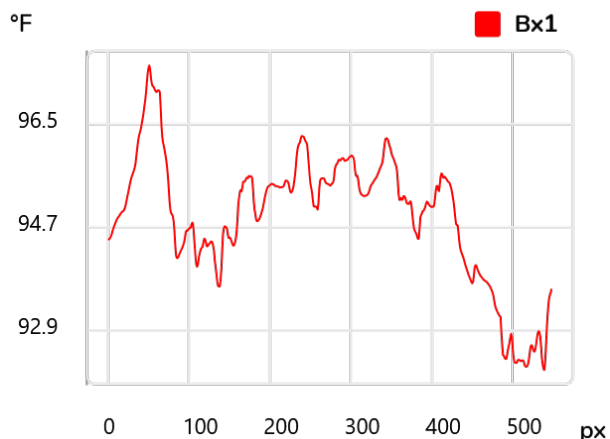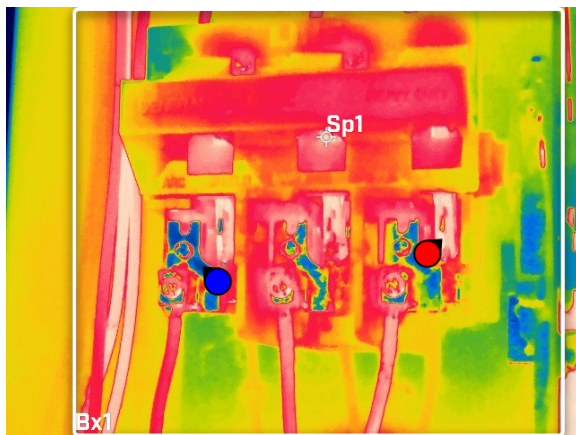

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Clean equipment

Comment 25.4,21.6,23.7amps. Clean with compressed air

Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 2.01 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 137 / 271

Visual Photo



Equipment name : RTU #18
Device name : Roof Top Units
Measurement Point : #18
Status Note

Measurements

Value

Bx1

Max 159.3 °F



Min 49.0 °F

Area 1.894 ft²

Sp1 139.5 °F

Sp2 124.5 °F

Thermogram 129 Created: 6/3/2026 3:08:52 PM

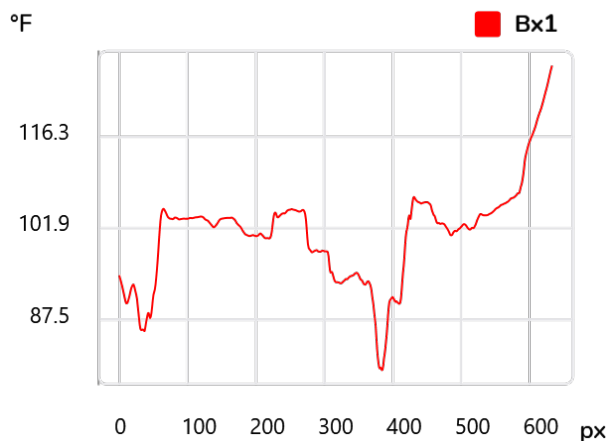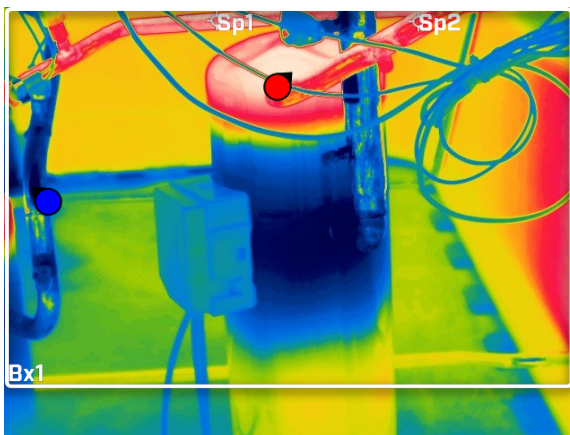

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Clean equipment

Comment 25.4,21.6,23.7amps. Clean with compressed air

Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 4.19 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 138 / 271

Visual Photo



Equipment name : RTU #18
Device name : Roof Top Units
Measurement Point : #18
Status Note

Measurements

Value

Bx1



Max 166.9 °F

Min 47.6 °F

Area 0.928 ft²

Sp1 126.6 °F

Thermogram 130 Created: 6/3/2026 3:09:46 PM

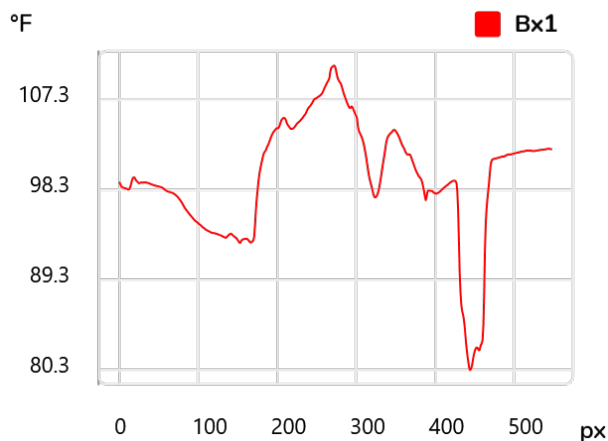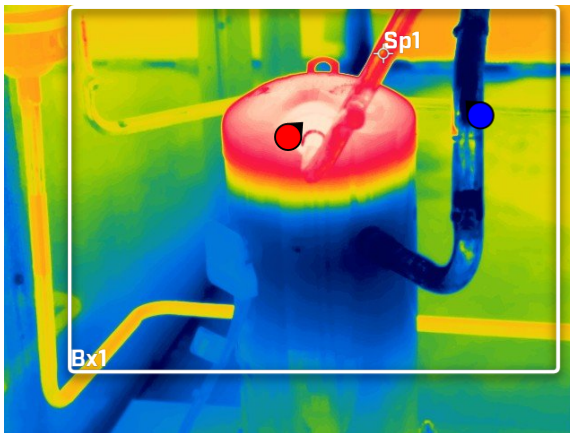

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Clean equipment

Comment 25.4,21.6,23.7amps. Clean with compressed air

Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.20 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 139 / 271

Visual Photo



Equipment name : RTU #6
Device name : Roof Top Units
Measurement Point : #6
Status OK

Measurements

Value

Bx1



Max 104.9 °F

Min 82.7 °F

Area 1.025 ft²

Sp1 102.0 °F

Thermogram 131 Created: 6/2/2026 1:11:16 PM

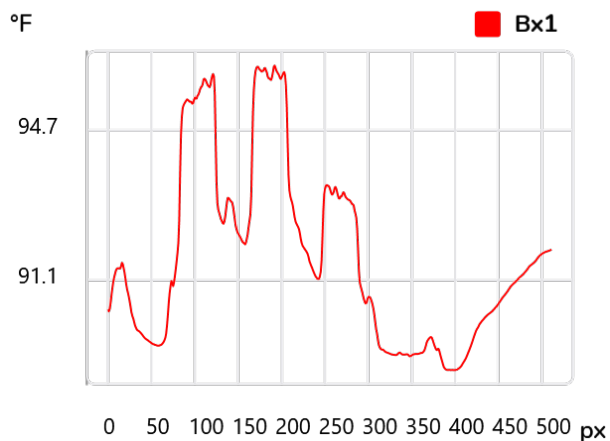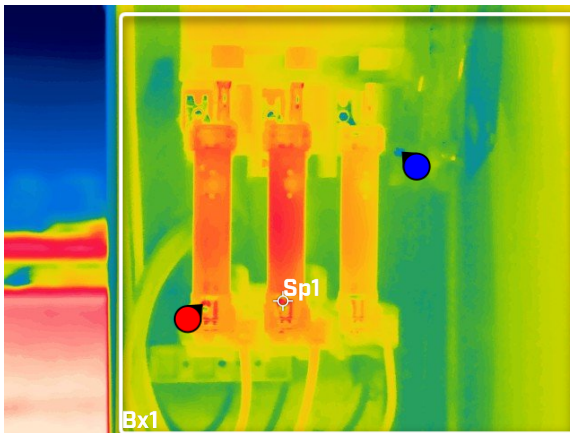

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.25 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 140 / 271

Visual Photo



Equipment name : RTU #6
Device name : Roof Top Units
Measurement Point : #6
Status OK

Measurements

Value

Bx1



Max 199.6 °F

Min 69.7 °F

Area 2.529 ft²

Sp1 187.0 °F

Thermogram 132 Created: 6/2/2026 1:14:12 PM

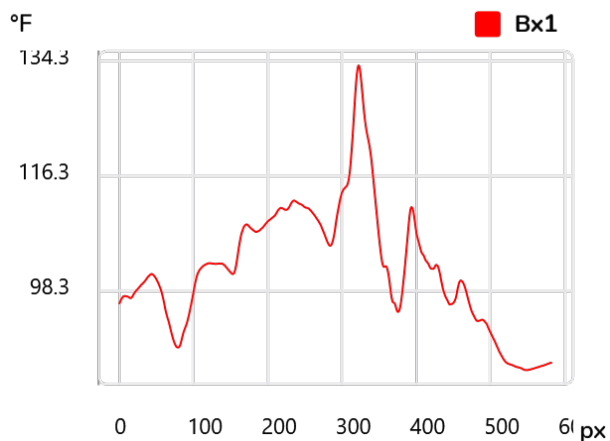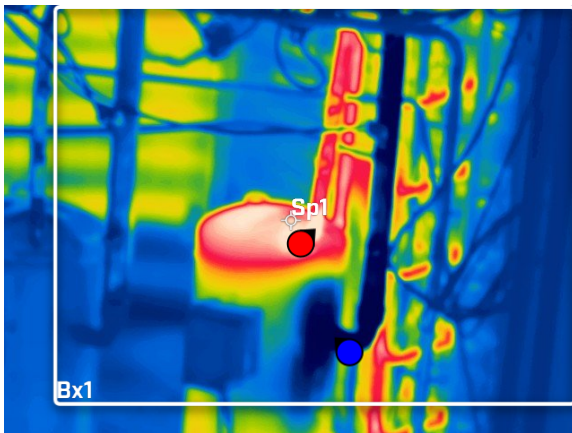

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 4.92 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 141 / 271

Visual Photo

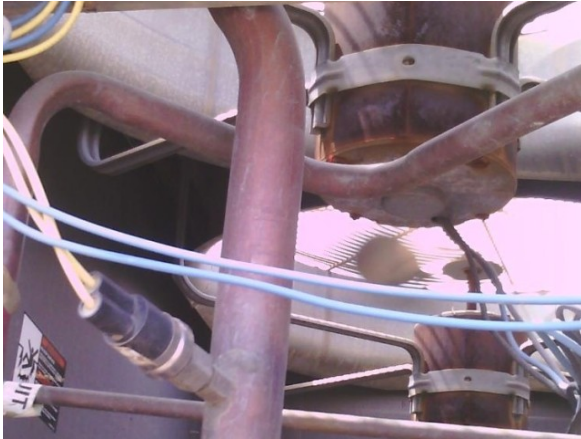

Equipment name : RTU #6
Device name : Roof Top Units
Measurement Point : #6
Status OK

Measurements

Value

Bx1

Max 166.6 °F



Min 69.4 °F

Area 1.123 ft²

Sp1 163.9 °F

Sp2 143.6 °F

Thermogram 133 Created: 6/2/2026 1:15:44 PM

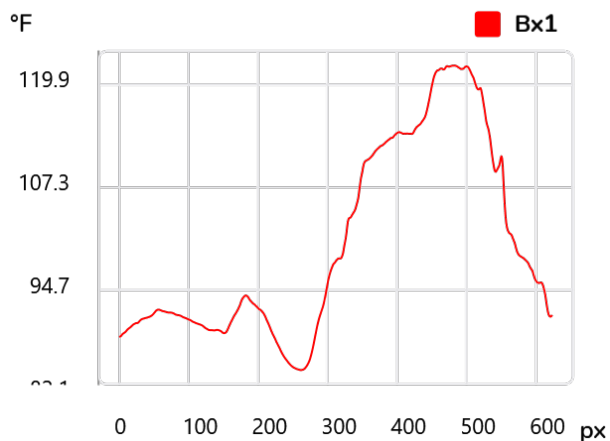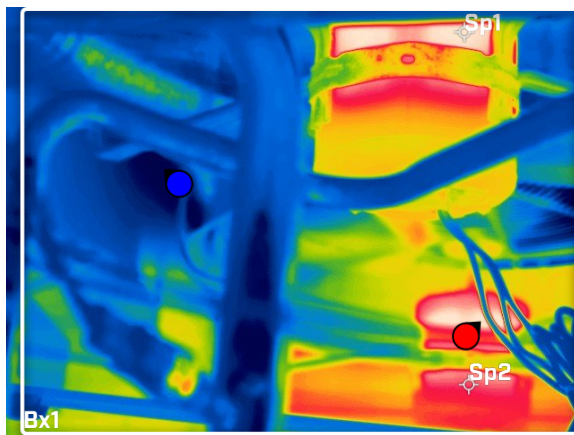

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.07 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 142 / 271

Visual Photo



Equipment name : RTU #6
Device name : Roof Top Units
Measurement Point : #6
Status OK

Measurements

Value

Bx1



Max 114.9 °F

Min 40.7 °F

Area 2.620 ft²

Sp1 91.5 °F

Thermogram 134 Created: 6/2/2026 1:20:51 PM

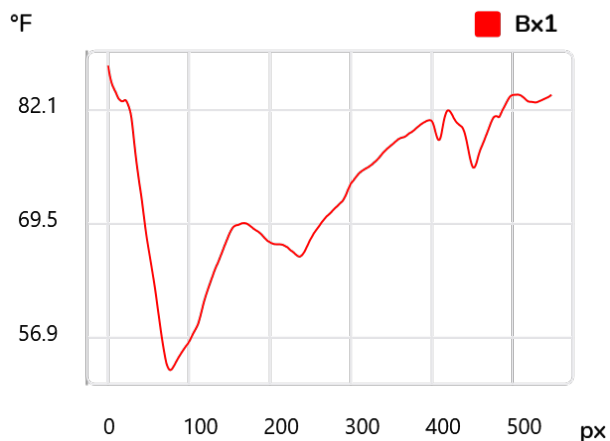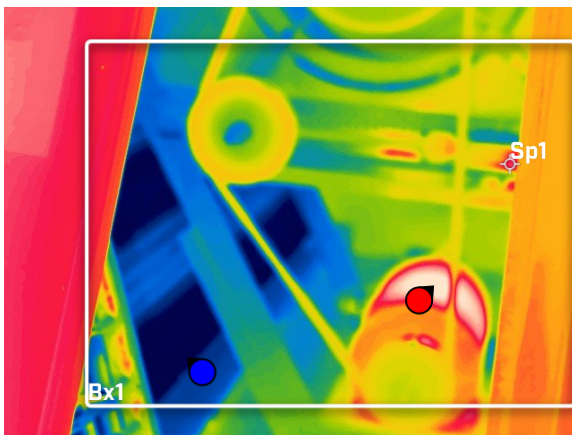

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 5.38 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 143 / 271

Visual Photo





Equipment name : RTU #21
Device name : Roof Top Units
Measurement Point : #21
Status Note

Measurements

Bx1	
Max	115.6 °F
Min	36.9 °F
Area	1.135 ft ²
Dt1	
Bx1.Max	78.7 °F
-Bx1.Min	
Sp1	94.4 °F
Sp2	107.8 °F

Thermogram 135 Created: 6/2/2026 1:33:25 PM

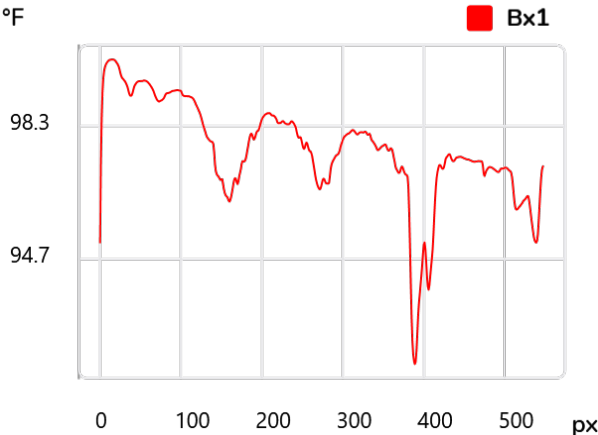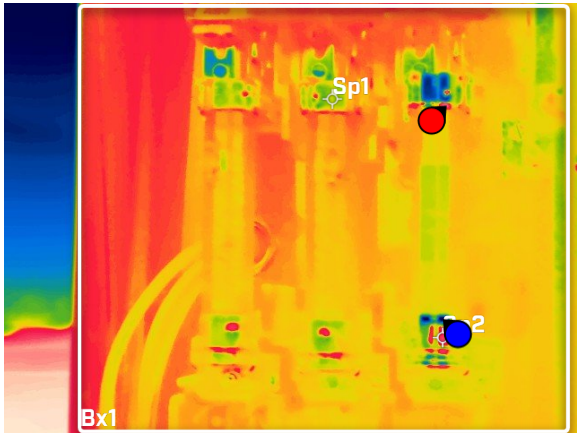

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Inspect connections
Comment This unit blew a fuse the day before inspection
Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 144 / 271

Visual Photo





Equipment name : RTU #21
Device name : Roof Top Units
Measurement Point : #21
Status Note

Measurements

Bx1	
Max	115.1 °F
Min	36.1 °F
Area	0.635 ft ²
Dt1	
Bx1.Max	79.0 °F
-Bx1.Min	
Sp1	107.2 °F

Thermogram 136 Created: 6/2/2026 1:34:22 PM

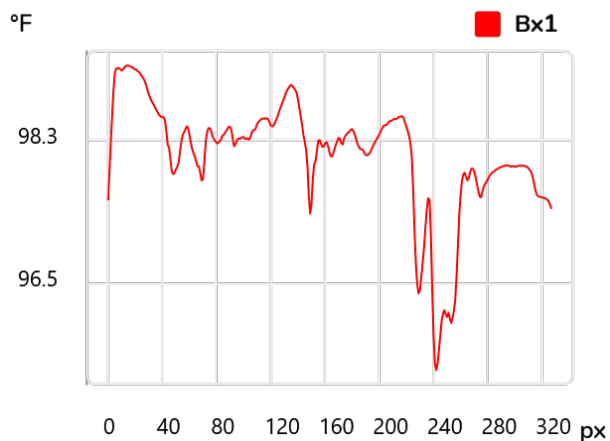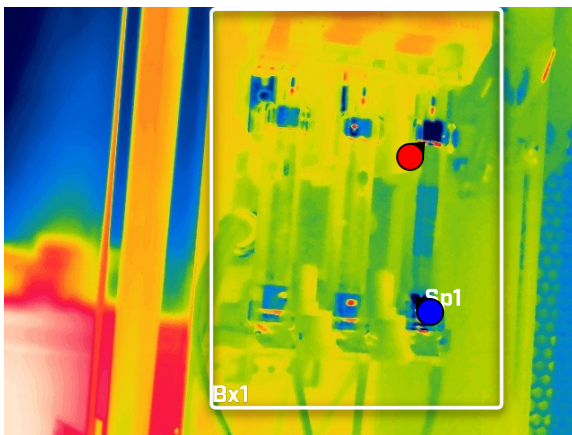

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Inspect connections

Comment This unit blew a fuse the day before inspection

Priority 2-Intermediate/Investigate

Parameters

Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 145 / 271

Visual Photo



Equipment name : RTU #12
Device name : Roof Top Units
Measurement Point : #12
Status OK

Measurements

Value

Bx1

Max 110.0 °F



Min 72.1 °F

Area 2.142 ft²

Sp1 99.5 °F

Sp2 101.1 °F

Thermogram 137 Created: 6/2/2026 1:55:25 PM

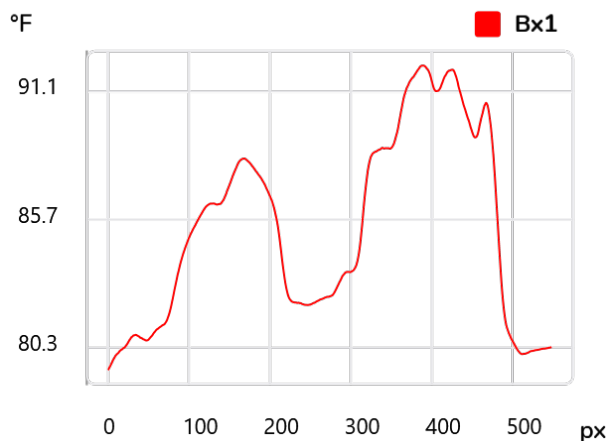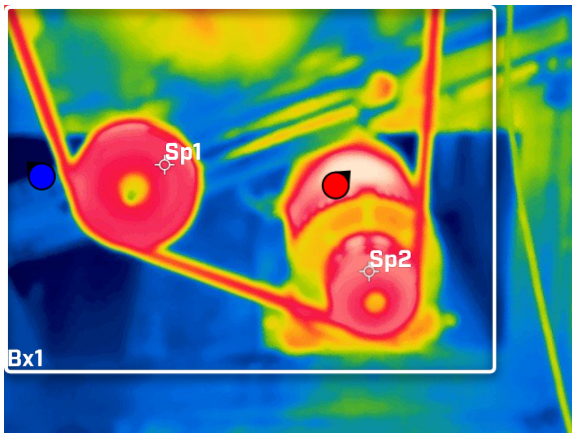

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 4.87 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 146 / 271

Visual Photo



Equipment name : RTU #13
Device name : Roof Top Units
Measurement Point : #13
Status OK

Measurements

Value

Bx1



Max 118.6 °F

Min 80.7 °F

Sp1 101.3 °F

Sp2 103.6 °F

Thermogram 138 Created: 6/2/2026 2:10:20 PM

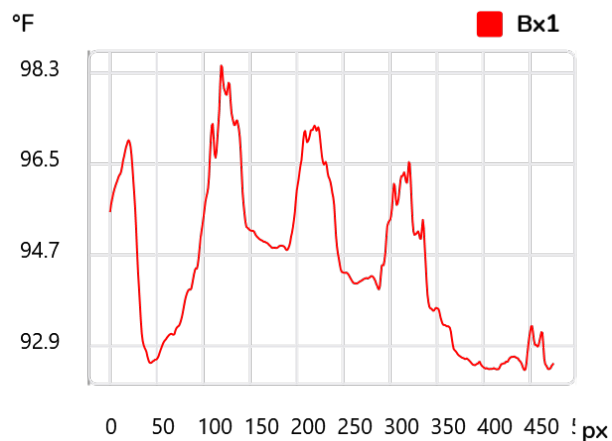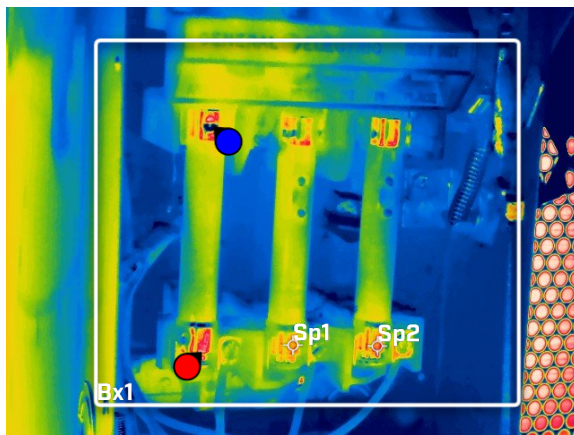

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity 0.95
Distance 2.01 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 147 / 271

Visual Photo

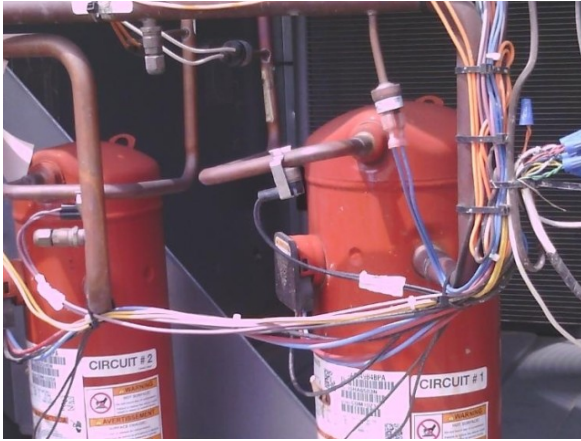

Equipment name : RTU #13
Device name : Roof Top Units
Measurement Point : #13
Status OK

Measurements

Value

Bx1



Max 174.9 °F

Min 63.8 °F

Area 1.142 ft²

Sp1 147.7 °F

Thermogram 139 Created: 6/2/2026 2:14:12 PM

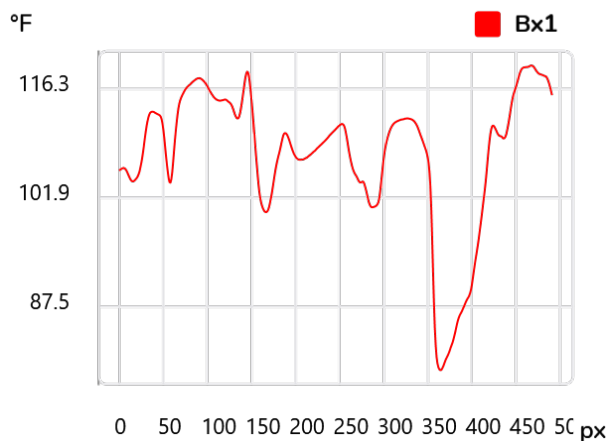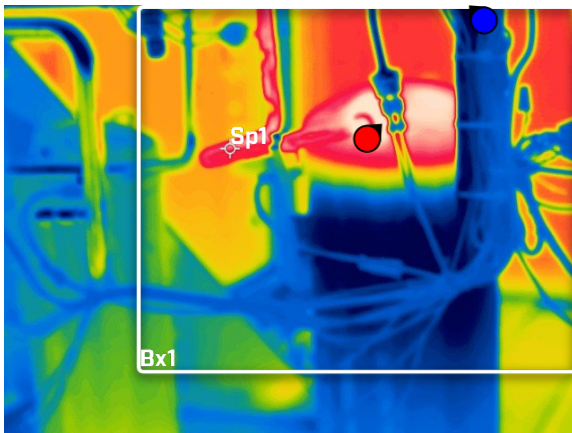

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.76 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 148 / 271

Visual Photo



Equipment name : RTU #14
Device name : Roof Top Units
Measurement Point : #14
Status OK



Measurements

Value

Bx1

Max 115.8 °F
Min 84.8 °F
Area 72.872 ft²
Sp1 107.5 °F
Sp2 103.8 °F

Thermogram 140 Created: 6/2/2026 2:26:49 PM

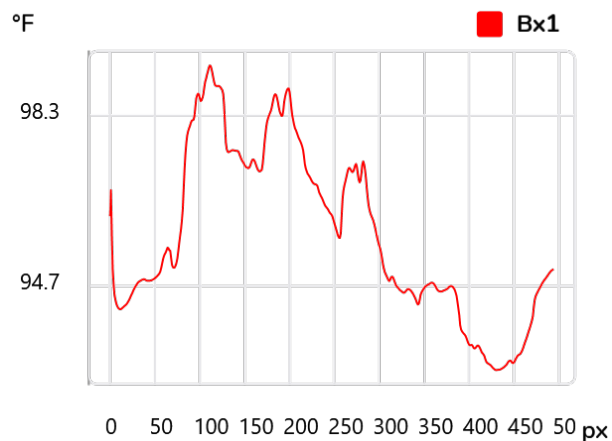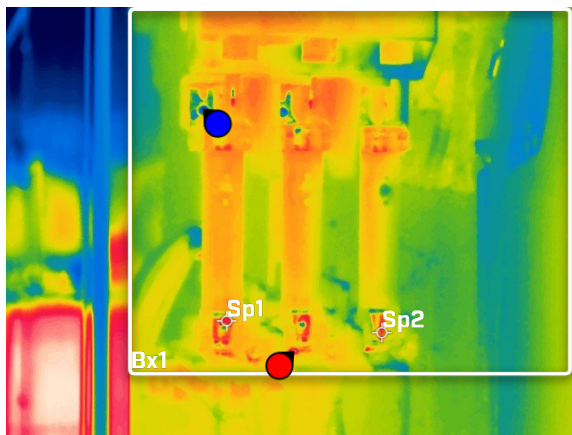

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment Unit cycled off

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 29.91 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 149 / 271

Visual Photo



Equipment name : RTU #14
Device name : Roof Top Units
Measurement Point : #14
Status OK

Measurements

Value

Bx1



Max 187.8 °F

Min 77.5 °F

Area 0.885 ft²

Sp1 181.7 °F

Thermogram 141 Created: 6/2/2026 2:29:04 PM

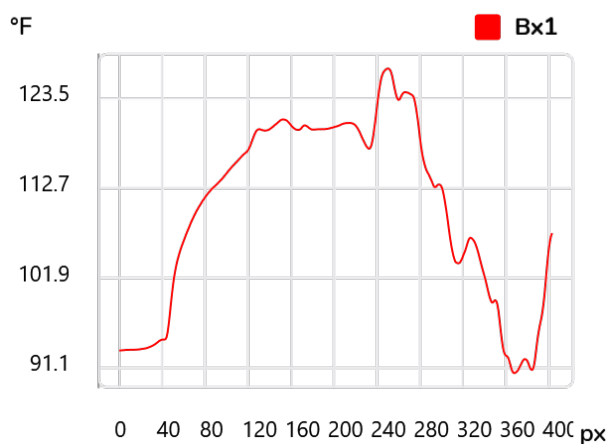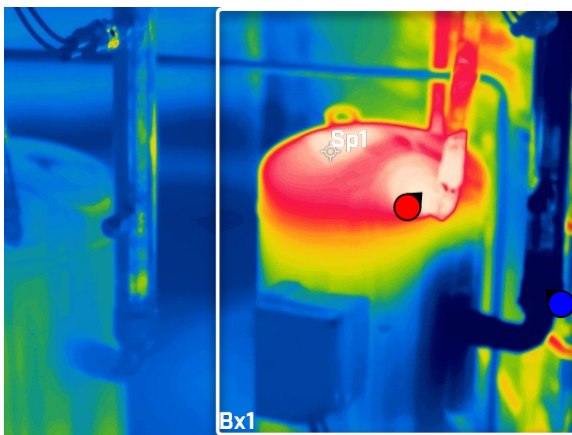

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment Unit cycled off

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.38 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 150 / 271

Visual Photo



Equipment name : RTU #20
Device name : Roof Top Units
Measurement Point : #20
Status Note

Measurements

Value

Bx1

Max 99.2 °F



Min 87.5 °F

Sp1 94.3 °F

Sp2 94.9 °F

Sp3 94.1 °F

Thermogram 142 Created: 6/2/2026 2:38:02 PM

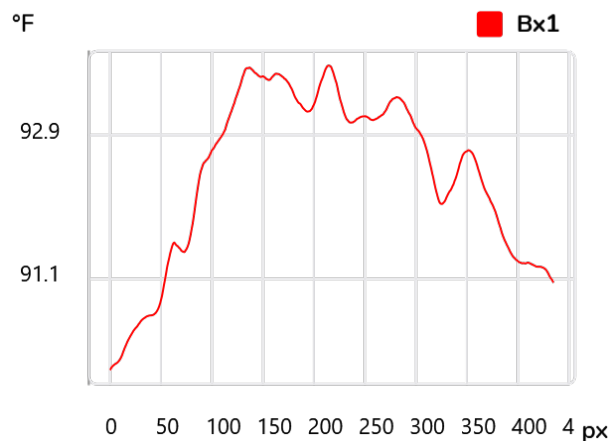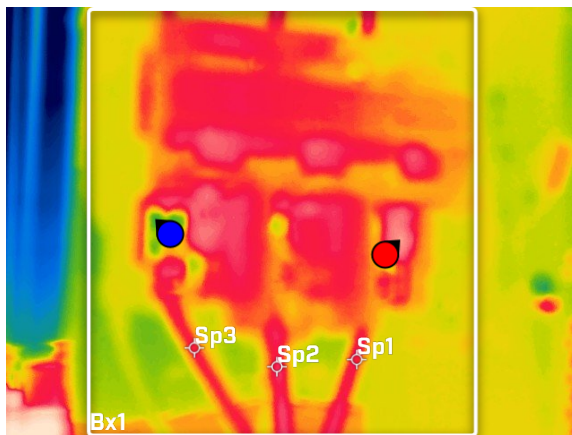

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Clean equipment

Comment Clean with compressed air.

Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 1.98 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 151 / 271

Visual Photo



Equipment name : RTU #22
Device name : Roof Top Units
Measurement Point : #22
Status OK

Measurements

Value

Bx1

Max 116.2 °F



Min 81.2 °F

Sp1 114.7 °F

Sp2 110.1 °F

Sp3 111.8 °F

Thermogram 143 Created: 6/3/2026 2:56:12 PM

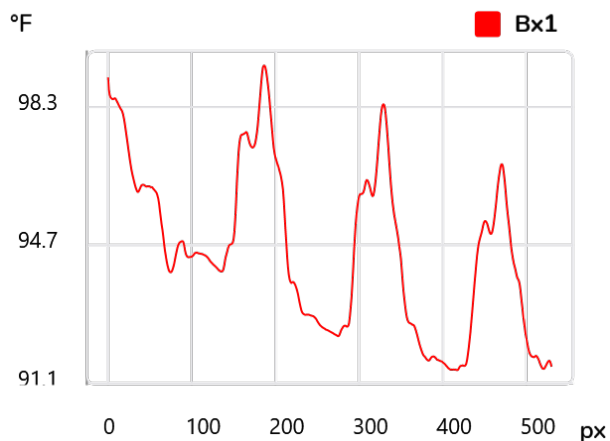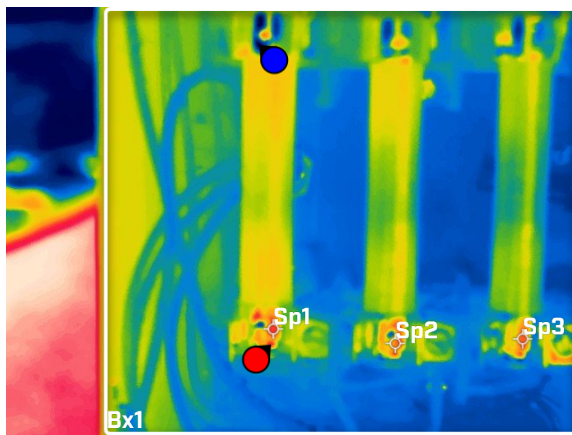

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 4.5,4.3,3.9amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 1.80 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 152 / 271

Visual Photo



Equipment name : RTU #22
Device name : Roof Top Units
Measurement Point : #22
Status OK

Measurements

Value

Bx1



Max 151.1 °F

Min 45.6 °F

Area 0.610 ft²

Sp1 73.3 °F

Thermogram 144 Created: 6/3/2026 2:57:39 PM

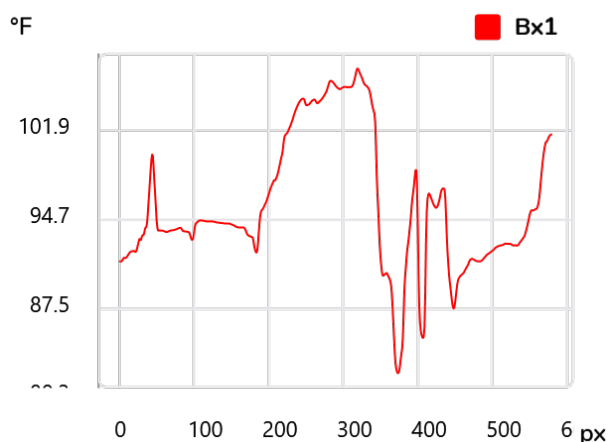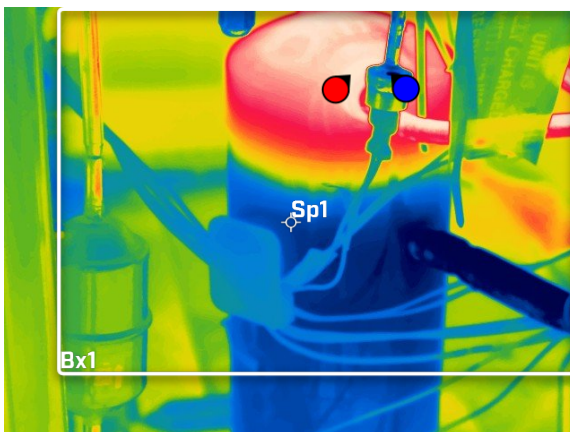

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 4.5,4.3,3.9amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.53 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 153 / 271

Visual Photo



Equipment name : RTU #22
Device name : Roof Top Units
Measurement Point : #22
Status OK

Measurements

Value

Bx1

Max 140.4 °F



Min 78.1 °F

Area 1.036 ft²

Sp1 115.3 °F


Thermogram 145

Created: 6/3/2026 2:58:17 PM

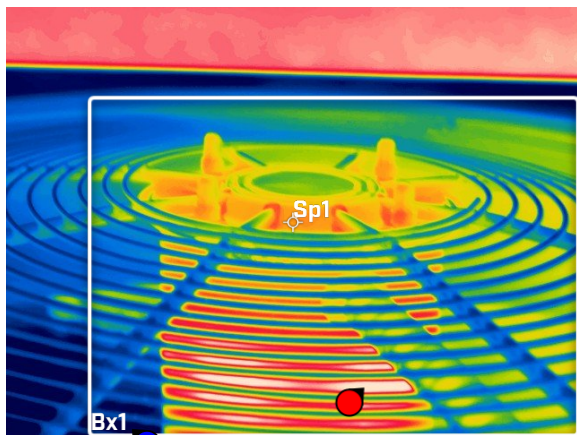

°F

Bx1

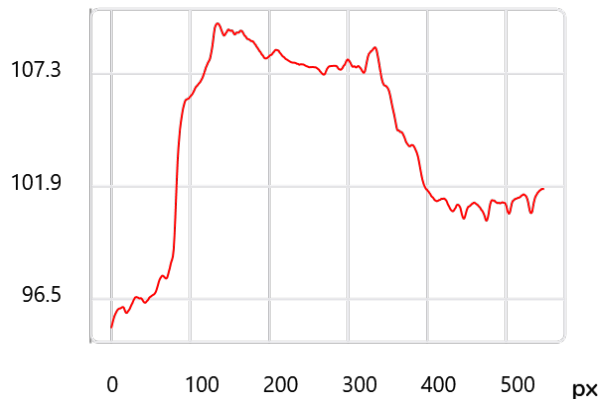

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 4.5,4.3,3.9amps

Priority None

Parameters

Emissivity 0.95
Distance 3.52 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 154 / 271

Visual Photo



Equipment name : RTU #23
Device name : Roof Top Units
Measurement Point : #23
Status OK



Measurements

Value

Bx1

Max 115.8 °F
Min 69.4 °F
Area 0.547 ft²
Sp1 114.5 °F
Sp2 113.0 °F
Sp3 112.9 °F

Thermogram 146 Created: 6/3/2026 1:55:18 PM

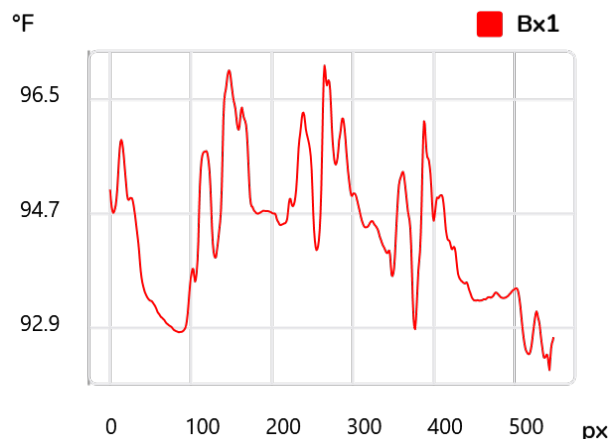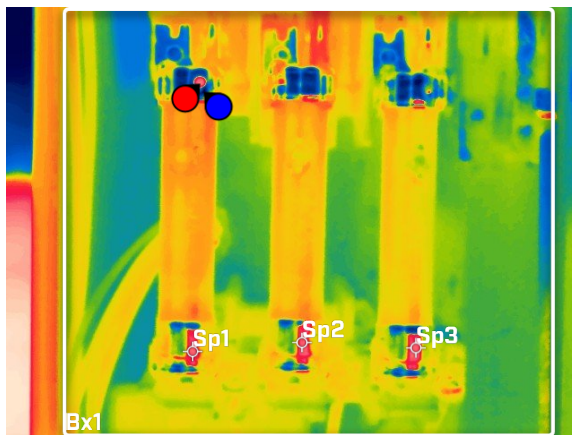

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 19.2,20.2,18.2 amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 155 / 271

Visual Photo





Equipment name : RTU #23
Device name : Roof Top Units
Measurement Point : #23
Status OK

Measurements

Bx1	
Max	170.3 °F
Min	59.6 °F
Area	0.974 ft²
Dt1	
Bx1.Max	110.7 °F
-Bx1.Min	
Sp1	161.9 °F

Thermogram 147 Created: 6/3/2026 1:59:45 PM

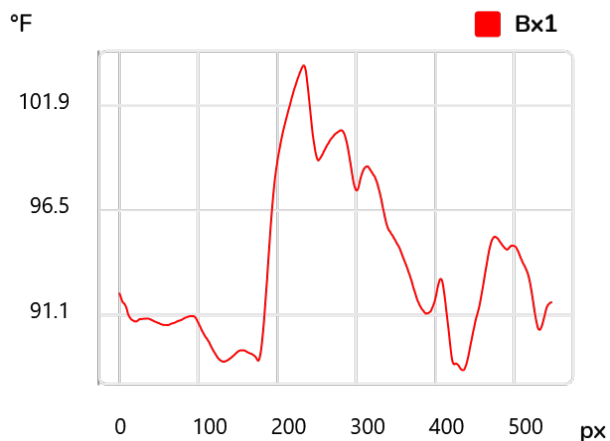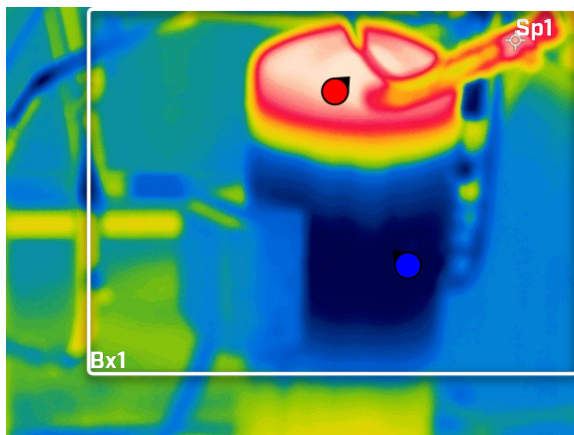

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 19.2,20.2,18.2 amps

Priority None

Parameters

Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 156 / 271

Visual Photo



Equipment name : RTU #23
Device name : Roof Top Units
Measurement Point : #23
Status OK

Measurements

Value

Bx1



Max 111.6 °F

Min 67.8 °F

Area 1.414 ft²

Sp1 105.8 °F

Thermogram 148 Created: 6/3/2026 2:00:18 PM

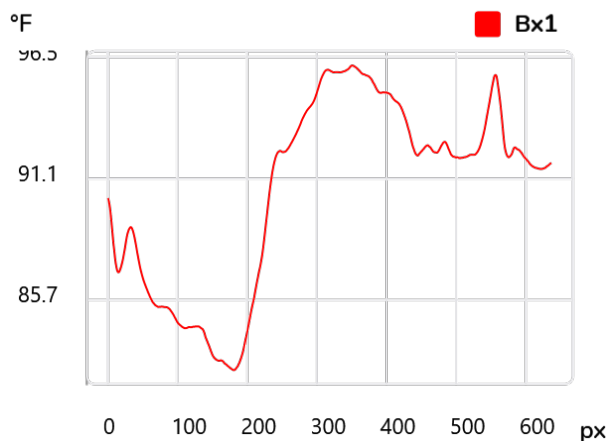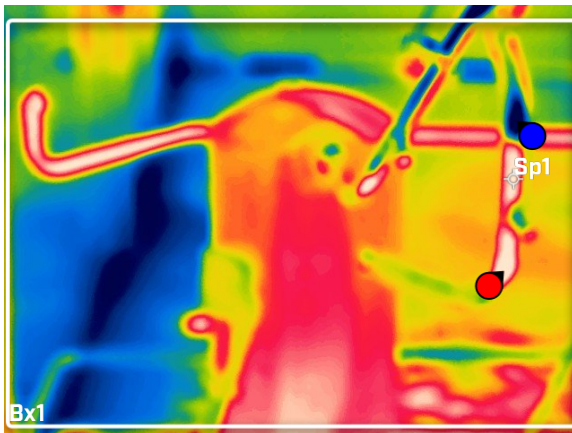

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 19.2,20.2,18.2 amps

Priority None

Parameters

Emissivity 0.95
Distance 3.48 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 157 / 271

Visual Photo



Equipment name : RTU #24
Device name : Roof Top Units
Measurement Point : #24
Status OK

Measurements

Value

Bx1

Max 117.6 °F



Min 67.4 °F

Area 0.956 ft²

Sp1 103.6 °F

Sp2 102.3 °F

Thermogram 149 Created: 6/3/2026 1:43:42 PM

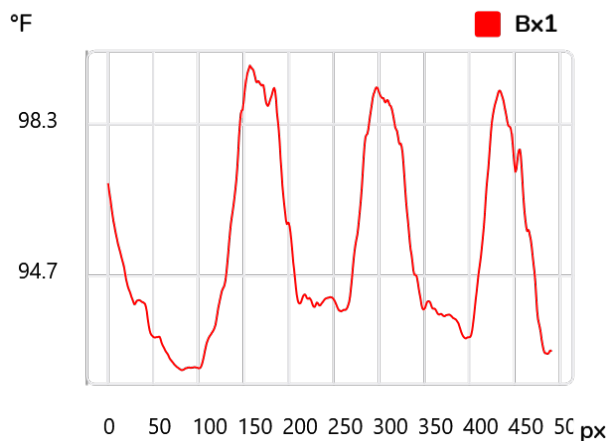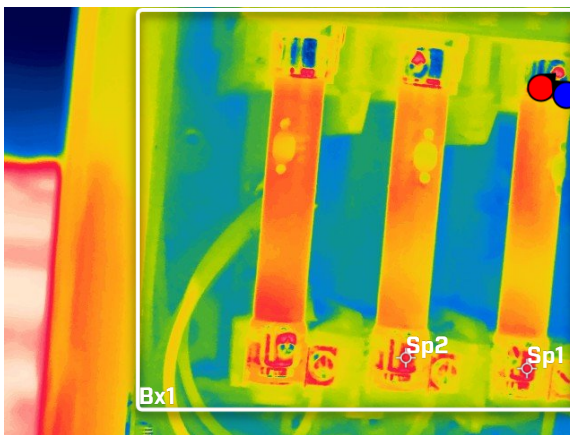

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 4.2,3.8,3.9amps

Priority None

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 158 / 271

Visual Photo



Equipment name : RTU #24
Device name : Roof Top Units
Measurement Point : #24
Status OK

Measurements

Value

Bx1



Max 151.5 °F

Min 59.7 °F

Area 0.784 ft²

Sp1 132.7 °F

Thermogram 150 Created: 6/3/2026 1:47:43 PM

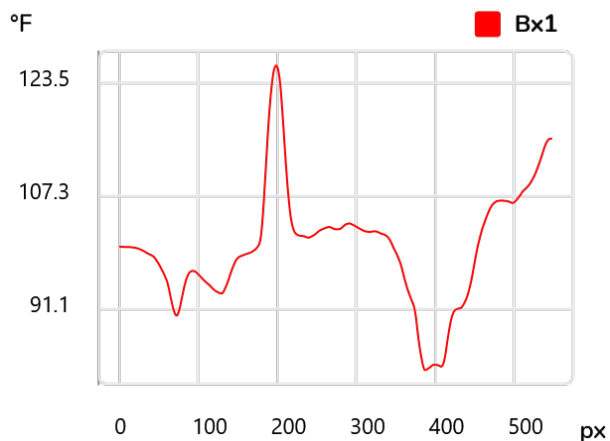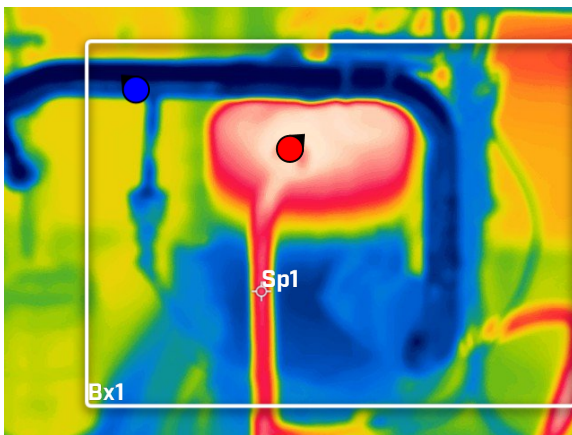

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 4.2,3.8,3.9amps

Priority None

Parameters

Emissivity 0.95
Distance 2.94 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 159 / 271

Visual Photo





Equipment name : RTU #24
Device name : Roof Top Units
Measurement Point : #24
Status OK

Measurements

Bx1	
Max	148.2 °F
Min	75.9 °F
Area	0.974 ft ²
Dt1	
Bx1.Max	72.3 °F
-Bx1.Min	
Sp1	119.1 °F

Thermogram 151 Created: 6/3/2026 1:48:20 PM

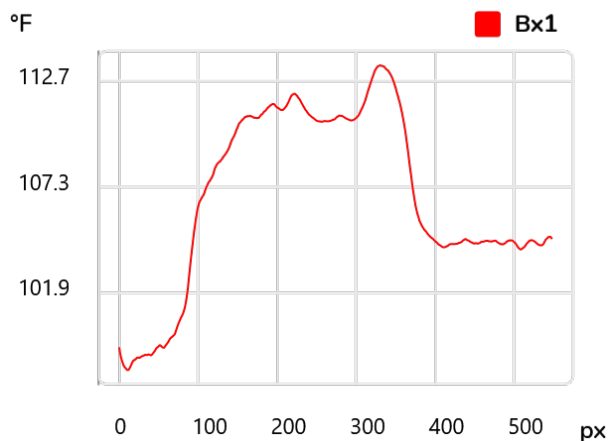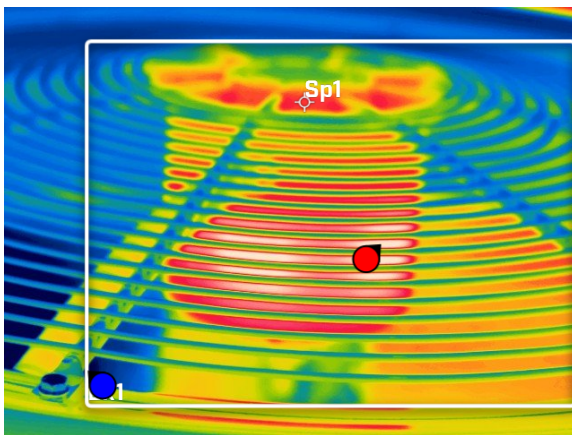

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 4.2,3.8,3.9amps

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 160 / 271

Visual Photo

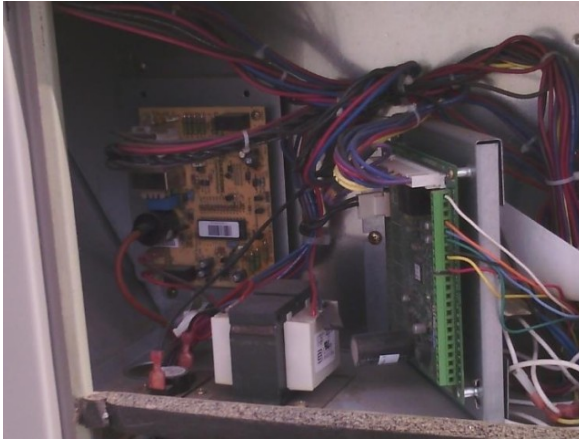

Equipment name : RTU #24
Device name : Roof Top Units
Measurement Point : #24
Status OK

Measurements

Value

Bx1

Max 184.6 °F

Min 69.1 °F




Area 0.816 ft²

Sp1 137.6 °F

Sp2 115.4 °F

Sp3 152.2 °F

Thermogram 152 Created: 6/3/2026 1:49:14 PM

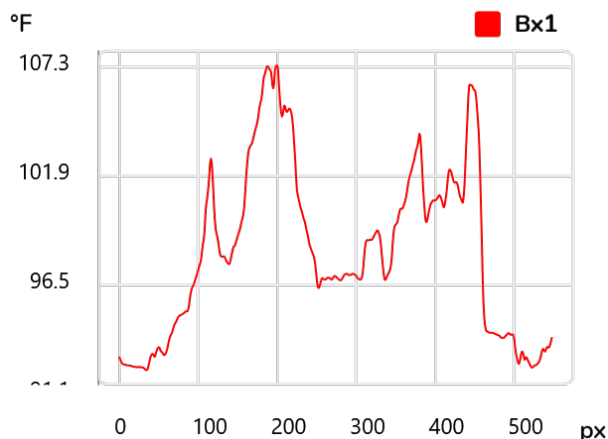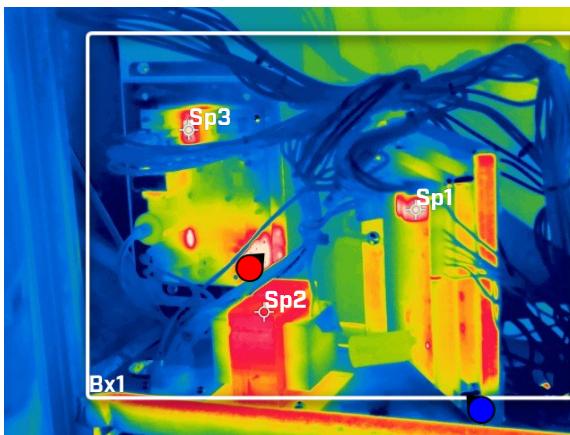

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 4.2,3.8,3.9amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.00 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 161 / 271

Visual Photo





Equipment name : RTU #25
Device name : Roof Top Units
Measurement Point : #25
Status Note

Measurements

Bx1	
Max	109.3 °F
Min	77.5 °F
Area	0.781 ft ²
Dt1	
Bx1.Max	31.8 °F
-Bx1.Min	
Sp1	99.9 °F
Sp2	97.8 °F

Thermogram 153 Created: 6/3/2026 2:06:30 PM

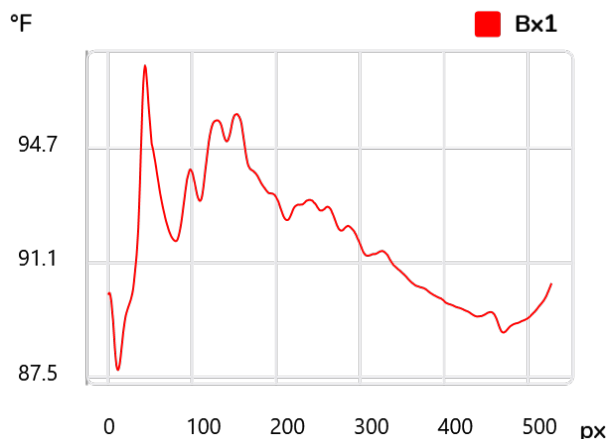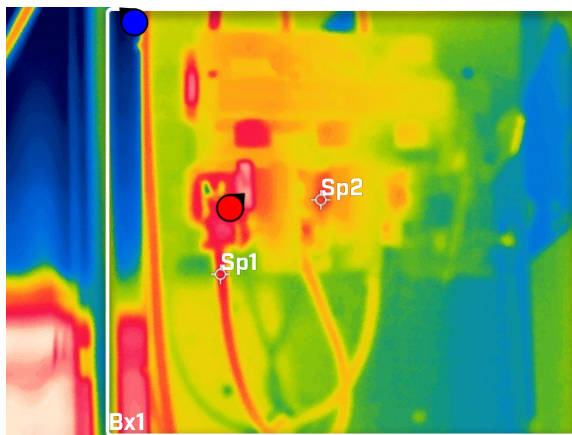

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Inspect connections

Comment Check connection on A-phase. Clean with compressed air. 25.8,23.5,24.7amps

Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 2.77 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 162 / 271

Visual Photo





Equipment name : RTU #25
Device name : Roof Top Units
Measurement Point : #25
Status Note

Measurements

Bx1	
Max	133.7 °F
Min	42.5 °F
Area	1.233 ft ²
Dt1	
Bx1.Max	91.2 °F
-Bx1.Min	
Sp1	130.7 °F

Thermogram 154 Created: 6/3/2026 2:11:44 PM

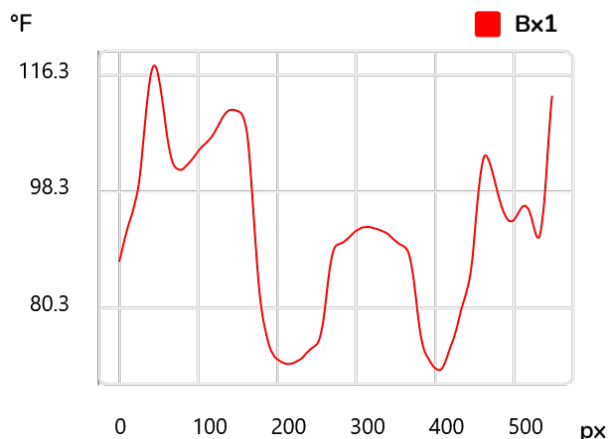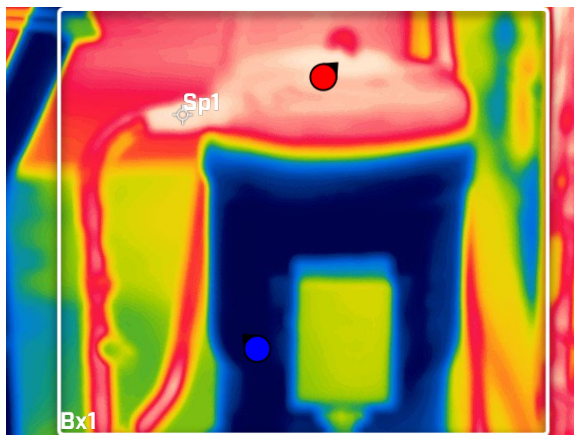

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Inspect connections

Comment Check connection on A-phase. Clean with compressed air. 25.8,23.5,24.7amps

Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.42 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 163 / 271

Visual Photo



Equipment name : RTU #25
Device name : Roof Top Units
Measurement Point : #25
Status Note

Measurements

Value

Bx1



Max 147.3 °F

Min 44.5 °F

Area 1.466 ft²

Sp1 134.5 °F

Thermogram 155 Created: 6/3/2026 2:12:09 PM

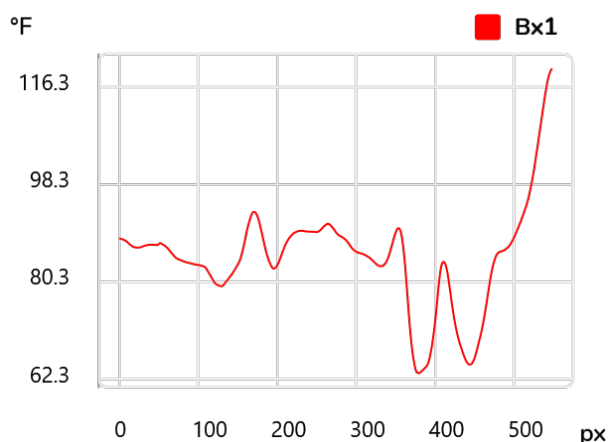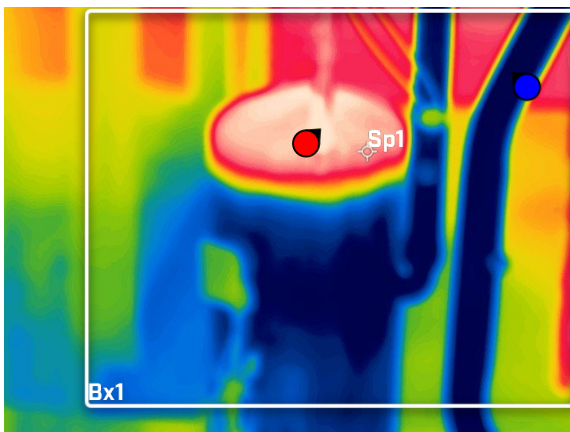

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Inspect connections

Comment Check connection on A-phase. Clean with compressed air. 25.8,23.5,24.7amps

Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.87 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 164 / 271

Visual Photo





Equipment name : RTU #25
Device name : Roof Top Units
Measurement Point : #25
Status Note

Measurements

Bx1	
Max	158.1 °F
Min	48.9 °F
Area	0.272 ft ²
Dt1	
Bx1.Max	109.1 °F
-Bx1.Min	
Sp1	152.9 °F

Thermogram 156 Created: 6/3/2026 2:15:28 PM

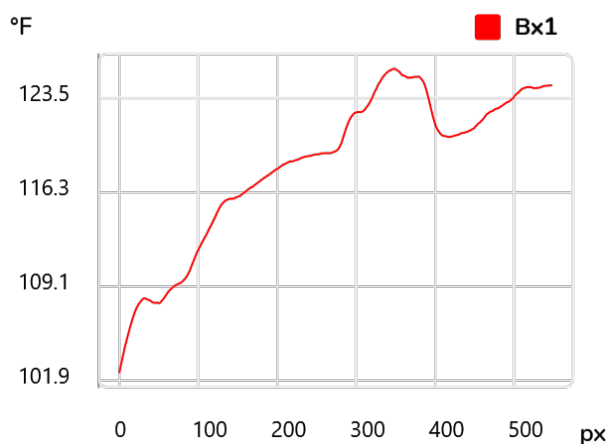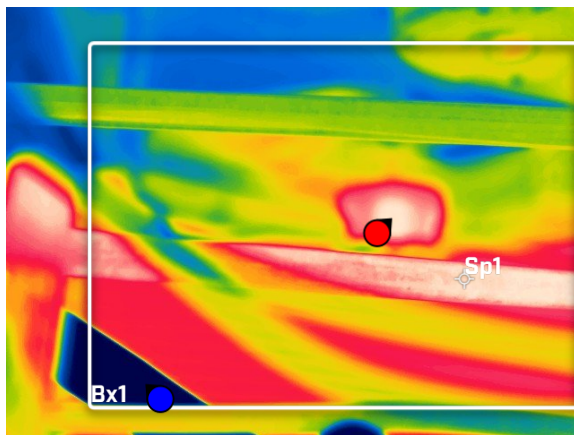

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Inspect connections

Comment Check connection on A-phase. Clean with compressed air. 25.8,23.5,24.7amps

Priority 2-Intermediate/Investigate

Parameters

Emissivity	0.95
Distance	1.74 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 165 / 271

Visual Photo





Equipment name : RTU #25
Device name : Roof Top Units
Measurement Point : #25
Status Note

Measurements

Value	
Bx1	
Max	150.0 °F
Min	91.3 °F
Area	0.299 ft²
Sp1	148.0 °F

Thermogram 157 Created: 6/3/2026 2:15:55 PM

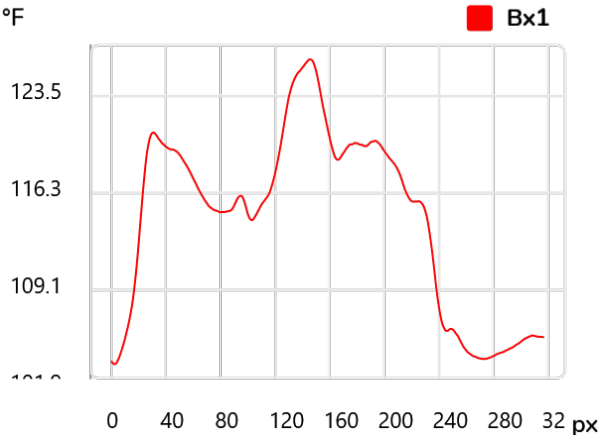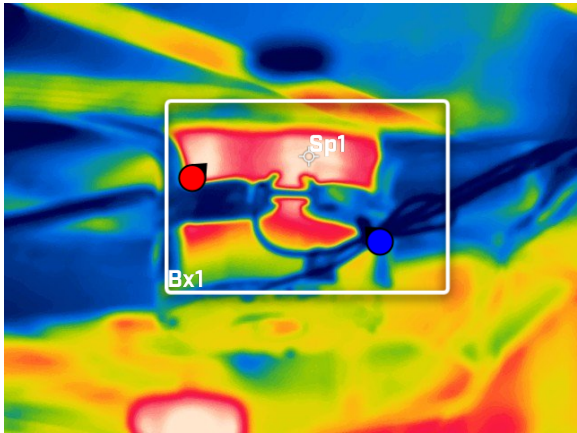

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Inspect connections
Comment Check connection on A-phase. Clean with compressed air. 25.8,23.5,24.7amps
Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 166 / 271

Visual Photo



Equipment name : RTU #26
Device name : Roof Top Units
Measurement Point : #26
Status Note



Measurements

Value

Bx1

Max 102.3 °F
Min 77.2 °F
Area 1.094 ft²
Sp1 97.8 °F
Sp2 94.7 °F
Sp3 96.4 °F

Thermogram 158 Created: 6/3/2026 1:22:55 PM

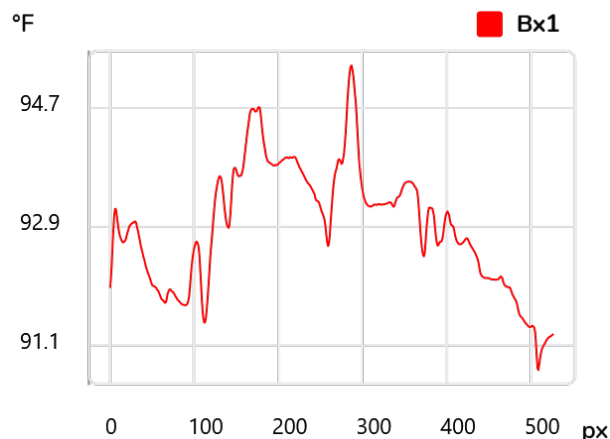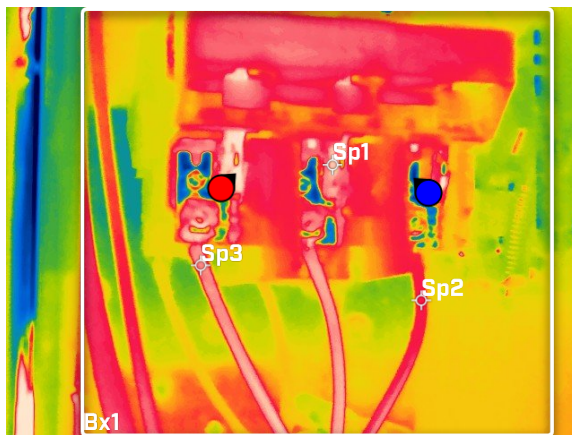

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 26.3,26.4,23 amps
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 167 / 271

Visual Photo






Equipment name : RTU #26
Device name : Roof Top Units
Measurement Point : #26
Status Note

Measurements

Bx1	
Max	102.0 °F
Min	75.5 °F
Area	0.465 ft ²
Dt1	
Bx1.Max	26.5 °F
-Bx1.Min	
Sp1	96.4 °F
Sp2	96.8 °F
Sp3	97.0 °F

Thermogram 159 Created: 6/3/2026 1:23:52 PM

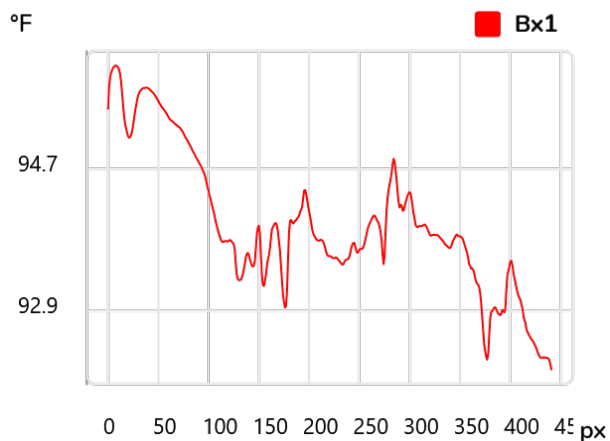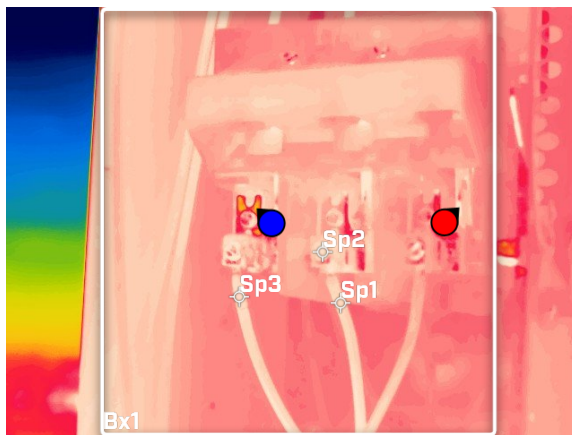

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 26.3,26.4,23 amps
Priority 2-Intermediate/Investigate

Parameters


Emissivity 0.95
Distance 2.34 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 168 / 271

Visual Photo


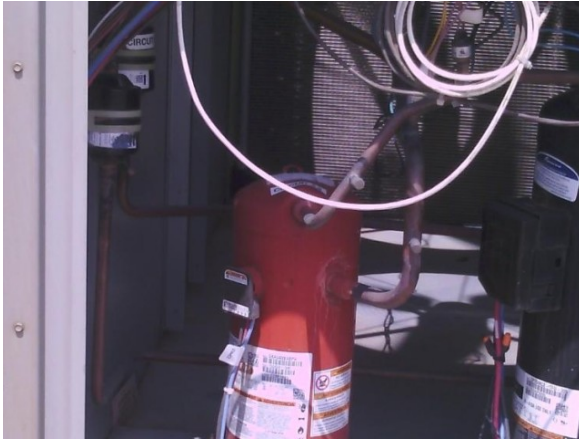


Equipment name : RTU #26
Device name : Roof Top Units
Measurement Point : #26
Status Note

Measurements

Bx1	
Max	182.8 °F
Min	63.7 °F
Area	2.782 ft ²
Dt1	
Bx1.Max	119.1 °F
-Bx1.Min	
Sp1	135.5 °F

Thermogram 160 Created: 6/3/2026 1:24:22 PM

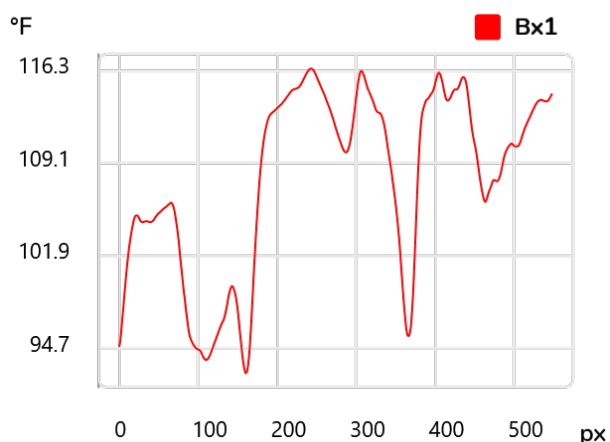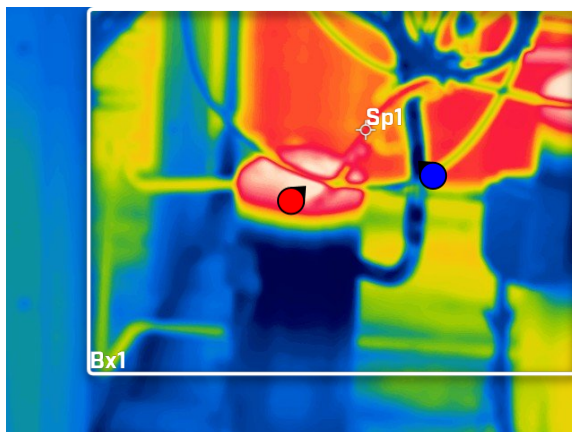

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 26.3,26.4,23 amps
Priority 2-Intermediate/Investigate

Parameters


Emissivity	0.95
Distance	5.55 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 169 / 271

Visual Photo


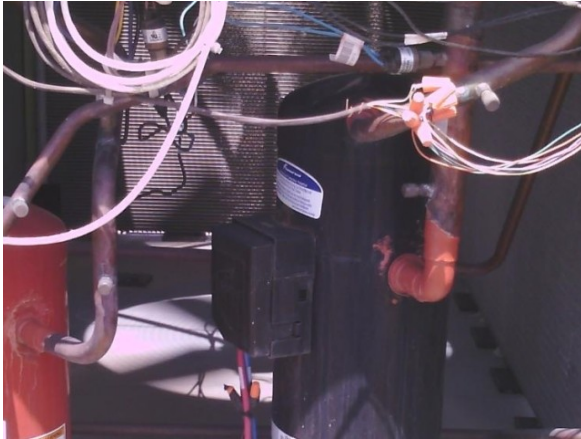


Equipment name : RTU #26
Device name : Roof Top Units
Measurement Point : #26
Status Note

Measurements

Bx1	
Max	178.4 °F
Min	67.8 °F
Area	0.758 ft ²
Dt1	
Bx1.Max	110.6 °F
-Bx1.Min	
Sp1	148.1 °F

Thermogram 161 Created: 6/3/2026 1:24:55 PM

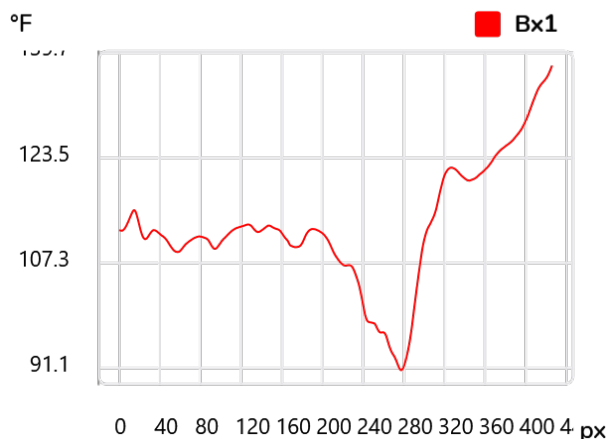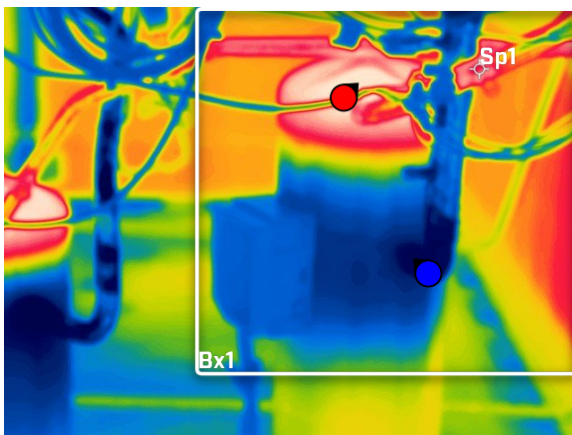

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 26.3,26.4,23 amps
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 170 / 271

Visual Photo






Equipment name : RTU #27
Device name : Roof Top Units
Measurement Point : #27
Status OK

Measurements

Bx1	
Max	109.6 °F
Min	83.8 °F
Dt1	
Bx1.Max	25.9 °F
-Bx1.Min	
Sp1	101.8 °F
Sp2	95.6 °F

Thermogram 162 Created: 6/3/2026 11:42:08 AM

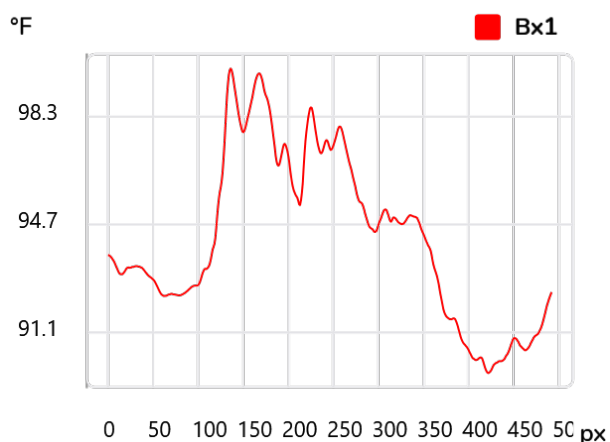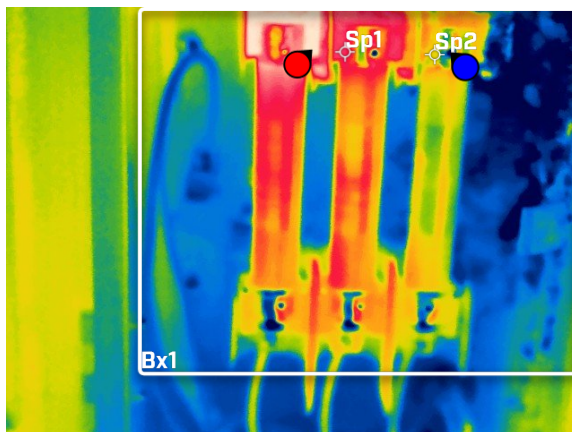

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment 13.8,15,13.2amps
Priority None

Parameters


Emissivity 0.95
Distance 1.80 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 171 / 271

Visual Photo


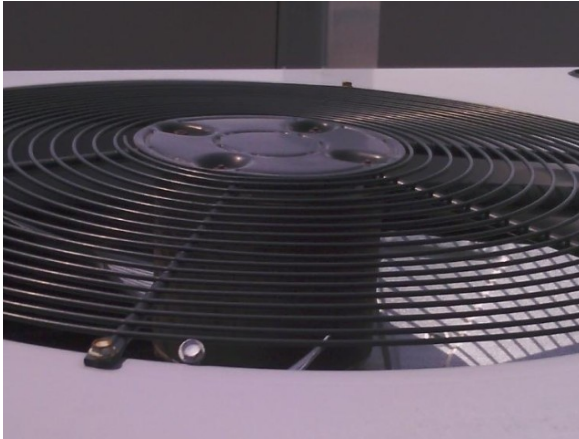


Equipment name : RTU #28
Device name : Roof Top Units
Measurement Point : #28
Status OK

Measurements

Bx1	
Max	137.7 °F
Min	60.9 °F
Area	0.936 ft ²
Dt1	
Bx1.Max	76.8 °F
-Bx1.Min	
Sp1	129.9 °F

Thermogram 163 Created: 6/3/2026 11:47:03 AM

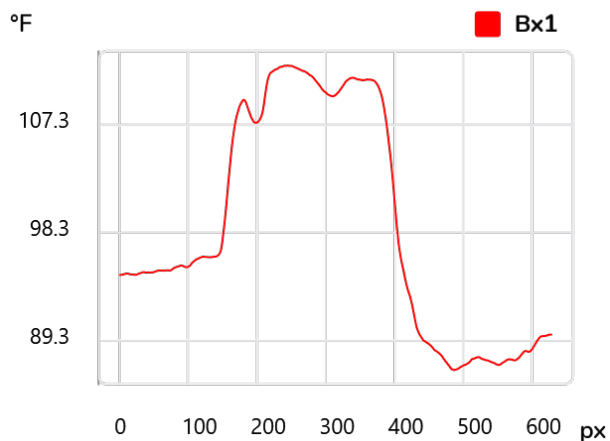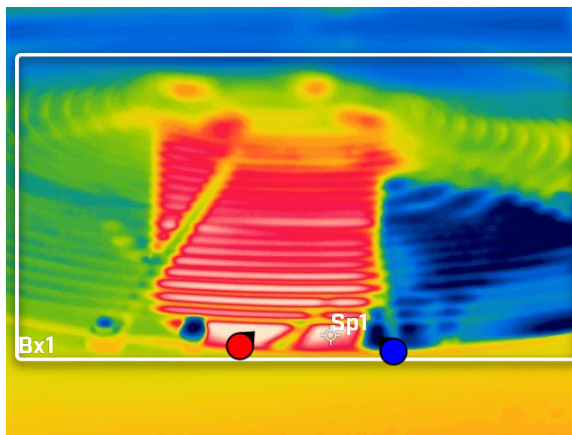

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 172 / 271

Visual Photo


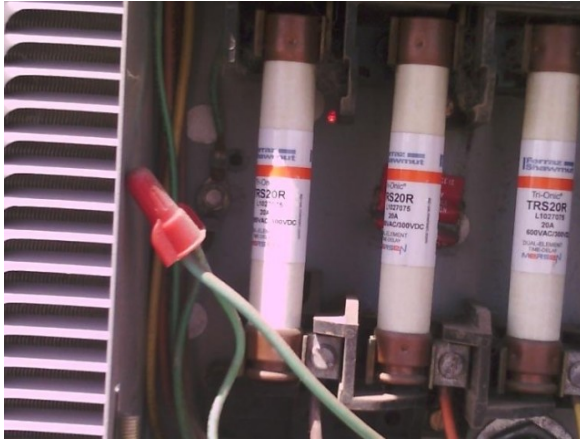


Equipment name : RTU #28
Device name : Roof Top Units
Measurement Point : #28
Status OK

Measurements

Bx1	
Max	116.4 °F
Min	64.7 °F
Area	0.252 ft ²
Dt1	
Bx1.Max	51.8 °F
-Bx1.Min	
Sp1	105.3 °F
Sp2	109.0 °F
Sp3	106.0 °F

Thermogram 164 Created: 6/3/2026 11:47:32 AM

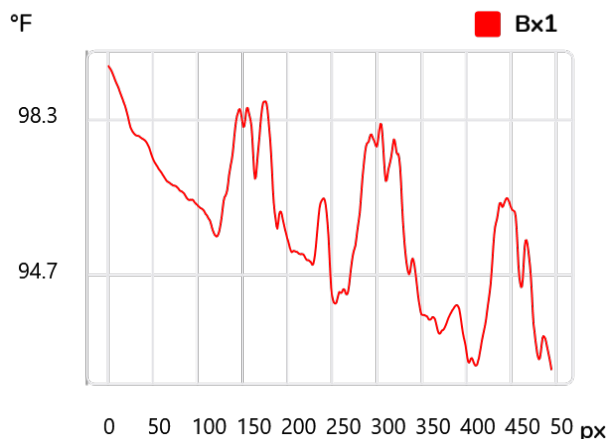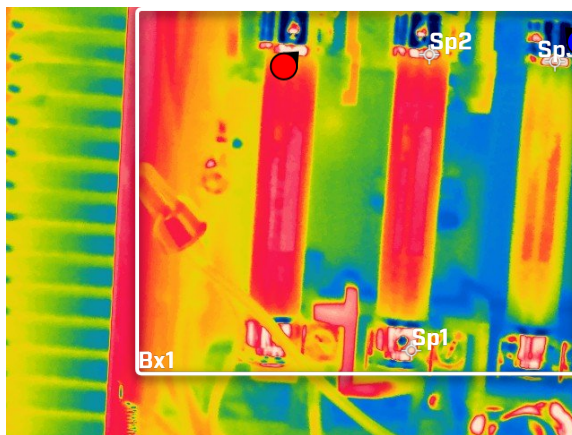

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 1.76 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 173 / 271

Visual Photo



Equipment name : RTU #29
Device name : Roof Top Units
Measurement Point : #29
Status Note



Measurements

Value

Bx1

Max 125.7 °F
Min 46.0 °F
Area 0.870 ft²
Sp1 115.8 °F
Sp2 122.0 °F
Sp3 118.0 °F

Thermogram 165 Created: 6/3/2026 11:12:02 AM

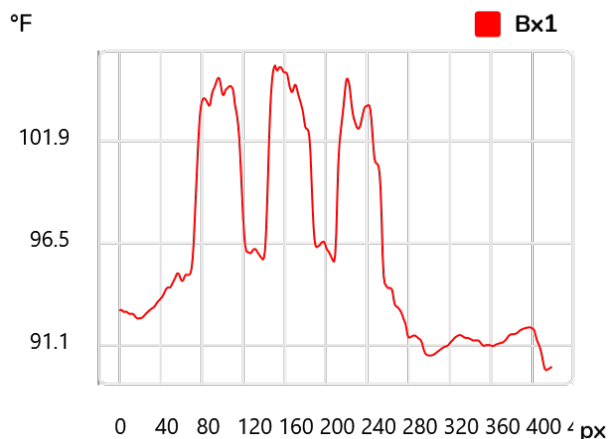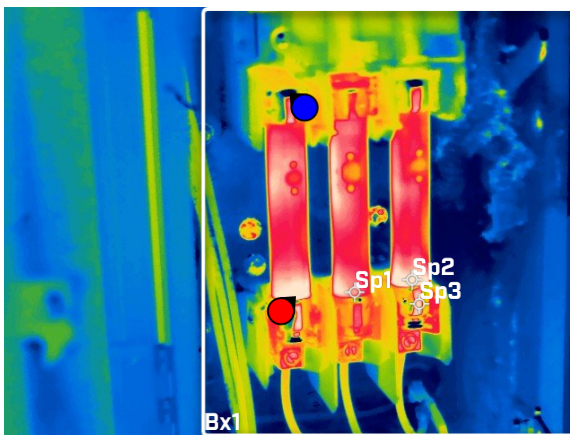

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 14.5,13.7,14.3amps
Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 174 / 271

Visual Photo





Equipment name : RTU #29
Device name : Roof Top Units
Measurement Point : #29
Status Note

Measurements

Bx1	
Max	124.9 °F
Min	64.2 °F
Area	0.974 ft ²
Dt1	
Bx1.Max	60.7 °F
-Bx1.Min	
Sp1	113.1 °F

Thermogram 166 Created: 6/3/2026 11:15:02 AM

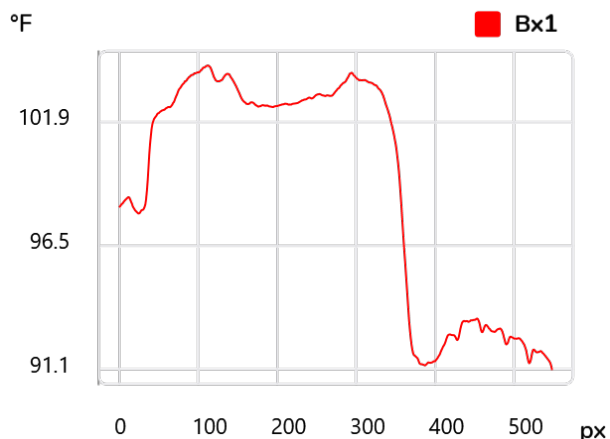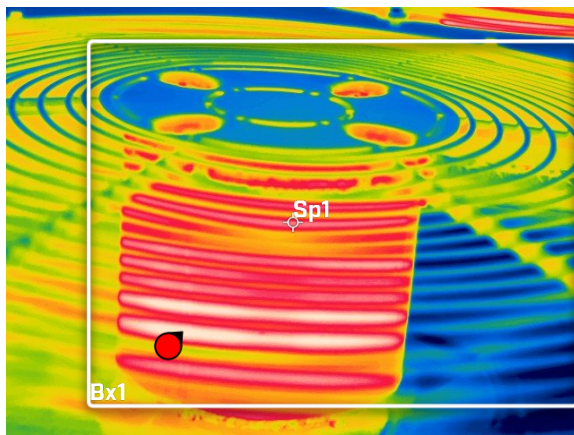

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 14.5,13.7,14.3amps
Priority 2-Intermediate/Investigate

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 175 / 271

Visual Photo





Equipment name : RTU #29
Device name : Roof Top Units
Measurement Point : #29
Status Note

Measurements

Bx1	
Max	129.1 °F
Min	55.9 °F
Dt1	
Bx1.Max	73.3 °F
-Bx1.Min	
Sp1	118.8 °F

Thermogram 167 Created: 6/3/2026 11:15:21 AM

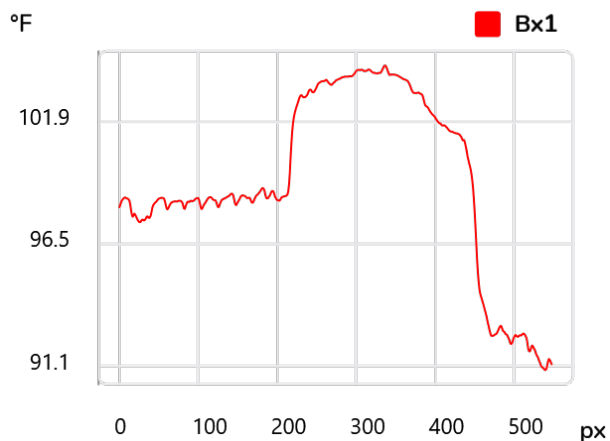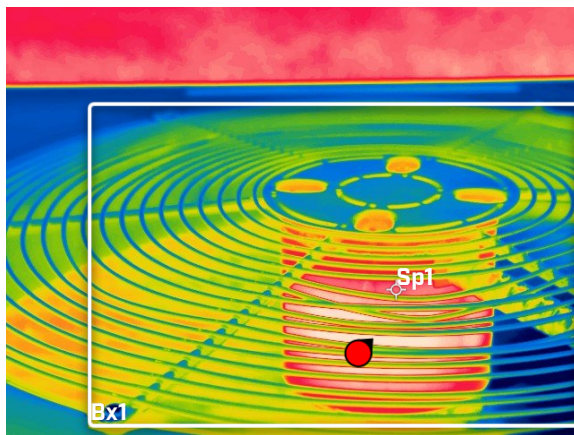

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Clean equipment

Comment Clean with compressed air. 14.5,13.7,14.3amps

Priority 2-Intermediate/Investigate

Parameters

Emissivity	0.95
Distance	3.44 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 176 / 271

Visual Photo





Equipment name : RTU #30
Device name : Roof Top Units
Measurement Point : #30
Status OK

Measurements

Value	
Bx1	
Max	100.9 °F
Min	64.3 °F
Area	0.375 ft²
Sp1	94.2 °F
Sp2	96.9 °F

Thermogram 168 Created: 6/3/2026 10:59:37 AM

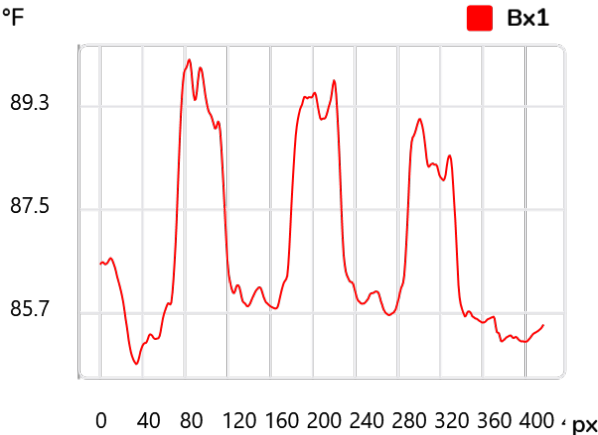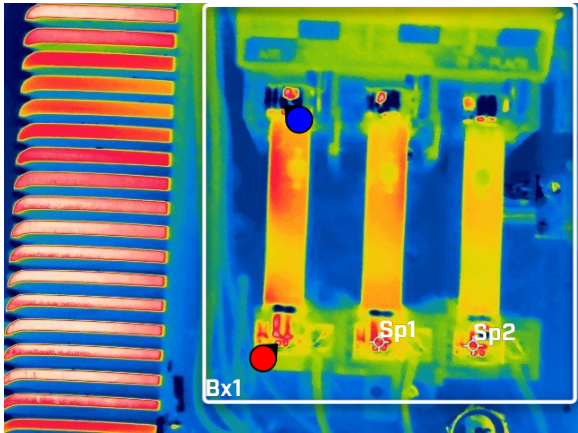

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment 4.8,3.8,4.4amps
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.24 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 177 / 271

Visual Photo





Equipment name : RTU #30
Device name : Roof Top Units
Measurement Point : #30
Status OK

Measurements

Bx1	
Max	133.4 °F
Min	73.0 °F
Area	0.497 ft²
Dt1	
Bx1.Max	60.4 °F
-Bx1.Min	
Sp1	133.0 °F

Thermogram 169 Created: 6/3/2026 11:06:51 AM

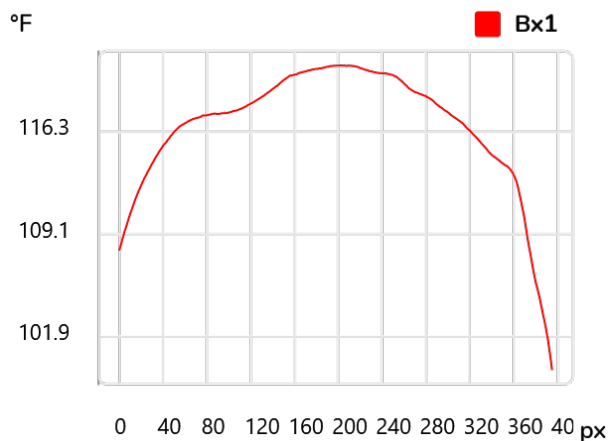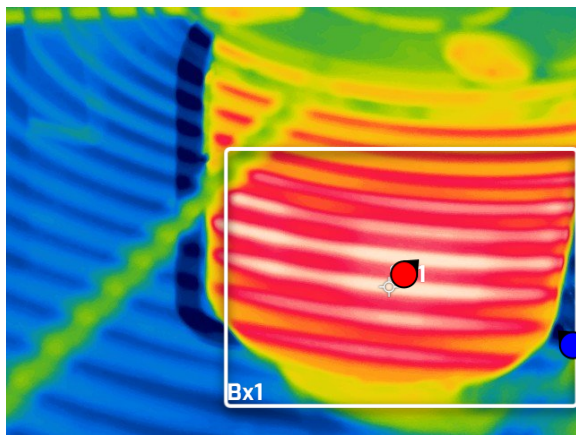

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 4.8,3.8,4.4amps

Priority None

Parameters

Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 178 / 271

Visual Photo



Equipment name : RTU #31
Device name : Roof Top Units
Measurement Point : #31
Status OK

Measurements

Value

Bx1

Max 114.5 °F




Min 57.6 °F

Sp1 106.2 °F

Sp2 108.3 °F

Sp3 102.5 °F

Thermogram 170 Created: 6/3/2026 11:23:34 AM

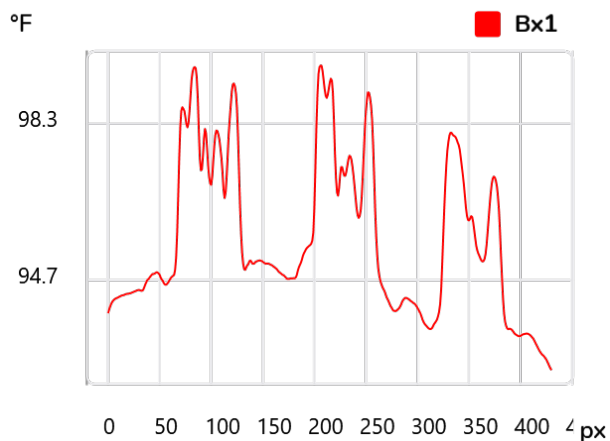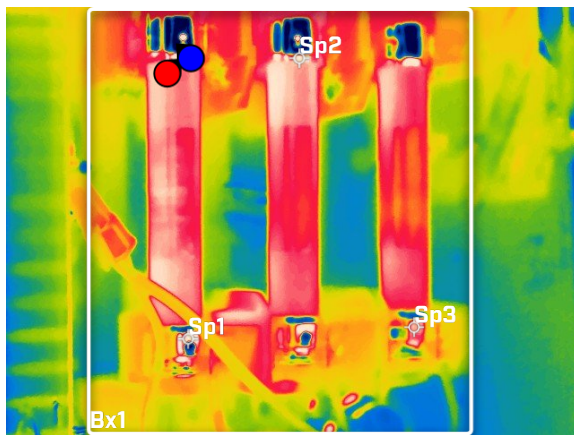

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 11.2,11.6,9.2amps

Priority None

Parameters


Emissivity 0.95
Distance 1.74 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 179 / 271

Visual Photo


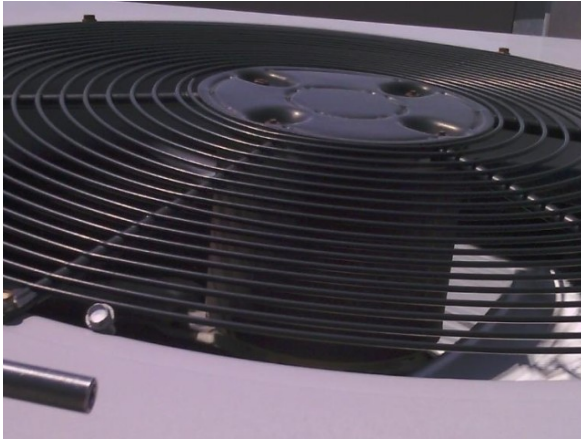


Equipment name : RTU #31
Device name : Roof Top Units
Measurement Point : #31
Status OK

Measurements

Bx1	
Max	132.4 °F
Min	24.6 °F
Area	1.718 ft ²
Dt1	
Bx1.Max	107.8 °F
-Bx1.Min	
Sp1	119.8 °F

Thermogram 171 Created: 6/3/2026 11:26:00 AM

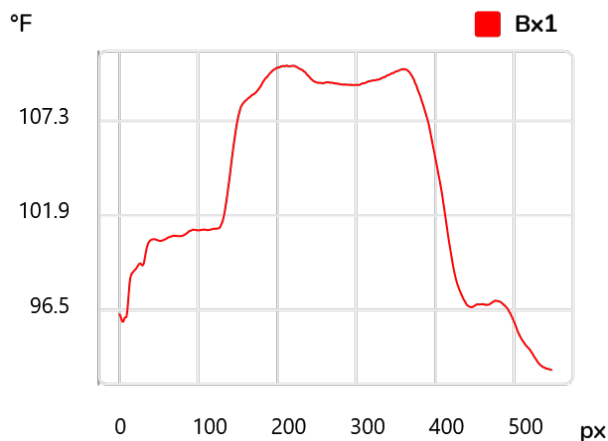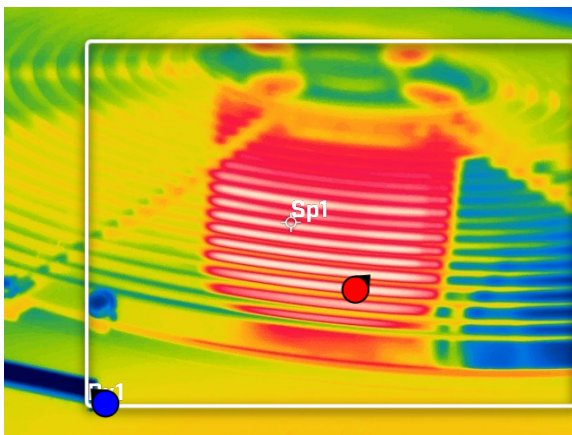

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 11.2,11.6,9.2amps

Priority None

Parameters

Emissivity	0.95
Distance	4.36 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 180 / 271

Visual Photo



Equipment name : RTU #31
Device name : Roof Top Units
Measurement Point : #31
Status OK

Measurements

Value

Bx1




Max 155.1 °F

Min 50.5 °F

Area 0.974 ft²

Sp1 152.0 °F

Thermogram 172 Created: 6/3/2026 11:36:39 AM

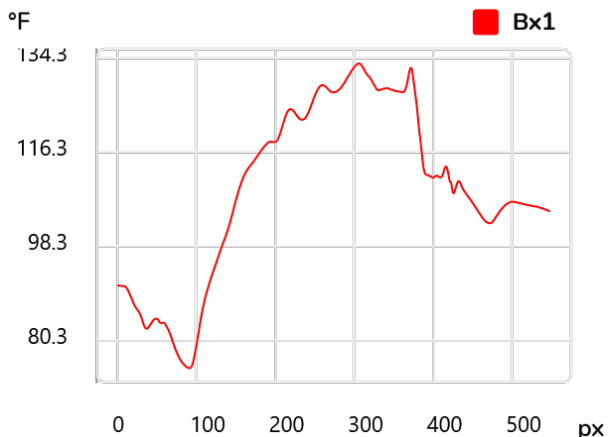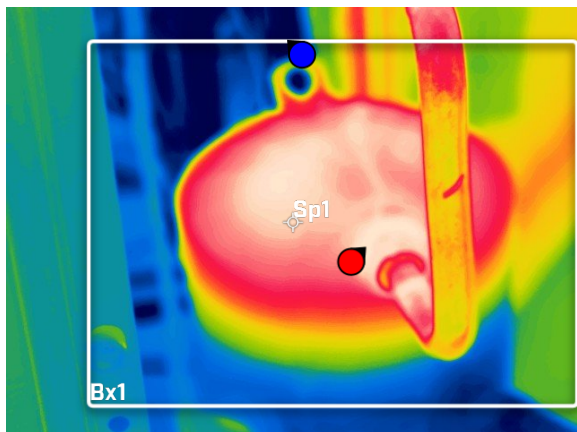

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 11.2,11.6,9.2amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 181 / 271

Visual Photo



Equipment name : RTU #31
Device name : Roof Top Units
Measurement Point : #31
Status OK

Measurements

Value

Bx1

Max 105.6 °F



Min 84.8 °F

Area 0.153 ft²

Sp1 100.8 °F

Sp2 99.5 °F

Thermogram 173 Created: 6/3/2026 11:58:09 AM

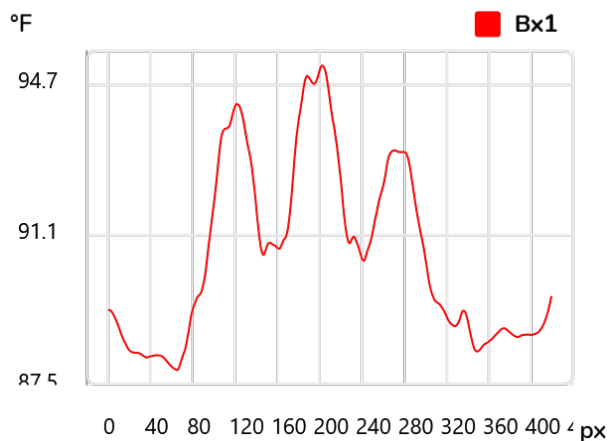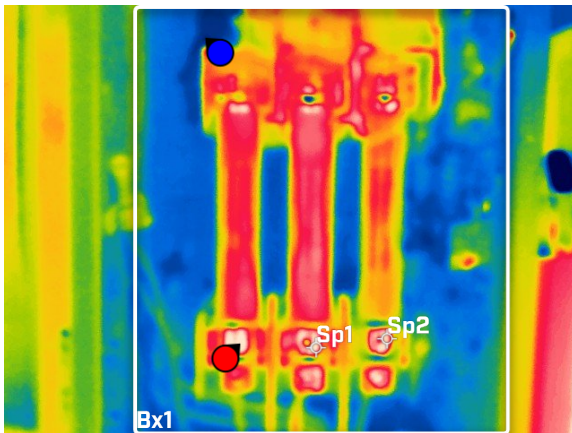

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 11.2,11.6,9.2amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 1.38 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 182 / 271

Visual Photo





Equipment name : RTU #31
Device name : Roof Top Units
Measurement Point : #31
Status OK

Measurements

Bx1	
Max	174.6 °F
Min	59.3 °F
Area	0.974 ft²
Dt1	
Bx1.Max	115.3 °F
-Bx1.Min	
Sp1	109.9 °F

Thermogram 174 Created: 6/3/2026 12:05:20 PM

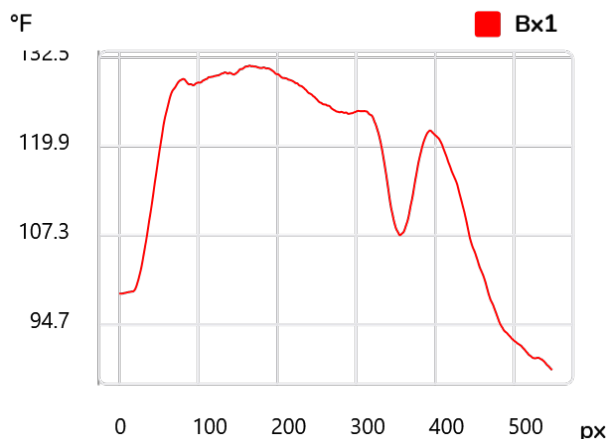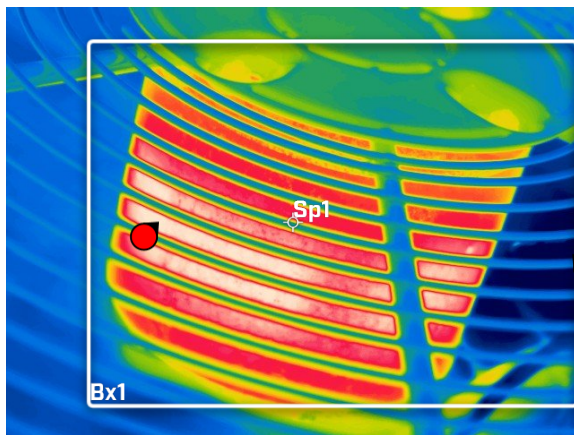

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 11.2,11.6,9.2amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 183 / 271

Visual Photo





Equipment name : RTU #31
Device name : Roof Top Units
Measurement Point : #31
Status OK

Measurements

Bx1	
Max	166.4 °F
Min	67.4 °F
Area	0.974 ft ²
Dt1	
Bx1.Max	99.0 °F
-Bx1.Min	
Sp1	140.4 °F

Thermogram 175 Created: 6/3/2026 12:05:40 PM

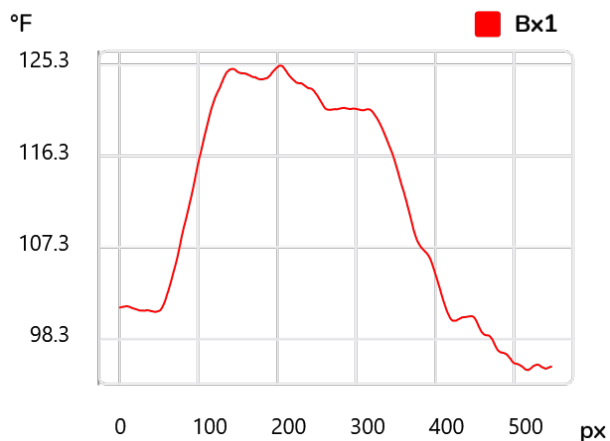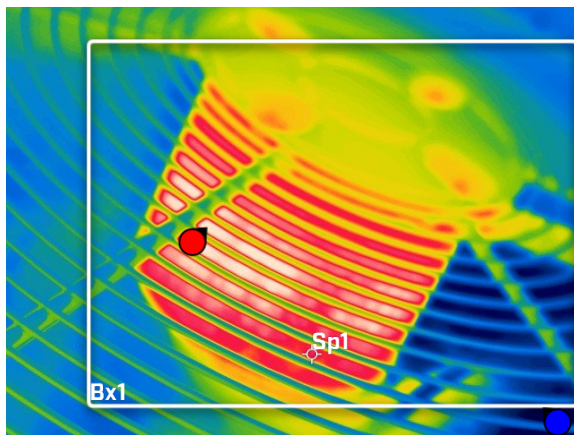

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 11.2,11.6,9.2amps

Priority None

Parameters

Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%

Camera information


Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 184 / 271

Visual Photo

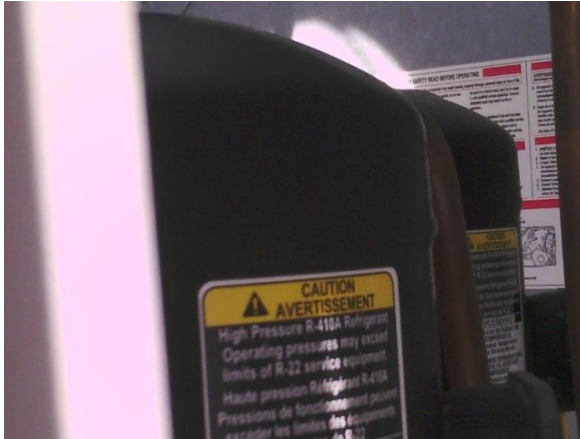

Equipment name : RTU #31
Device name : Roof Top Units
Measurement Point : #31
Status OK

Measurements

Value

Bx1



Max 144.6 °F

Min 80.3 °F

Area 0.873 ft²

Sp1 141.6 °F

Thermogram 176 Created: 6/3/2026 12:08:44 PM

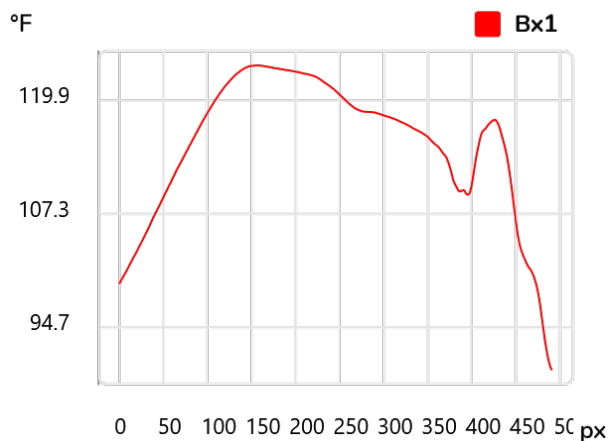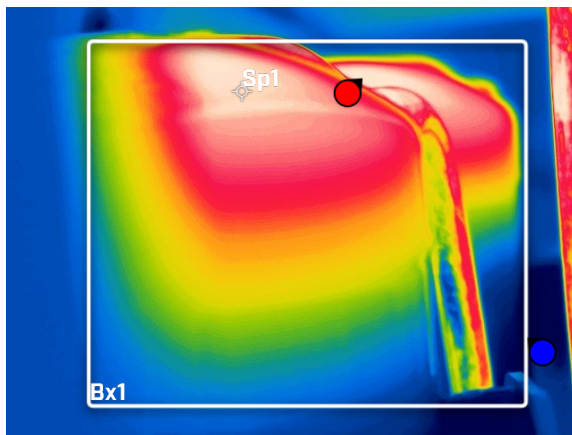

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 11.2,11.6,9.2amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 185 / 271

Visual Photo



Equipment name : RTU #32
Device name : Roof Top Units
Measurement Point : #32
Status OK



Measurements

Value

Bx1

Max 112.5 °F
Min 88.7 °F
Area 0.209 ft²
Sp1 109.9 °F
Sp2 104.8 °F
Sp3 110.2 °F

Thermogram 177 Created: 6/3/2026 12:13:28 PM

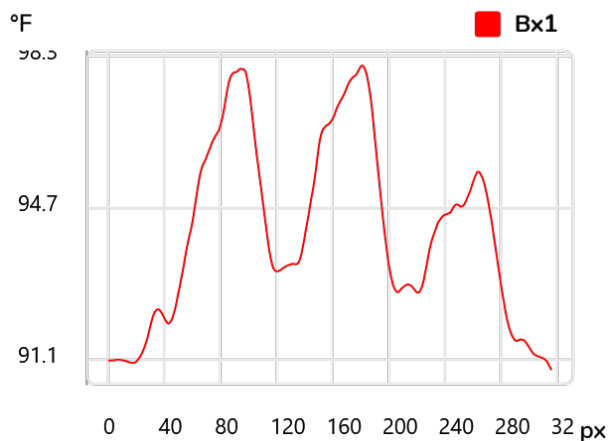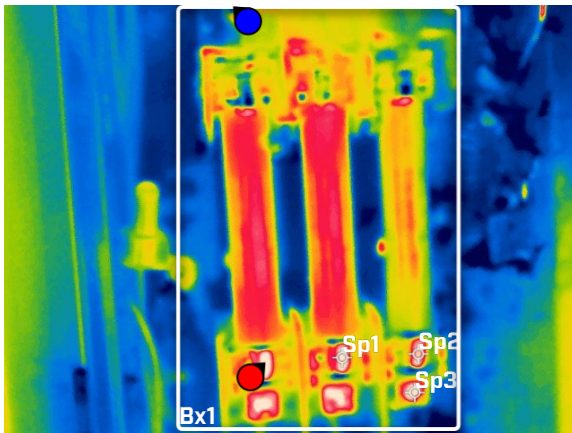

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 7.2,7.6,5.8amps

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 1.86 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 186 / 271

Visual Photo





Equipment name : RTU #32
Device name : Roof Top Units
Measurement Point : #32
Status OK

Measurements

Bx1	
Max	156.9 °F
Min	91.4 °F
Dt1	
Bx1.Max	65.5 °F
-Bx1.Min	
Sp1	148.2 °F

Thermogram 178 Created: 6/3/2026 12:15:58 PM

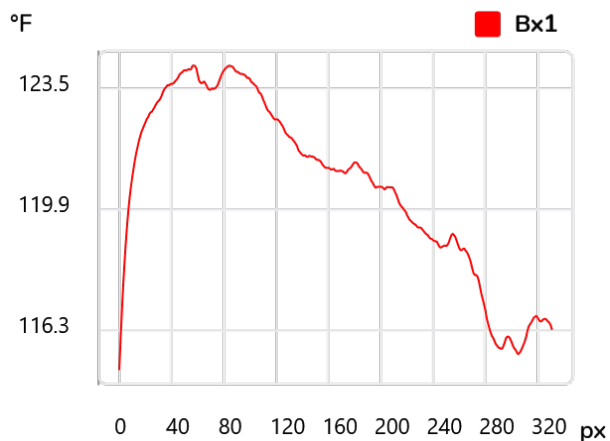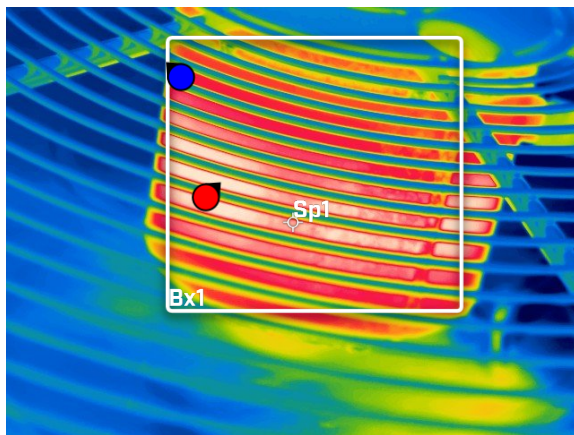

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment 7.2,7.6,5.8amps

Priority None

Parameters

Emissivity	0.95
Distance	1.69 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 187 / 271

Visual Photo





Equipment name : RTU #32
Device name : Roof Top Units
Measurement Point : #32
Status OK

Measurements

Bx1	
Max	152.5 °F
Min	83.9 °F
Area	0.387 ft²
Dt1	
Bx1.Max	68.5 °F
-Bx1.Min	
Sp1	130.7 °F

Thermogram 179 Created: 6/3/2026 12:16:17 PM

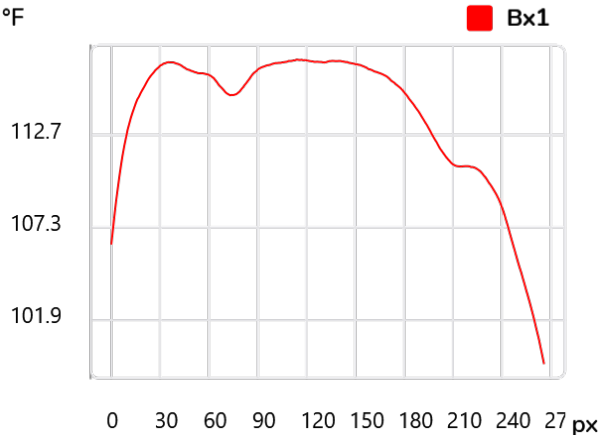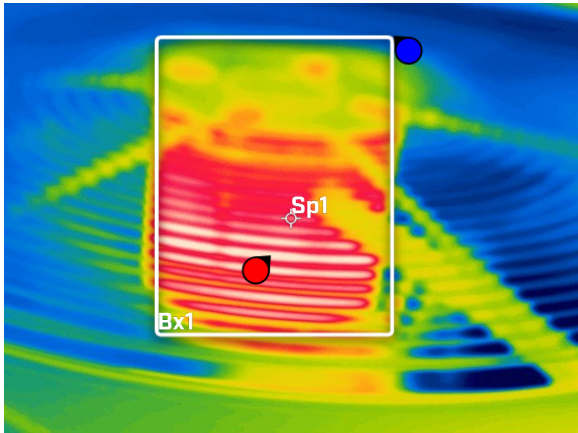

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment 7.2,7.6,5.8amps
Priority None

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 188 / 271

Visual Photo





Equipment name : RTU #32
Device name : Roof Top Units
Measurement Point : #32
Status OK

Measurements

Value	
Bx1	
Max	151.0 °F
Min	83.0 °F
Area	0.942 ft²
Sp1	137.2 °F

Thermogram 180 Created: 6/3/2026 12:17:46 PM

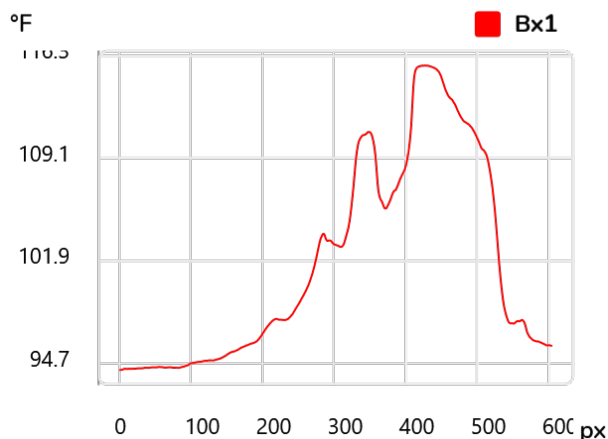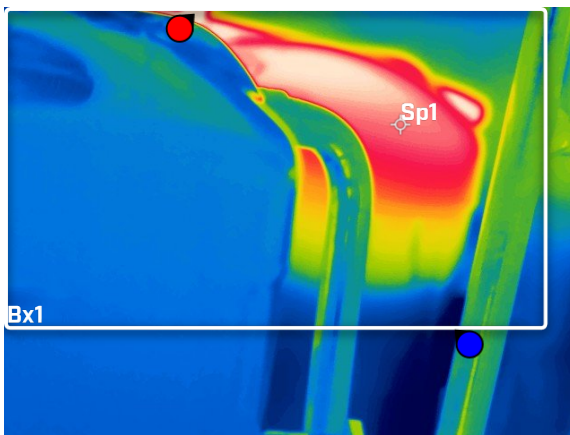

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment 7.2,7.6,5.8amps
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 189 / 271

Visual Photo





Equipment name : RTU #33
Device name : Roof Top Units
Measurement Point : #33
Status Note

Measurements

Value	
Bx1	
Max	109.3 °F
Min	66.2 °F
Sp1	108.7 °F
Sp2	107.3 °F

Thermogram 181 Created: 6/3/2026 10:39:17 AM

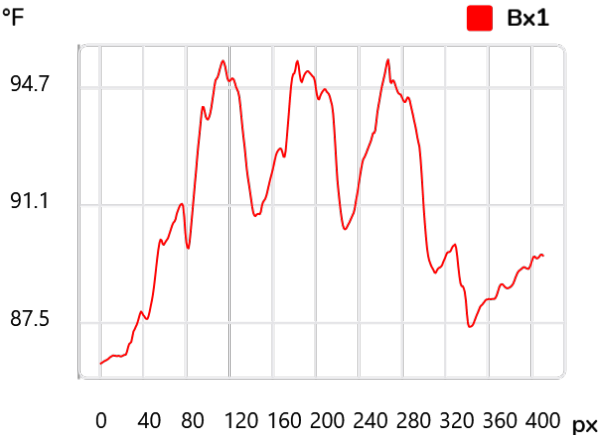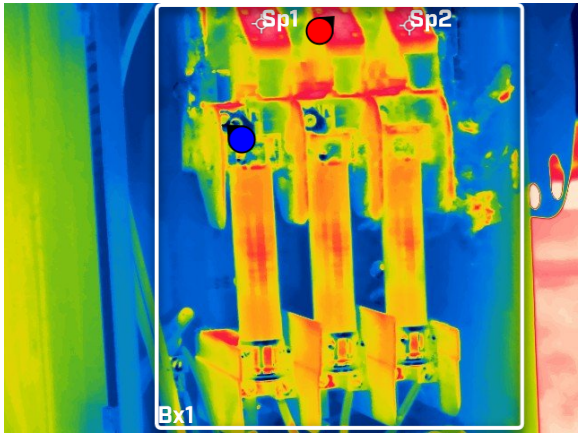

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 18.4,16.7,16 amps
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.66 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 190 / 271

Visual Photo



Equipment name : RTU #33
Device name : Roof Top Units
Measurement Point : #33
Status Note

Measurements

Value

Bx1



Max 187.1 °F

Min 47.7 °F

Area 0.598 ft²

Sp1 150.9 °F

Thermogram 182 Created: 6/3/2026 10:46:45 AM

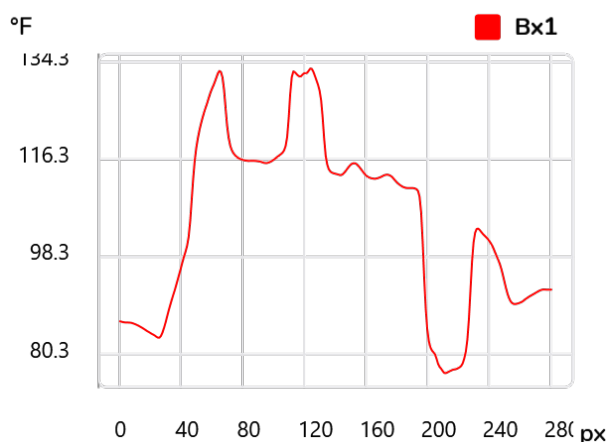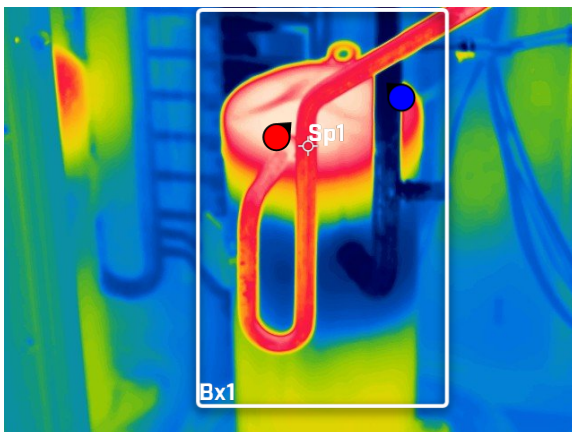

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 18.4,16.7,16 amps
Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.45 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 191 / 271

Visual Photo





Equipment name : RTU #33
Device name : Roof Top Units
Measurement Point : #33
Status Note

Measurements

Bx1	
Max	114.4 °F
Min	12.3 °F
Area	0.516 ft ²
Dt1	
Bx1.Max	102.2 °F
-Bx1.Min	
Sp1	99.7 °F

Thermogram 183 Created: 6/3/2026 10:51:29 AM

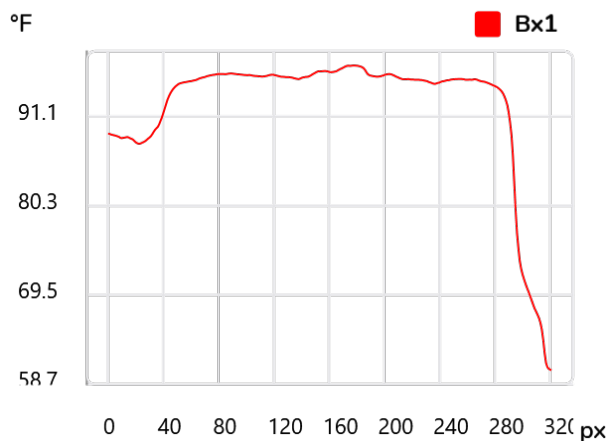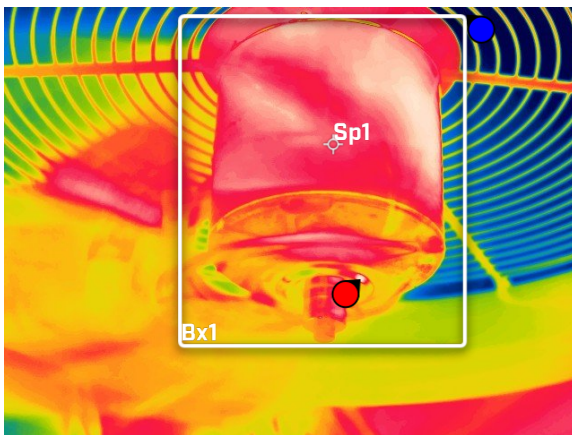

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Clean equipment
Comment Clean with compressed air. 18.4,16.7,16 amps
Priority 2-Intermediate/Investigate

Parameters

Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 192 / 271

Visual Photo



Equipment name : RTU #33
Device name : Roof Top Units
Measurement Point : #33
Status Note

Measurements

Value

Bx1



Max 142.6 °F

Min 19.3 °F

Area 0.234 ft²

Sp1 128.9 °F

Thermogram 184 Created: 6/3/2026 10:52:00 AM

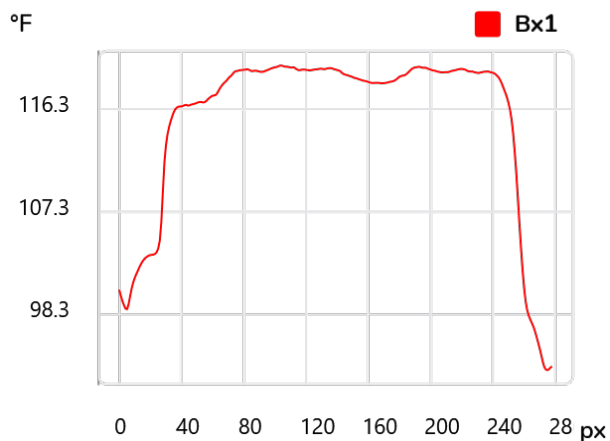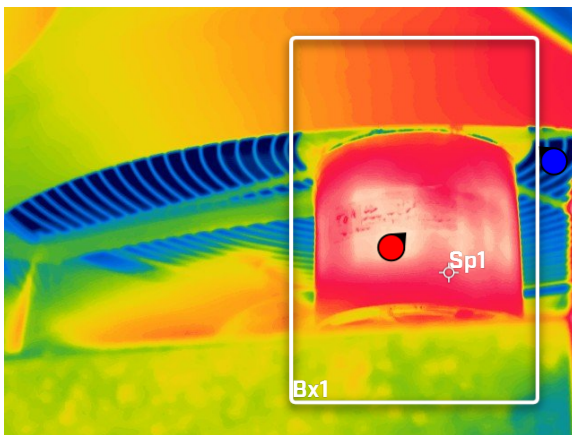

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)

Recommended Action Clean equipment

Comment Clean with compressed air. 18.4,16.7,16 amps

Priority 2-Intermediate/Investigate

Parameters


Emissivity 0.95
Distance 2.26 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 193 / 271

Visual Photo


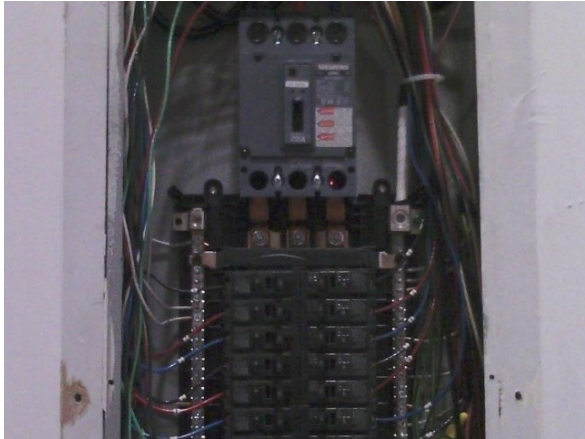


Equipment name : Sensors 204
Device name : 1032
Measurement Point : HZ-1
Status OK

Measurements

Bx1	
Max	82.3 °F
Min	72.2 °F
Dt1	
Bx1.Max	10.1 °F
-Bx1.Min	
Sp1	75.9 °F
Sp2	77.3 °F

Thermogram 185 Created: 5/18/2026 10:49:04 AM

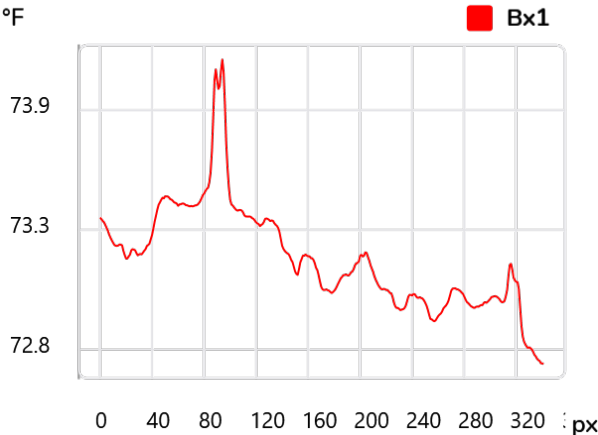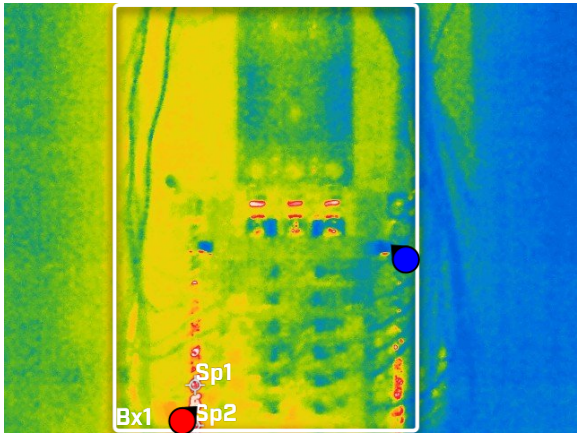

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters


Emissivity	0.95
Distance	4.41 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 194 / 271

Visual Photo


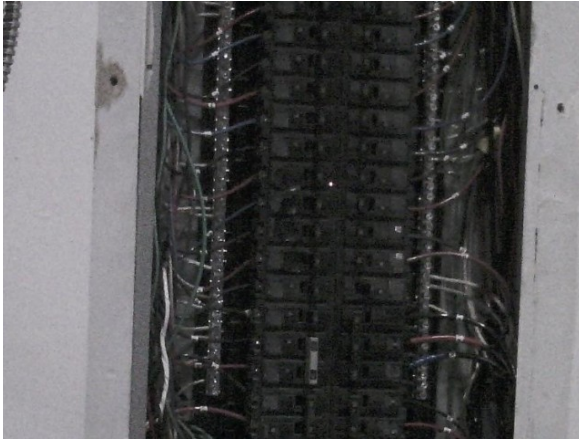


Equipment name : Sensors 204
Device name : 1032
Measurement Point : HZ-1
Status OK

Measurements

Bx1	
Max	74.7 °F
Min	72.8 °F
Area	1.017 ft ²
Dt1	
Bx1.Max	1.9 °F
-Bx1.Min	
Sp1	74.3 °F

Thermogram 186 Created: 5/18/2026 10:50:09 AM

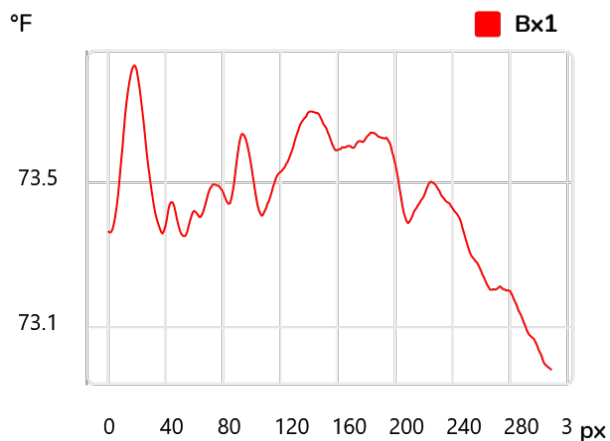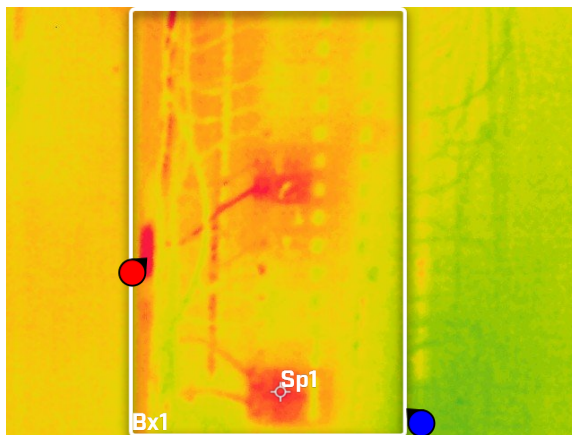

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	4.13 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 195 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1033
Measurement Point : MM140 Switchboard #1
Status OK



Measurements

Value

Bx1

Max 75.7 °F
Min 71.1 °F
Area 1.389 ft²
Sp1 74.6 °F

Thermogram 187 Created: 5/18/2026 12:58:41 PM

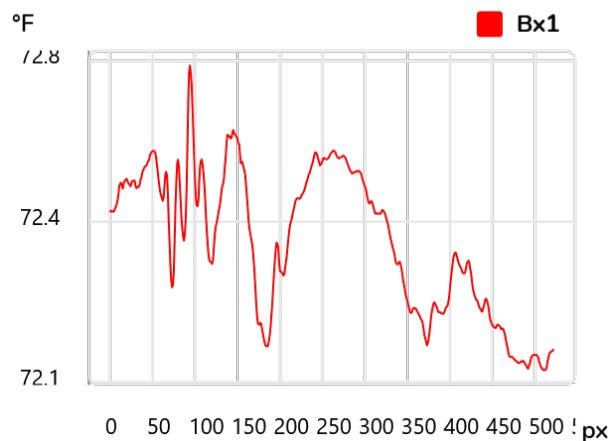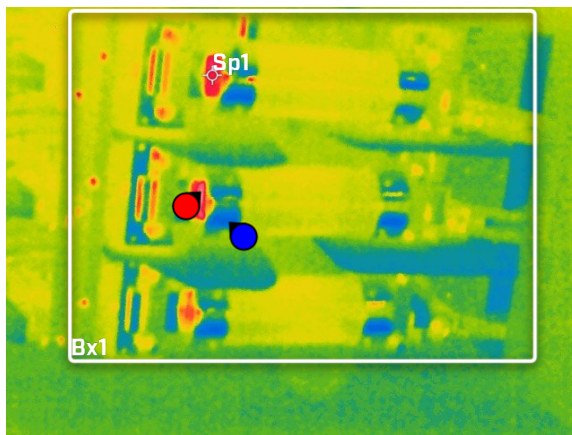

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.10 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 196 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1033
Measurement Point : MM140 Switchboard #1
Status OK



Measurements

Value

Bx1

Max 73.7 °F
Min 71.4 °F
Area 1.248 ft²
Sp1 73.4 °F

Thermogram 188 Created: 5/18/2026 1:04:54 PM

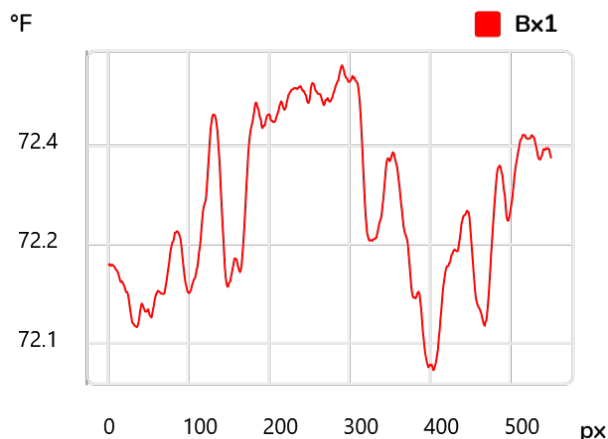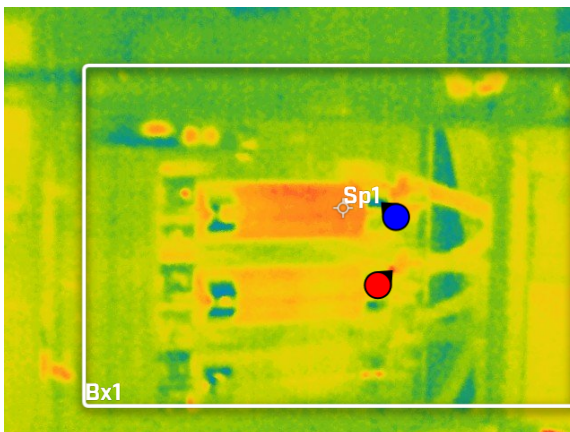

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.83 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 197 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1033
Measurement Point : MM140 Switchboard #1
Status OK



Measurements

Value

Bx1

Max 74.9 °F
Min 71.2 °F
Area 0.797 ft²
Sp1 73.8 °F
Sp2 74.5 °F
Sp3 74.4 °F

Thermogram 189 Created: 5/18/2026 1:07:22 PM

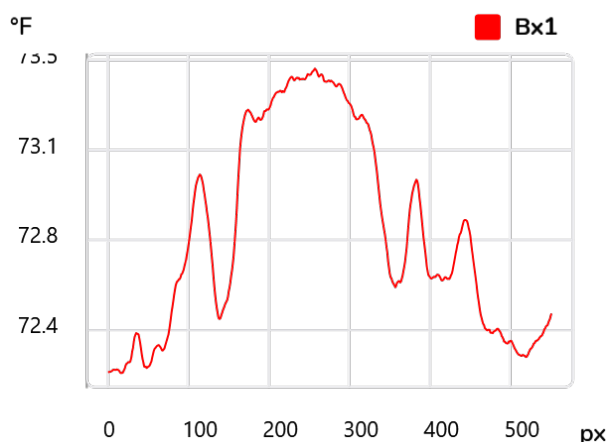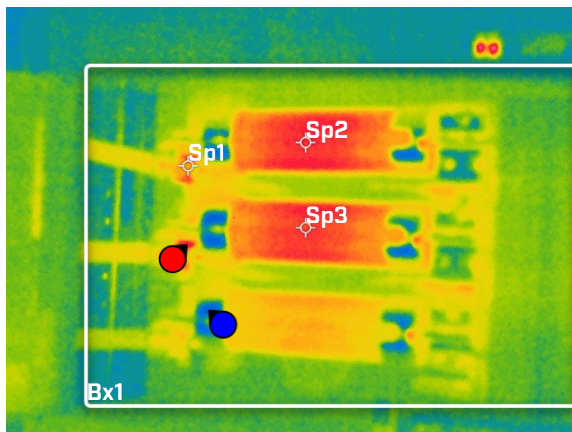

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity 0.95
Distance 3.06 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 198 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1033
Measurement Point : MM140 Switchboard #1
Status OK



Measurements

Value

Bx1

Max 74.5 °F
Min 71.1 °F
Area 0.285 ft²
Sp1 74.1 °F

Thermogram 190 Created: 5/18/2026 1:09:59 PM

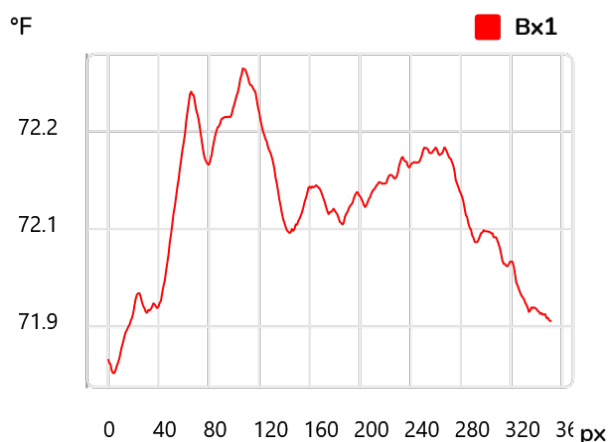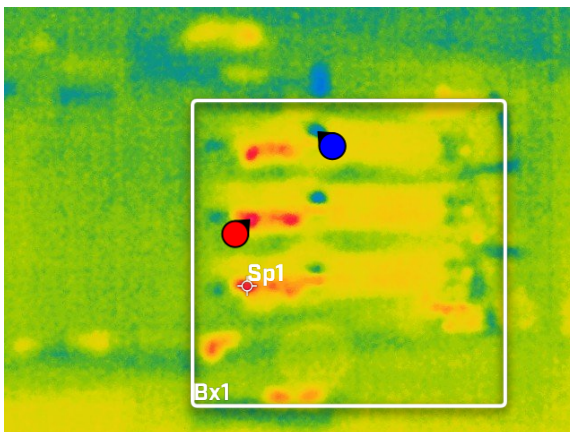

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.42 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 199 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1033
Measurement Point : MM140 Switchboard #1
Status OK

Measurements

Value

Bx1



Max 81.2 °F

Min 71.2 °F

Sp1 76.9 °F

Sp2 77.1 °F

Thermogram 191 Created: 5/18/2026 1:14:12 PM

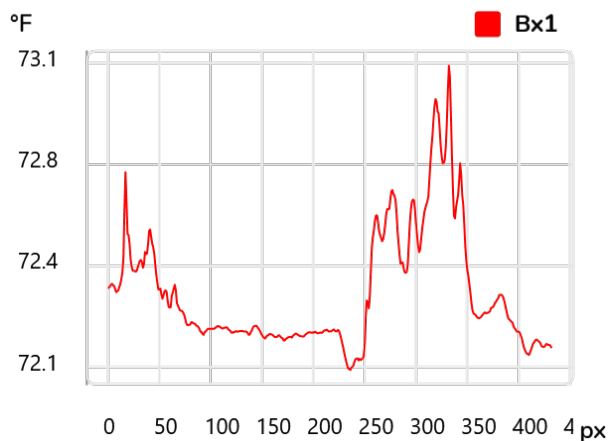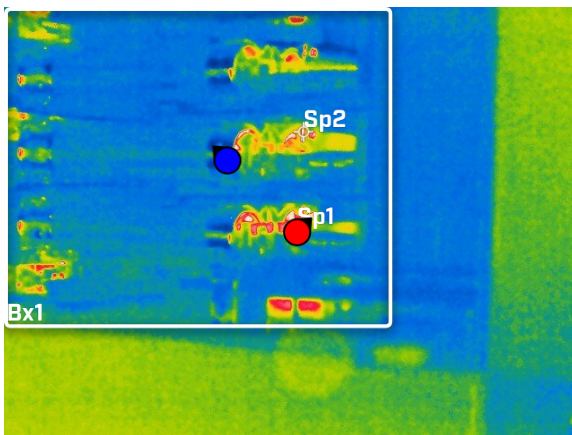

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 1.86 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 200 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1033
Measurement Point : MM140 Switchboard #1
Status OK

Measurements

Value	
Bx1	
Max	75.9 °F
Min	70.4 °F
Area	0.333 ft²
Sp1	74.9 °F

Thermogram 192 Created: 5/18/2026 1:18:04 PM

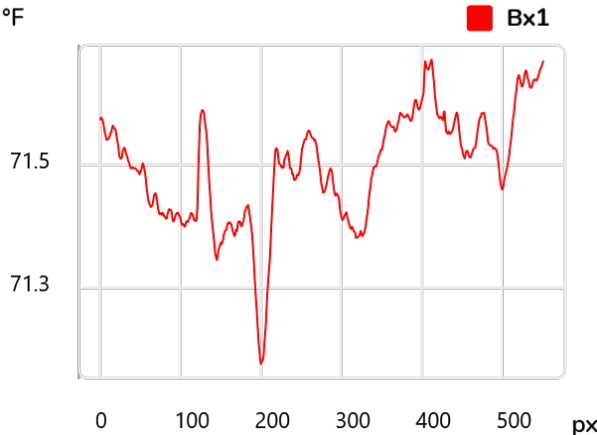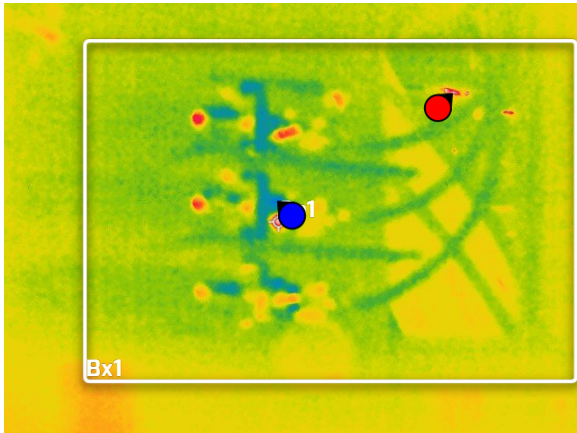

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 1.98 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 201 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK



Measurements

Value

Bx1

Max 81.7 °F
Min 70.4 °F
Area 0.555 ft²
Sp1 75.4 °F

Thermogram 193 Created: 5/18/2026 1:24:23 PM

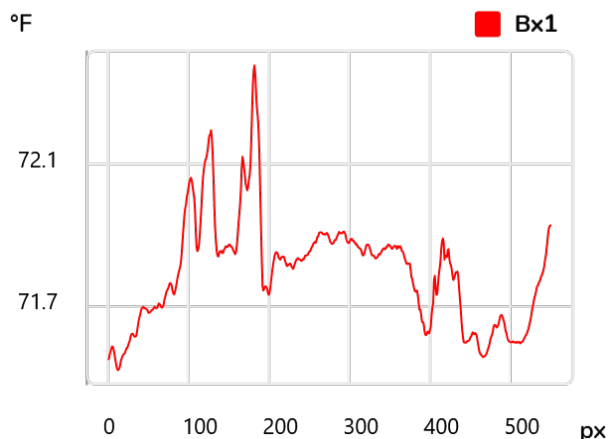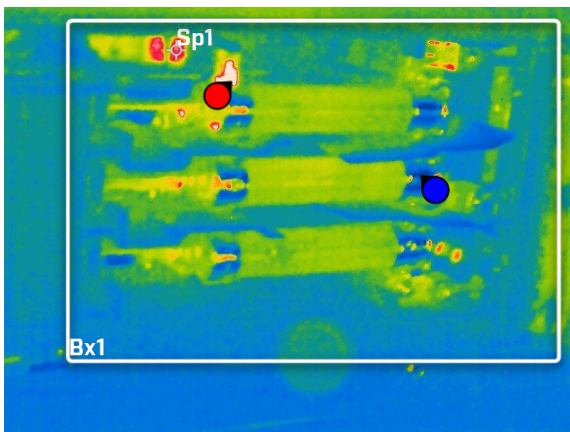

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.56 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 202 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK



Measurements

Value

Bx1

Max 76.1 °F
Min 70.9 °F
Area 0.344 ft²
Sp1 75.7 °F

Thermogram 194 Created: 5/18/2026 1:26:49 PM

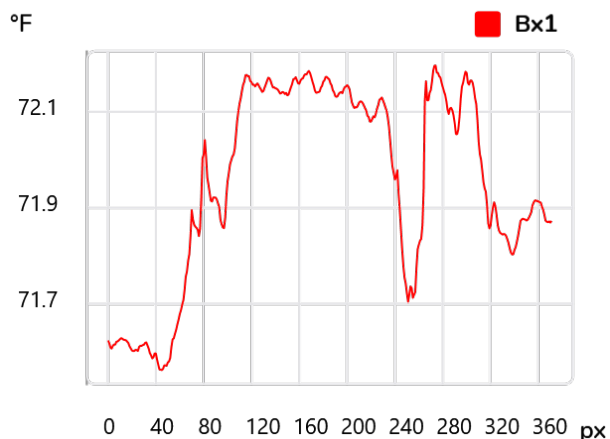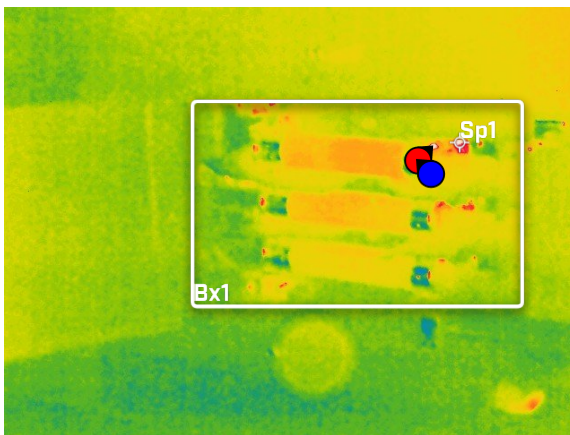

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.15 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 203 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK



Measurements

Value

Bx1

Max 78.2 °F
Min 71.1 °F
Area 0.969 ft²
Sp1 74.2 °F

Thermogram 195 Created: 5/18/2026 1:28:53 PM

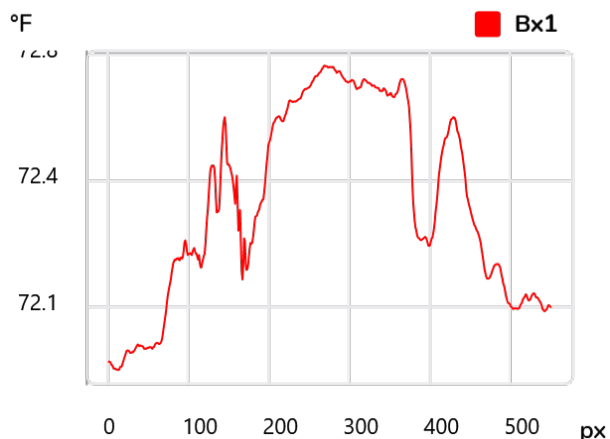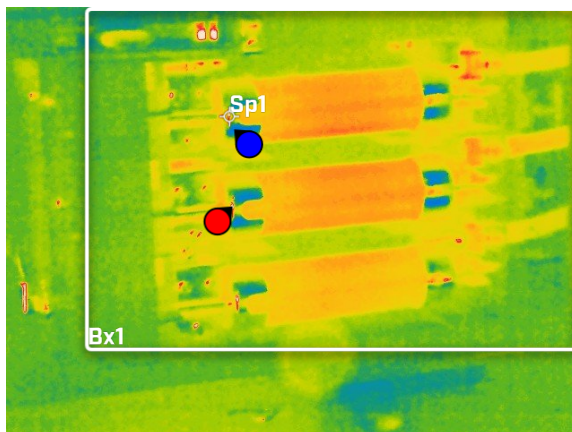

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.38 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 204 / 271


Visual Photo




Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK

Measurements

Thermogram 196 Created: 5/18/2026 1:31:22 PM

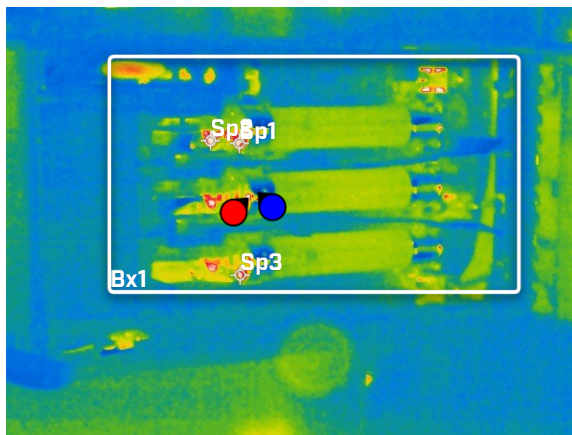

Value	
Bx1	
Max	80.4 °F
Min	70.6 °F
Area	0.381 ft²
Sp1	76.6 °F
Sp2	77.4 °F
Sp3	76.9 °F

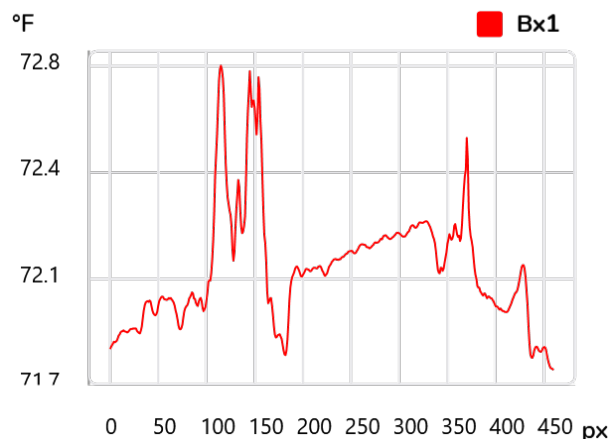

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.78 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 205 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK



Measurements

Value

Bx1

Max 78.9 °F
Min 70.4 °F
Area 0.331 ft²
Sp1 76.1 °F

Thermogram 197 Created: 5/18/2026 1:33:48 PM

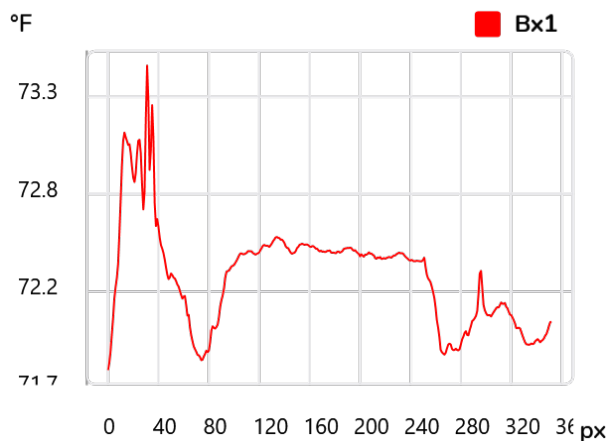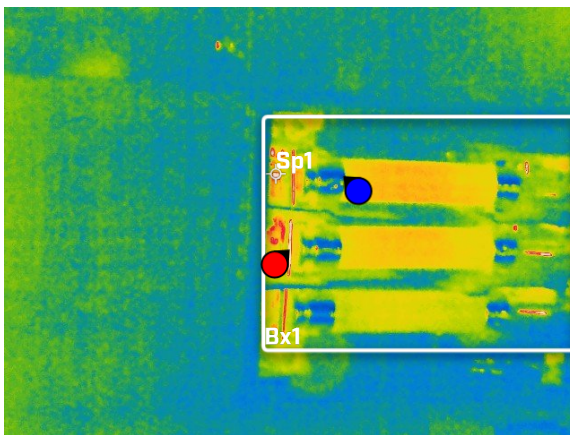

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.97 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 206 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK

Measurements

Value	
Bx1	
Max	76.5 °F
Min	70.6 °F
Area	0.619 ft²
Sp1	75.4 °F

Thermogram 198 Created: 5/18/2026 1:36:28 PM

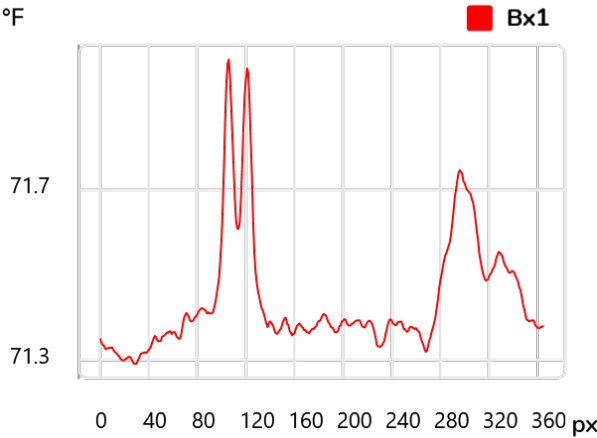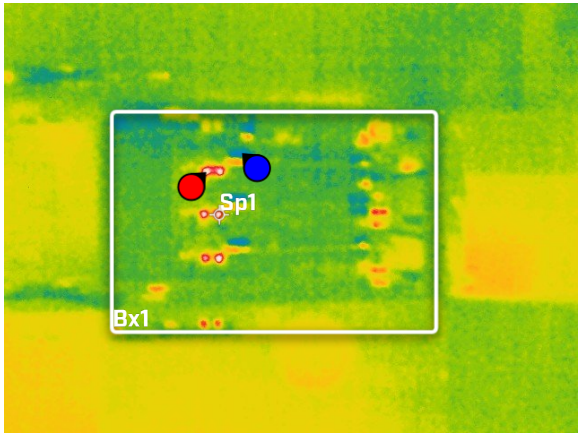

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.11 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 207 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK

Measurements

Value	
Bx1	
Max	78.3 °F
Min	70.7 °F
Area	0.749 ft²
Sp1	75.8 °F

Thermogram 199 Created: 5/18/2026 1:38:34 PM

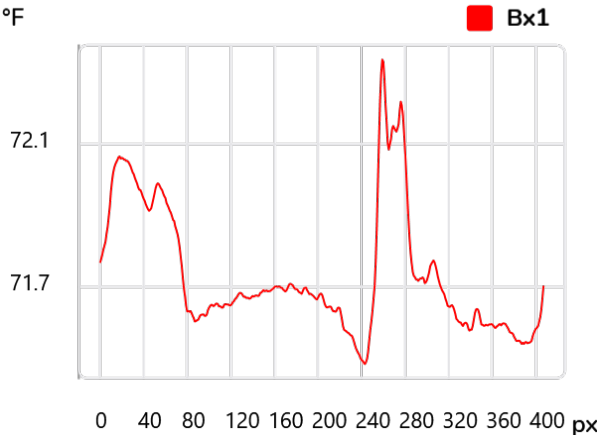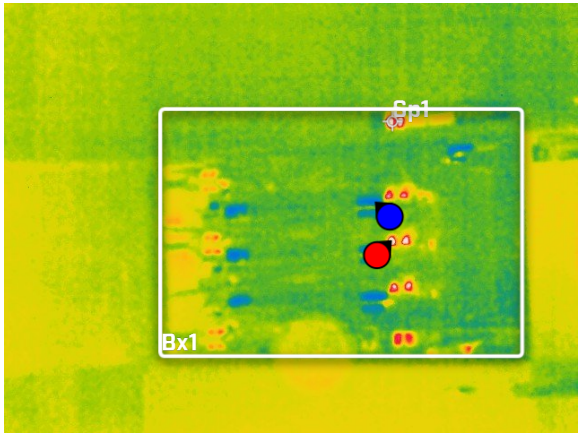

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.04 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 208 / 271

Visual Photo




Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK

Measurements

Value	
Bx1	
Max	73.3 °F
Min	69.9 °F
Area	1.437 ft²
Sp1	70.9 °F

Thermogram 200 Created: 5/18/2026 1:40:37 PM

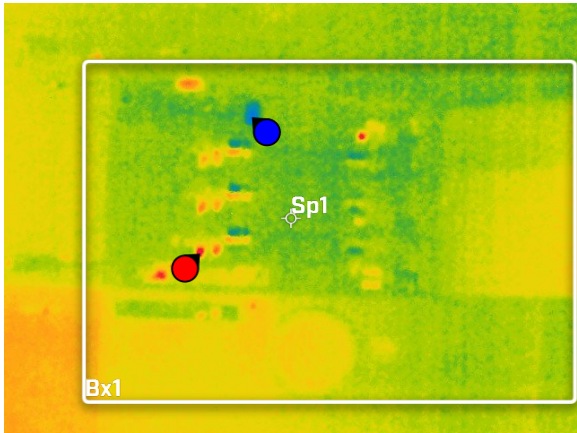

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	4.11 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 209 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK



Measurements

Value

Bx1

Max 76.2 °F
Min 70.7 °F
Area 1.471 ft²
Sp1 71.4 °F

Thermogram 201 Created: 5/18/2026 1:43:02 PM

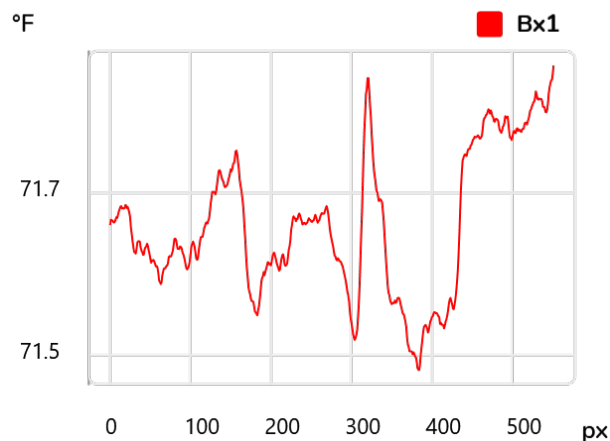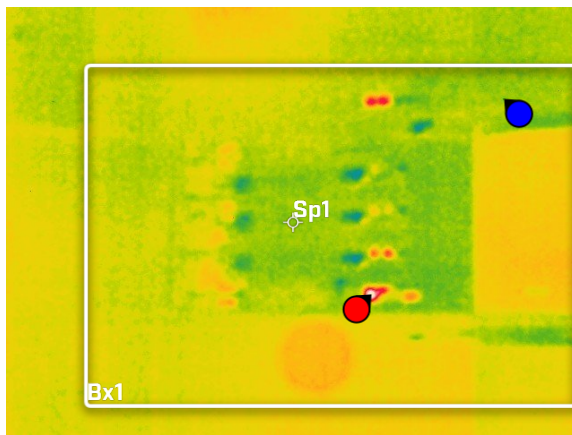

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.16 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 210 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK

Measurements

Value	
Bx1	
Max	73.6 °F
Min	70.2 °F
Area	1.278 ft²
Sp1	71.8 °F

Thermogram 202 Created: 5/18/2026 1:45:06 PM

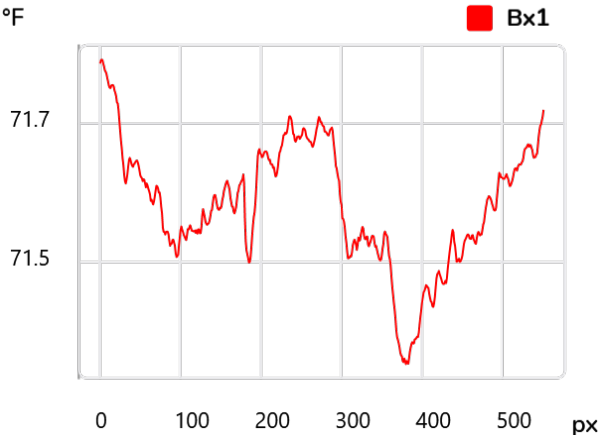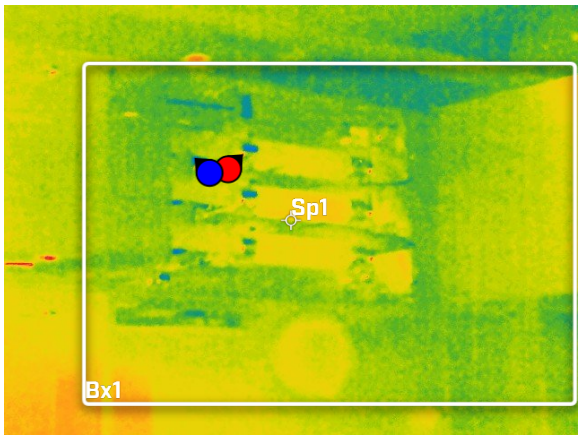

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.88 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 211 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1034
Measurement Point : MM140 Switchboard #2
Status OK

Measurements

Value	
Bx1	
Max	81.1 °F
Min	70.4 °F
Area	0.427 ft²
Sp1	73.6 °F

Thermogram 203 Created: 5/18/2026 1:47:15 PM

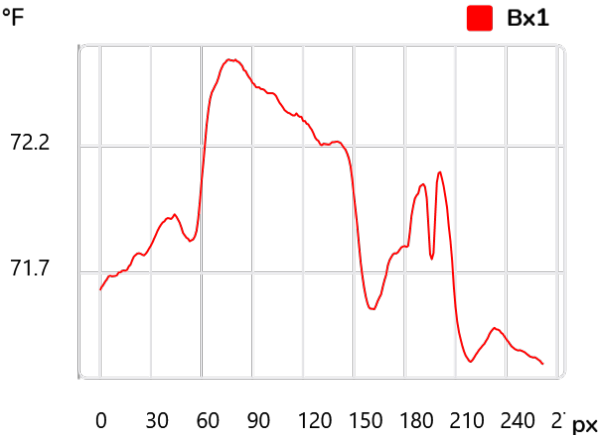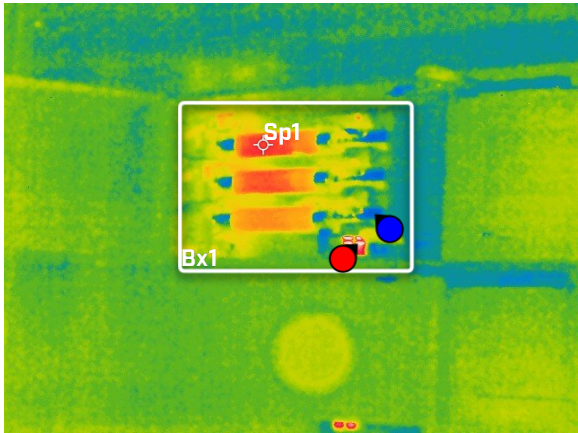

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.60 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 212 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK



Measurements

Value

Bx1

Max 78.9 °F
Min 70.7 °F
Area 0.353 ft²
Sp1 74.1 °F

Thermogram 204 Created: 5/18/2026 1:51:26 PM

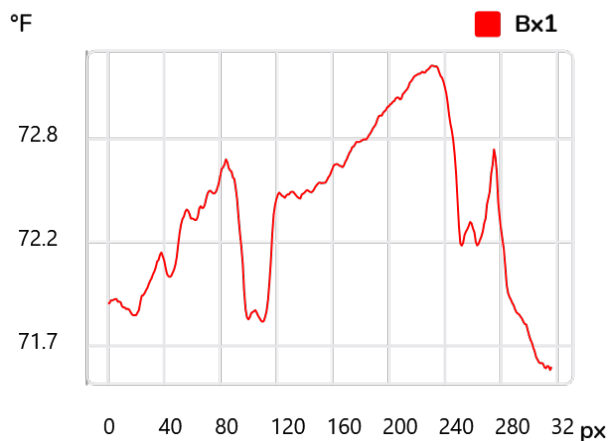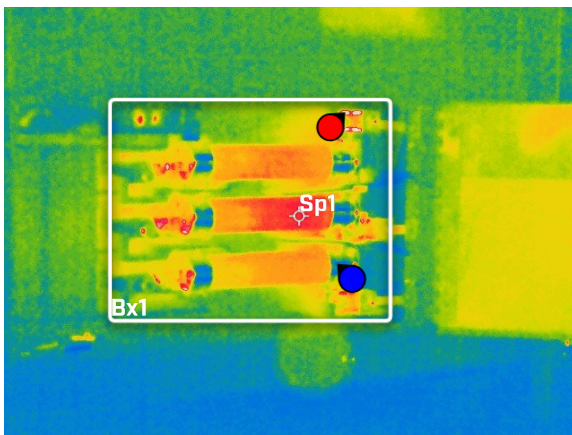

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.33 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 213 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK



Measurements

Value

Bx1

Max 76.5 °F
Min 70.5 °F
Area 0.433 ft²
Sp1 74.1 °F

Thermogram 205 Created: 5/18/2026 1:54:46 PM

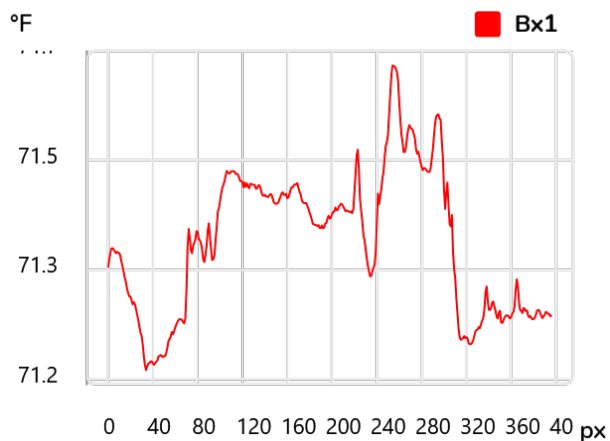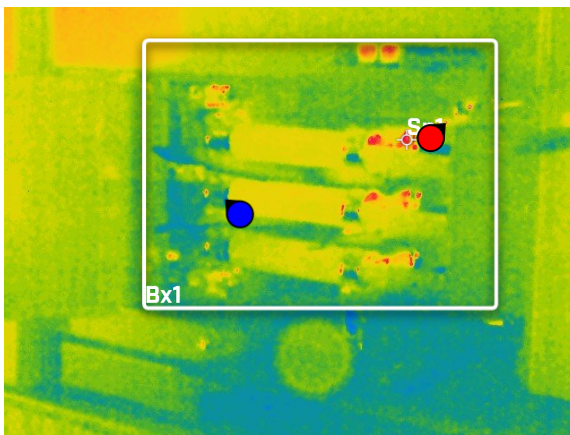

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.00 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 214 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK



Measurements

Value

Bx1

Max 76.0 °F
Min 70.4 °F
Area 0.734 ft²
Sp1 75.1 °F

Thermogram 206 Created: 5/18/2026 1:57:09 PM

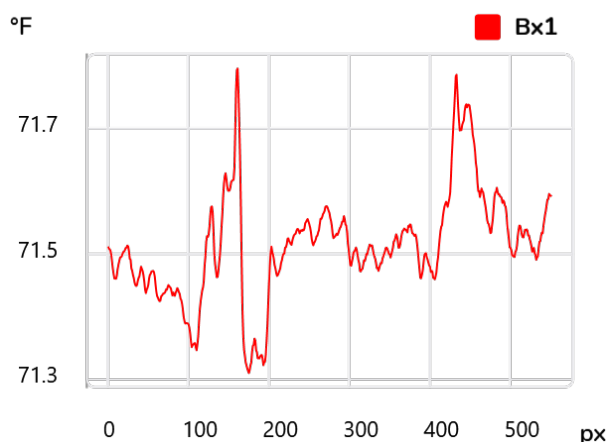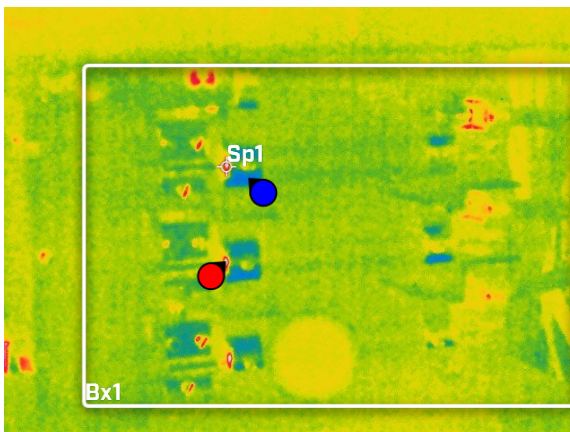

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.94 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 215 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK

Measurements

Value	
Bx1	
Max	77.3 °F
Min	70.9 °F
Area	0.640 ft²
Sp1	77.2 °F

Thermogram 207 Created: 5/18/2026 1:59:32 PM

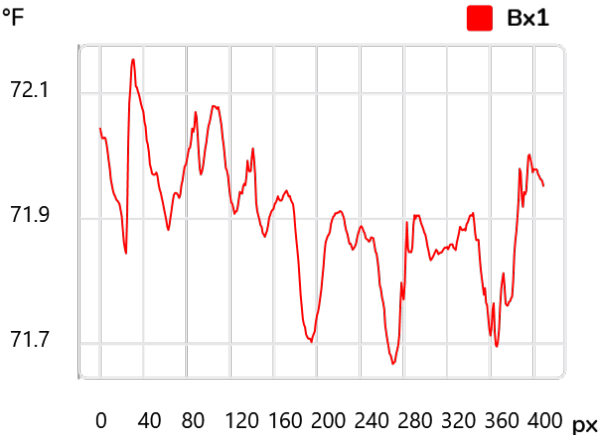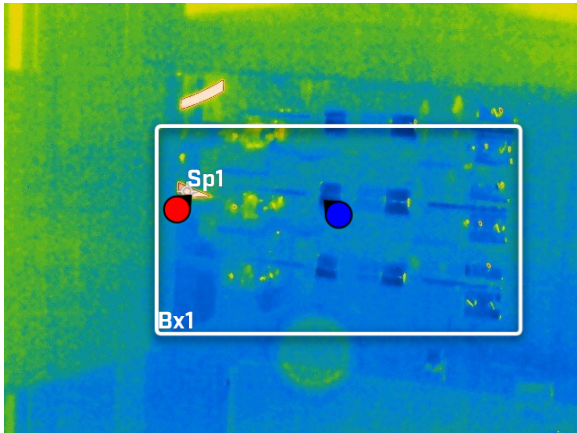

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 4.07 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 216 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK



Measurements

Value

Bx1

Max 89.6 °F
Min 71.3 °F
Area 0.355 ft²
Sp1 87.5 °F
Sp2 84.5 °F

Thermogram 208 Created: 5/18/2026 2:17:07 PM

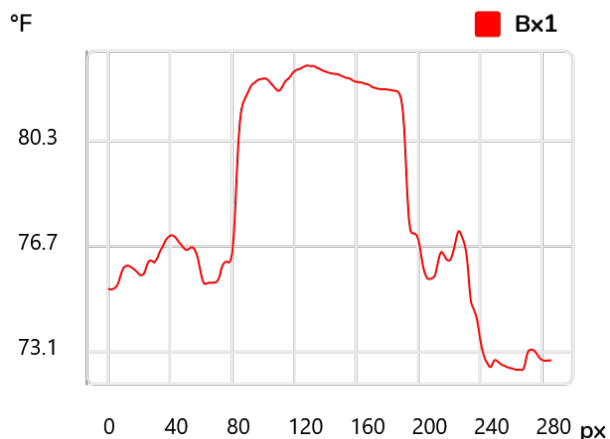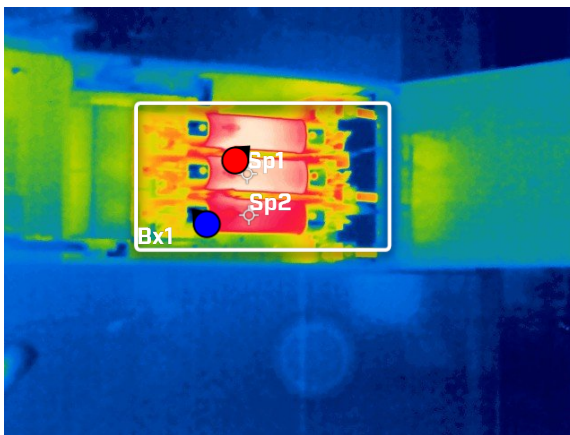

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 4.29 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 217 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK

Measurements

Value

Bx1

Max 104.7 °F



Min 72.2 °F

Area 0.403 ft²

Sp1 103.0 °F

Sp2 102.9 °F

Thermogram 209 Created: 5/18/2026 2:19:49 PM

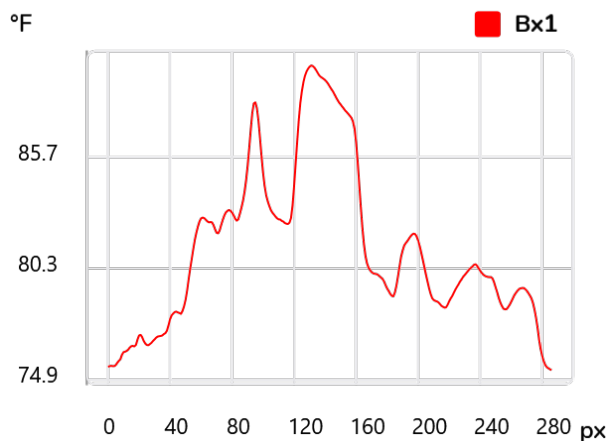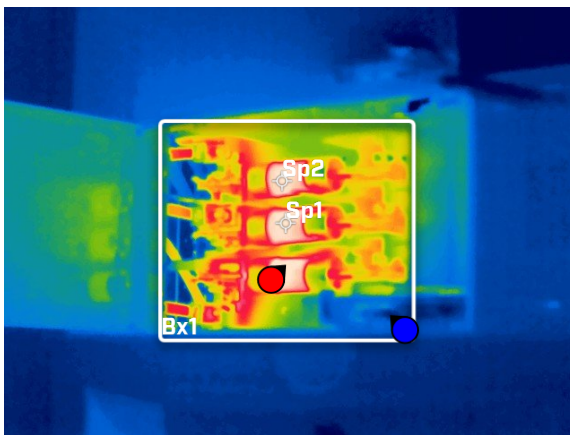

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 3.76 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 218 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK

Measurements

Value	
Bx1	
Max	102.9 °F
Min	71.8 °F
Area	0.549 ft²
Sp1	99.4 °F
Sp2	100.4 °F

Thermogram 210 Created: 5/18/2026 2:25:19 PM

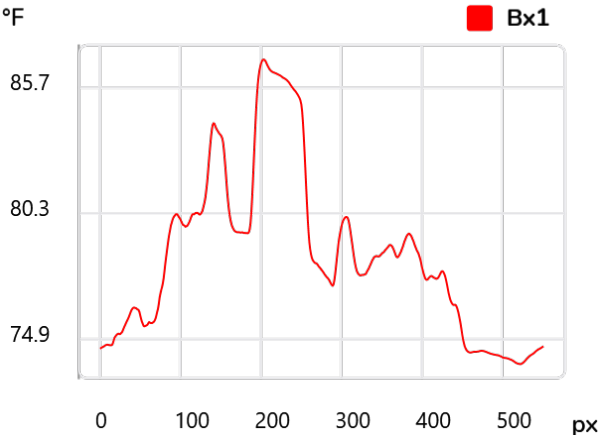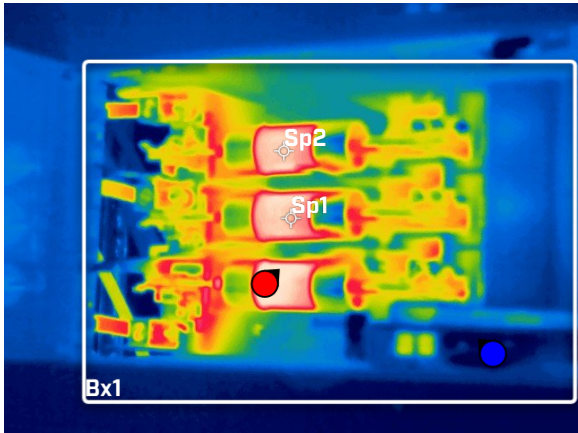

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	2.54 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 219 / 271

Visual Photo

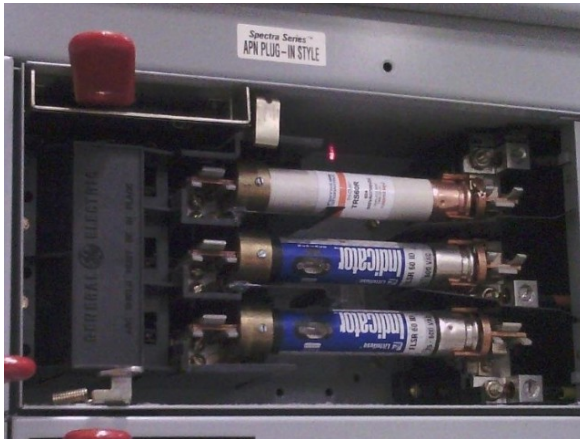

Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK



Measurements

Value

Bx1

Max 78.0 °F
Min 70.6 °F
Area 0.523 ft²
Sp1 72.5 °F

Thermogram 211 Created: 5/18/2026 2:26:46 PM

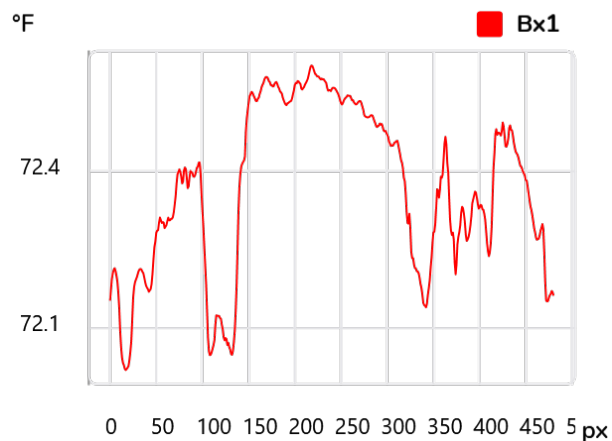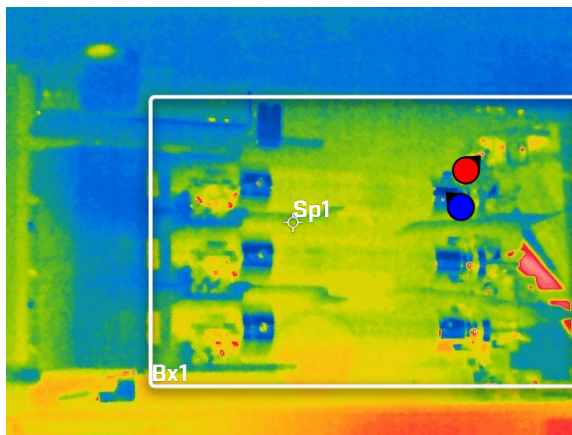

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.88 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 220 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1035
Measurement Point : MM140 Switchboard #3
Status OK



Measurements

Value

Bx1

Max 81.0 °F
Min 70.8 °F
Area 0.317 ft²
Sp1 76.6 °F

Thermogram 212 Created: 5/18/2026 2:28:53 PM

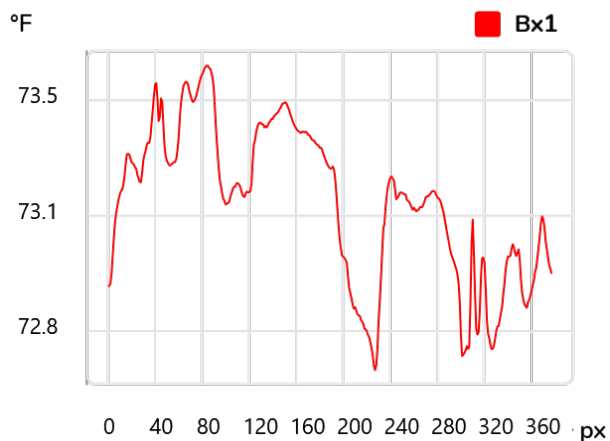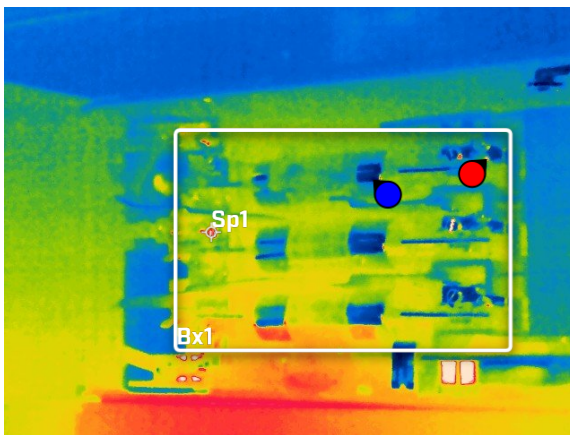

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.90 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 221 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1036
Measurement Point : MM140 Switchboard #4

Status Note



Measurements

Value

Bx1

Max 75.7 °F
Min 71.4 °F
Area 2.541 ft²
Sp1 73.6 °F

Thermogram 213 Created: 5/18/2026 2:34:40 PM

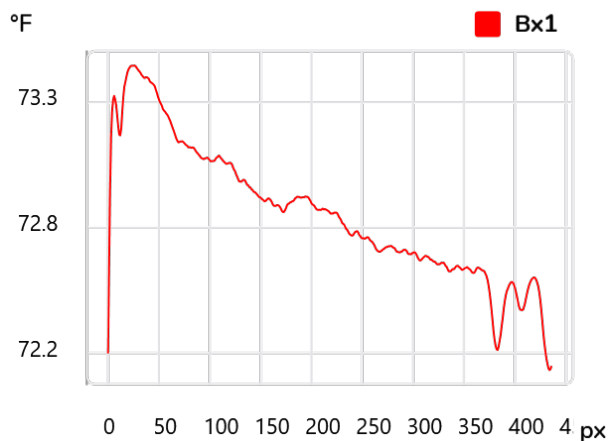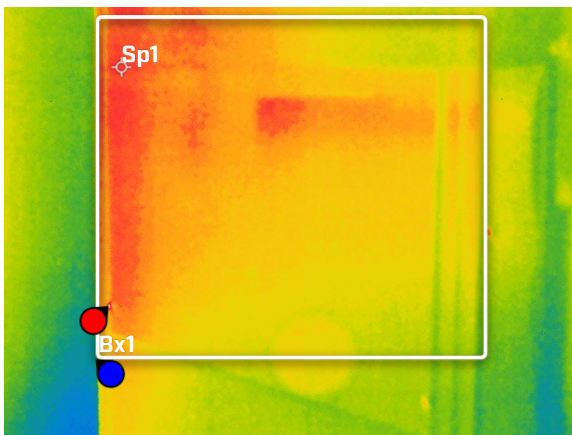

Text Annotations

Issue Unbalanced electrical loads

Recommended Action Monitor changes

Comment Continue to monitor. There is a small variance on A-phase.

Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 6.15 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 222 / 271

Visual Photo

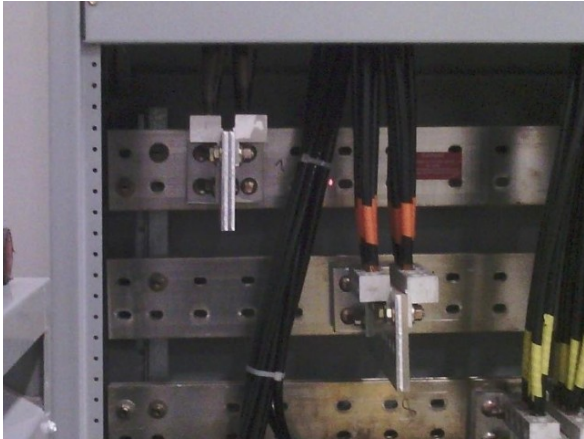

Equipment name : Sensors 204

Device name : 1036


Measurement Point : MM140 Switchboard #4

Status Note

Measurements

Value	
Bx1	
Max	86.7 °F
Min	70.2 °F
Area	4.337 ft²
Sp1	80.3 °F

Thermogram 214 Created: 5/18/2026 2:36:57 PM

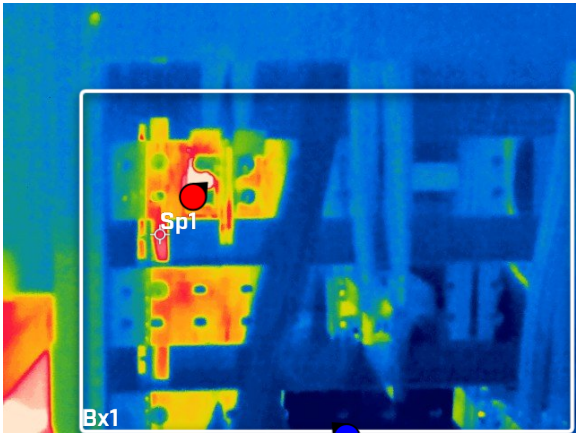

Text Annotations

Issue Unbalanced electrical loads

Recommended Action Monitor changes

Comment Continue to monitor. There is a small variance on A-phase.

Priority 2-Intermediate/Investigate

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	7.15 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 223 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1037
Measurement Point : Transformer #1
Status OK

Measurements

Value	
Bx1	
Max	90.4 °F
Min	73.2 °F
Sp1	84.1 °F

Thermogram 215 Created: 5/18/2026 2:40:12 PM

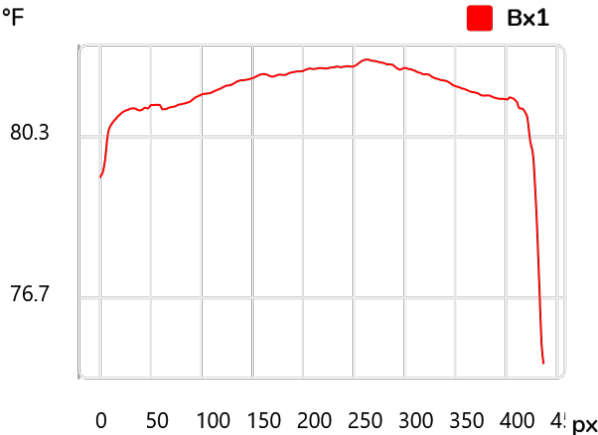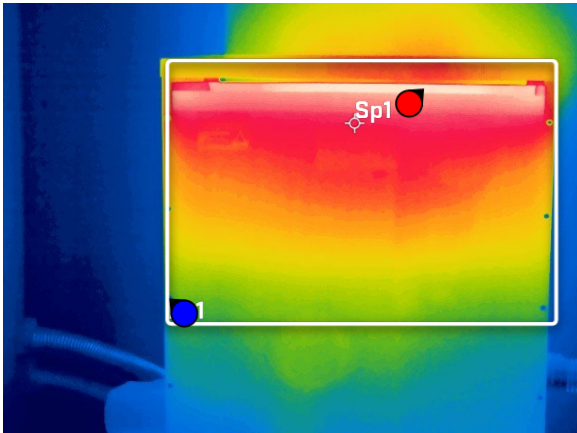

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	10.83 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 224 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1038
Measurement Point : LZ1
Status OK



Measurements

Value

Bx1

Max 74.9 °F
Min 68.8 °F
Area 0.626 ft²
Sp1 71.1 °F

Thermogram 216 Created: 5/18/2026 2:45:26 PM

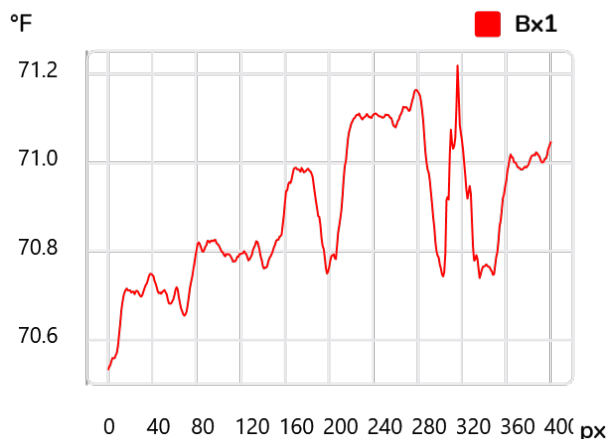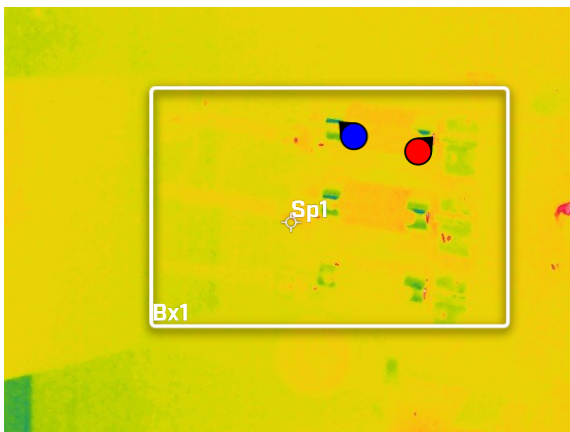

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.80 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 225 / 271

Visual Photo



Equipment name : Sensors 204
Device name : 1038
Measurement Point : LZ1
Status OK



Measurements

Value

Bx1

Max 81.1 °F
Min 69.9 °F
Area 0.416 ft²
Sp1 73.8 °F
Sp2 77.3 °F

Thermogram 217 Created: 5/18/2026 2:48:03 PM

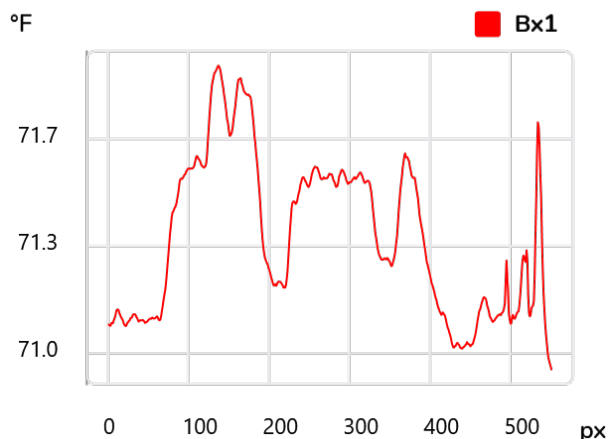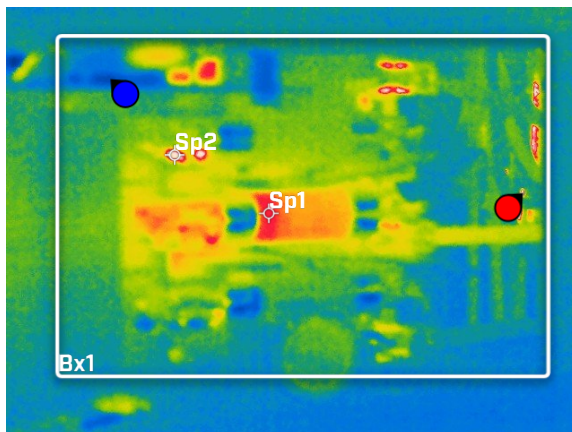

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity 0.95
Distance 2.22 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 226 / 271

Visual Photo


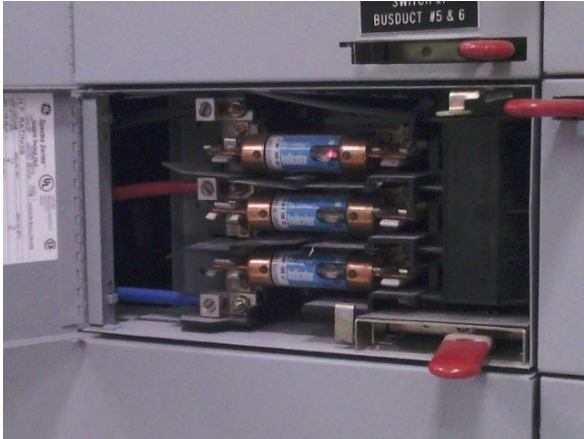


Equipment name : Sensors 204
Device name : 1038
Measurement Point : LZ1
Status OK

Measurements

Value	
Bx1	
Max	80.0 °F
Min	69.9 °F
Area	0.352 ft²
Sp1	77.0 °F

Thermogram 218 Created: 5/18/2026 2:50:14 PM

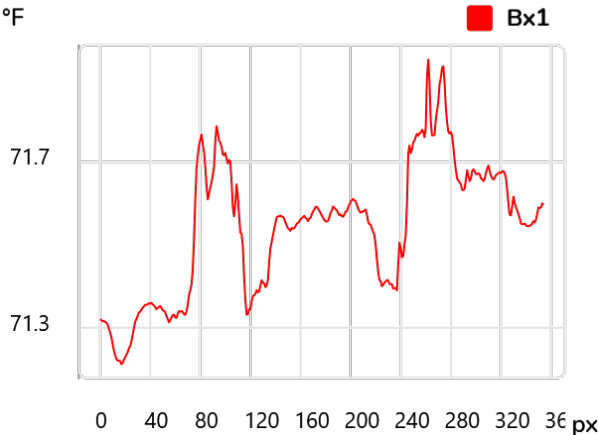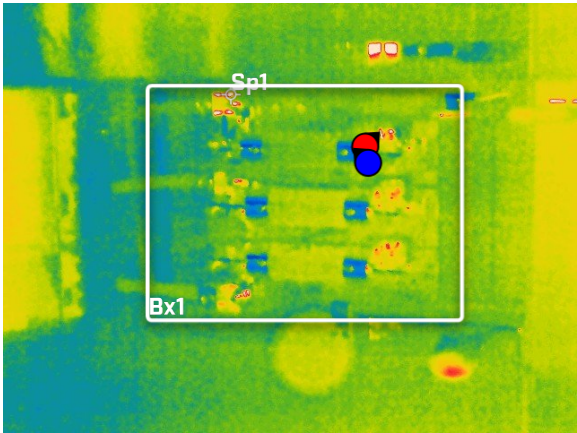

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 3.05 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 227 / 271

Visual Photo


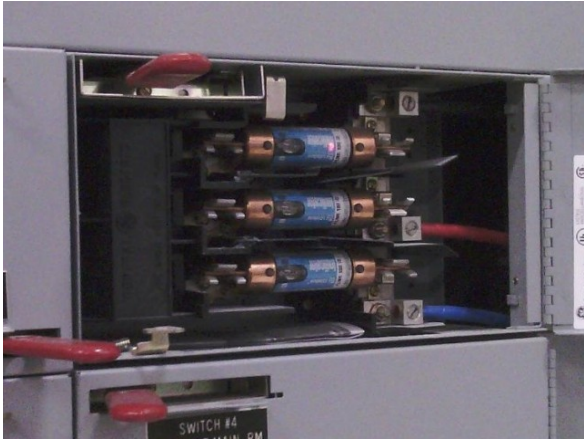


Equipment name : Sensors 204
Device name : 1038
Measurement Point : LZ1
Status OK

Measurements

Value	
Bx1	
Max	80.7 °F
Min	70.0 °F
Area	0.706 ft²
Sp1	72.8 °F

Thermogram 219 Created: 5/18/2026 2:52:17 PM

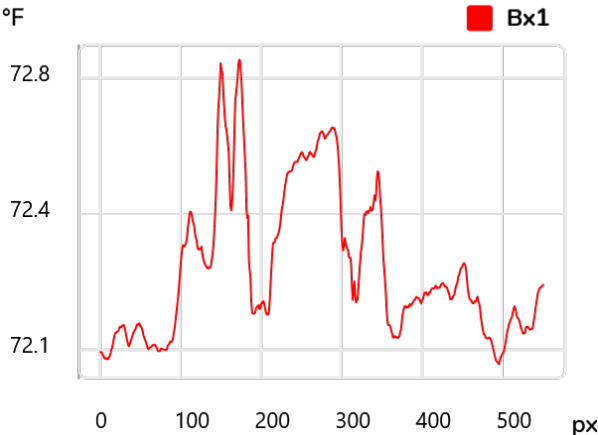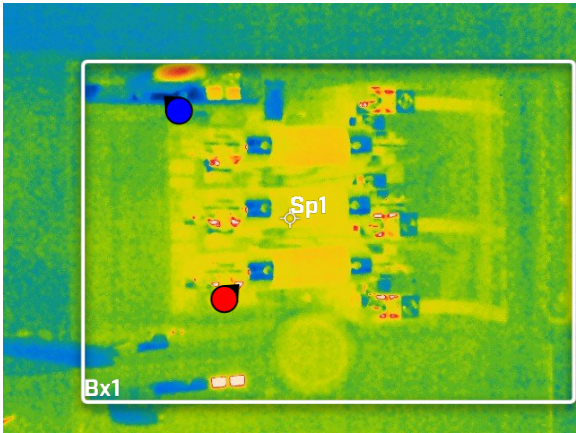

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	2.89 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 228 / 271

Visual Photo





Equipment name : Sensors 204
Device name : 1038
Measurement Point : LZ1
Status OK

Measurements

Value	
Bx1	
Max	79.0 °F
Min	70.0 °F
Area	0.420 ft²
Sp1	77.2 °F

Thermogram 220 Created: 5/18/2026 2:54:29 PM

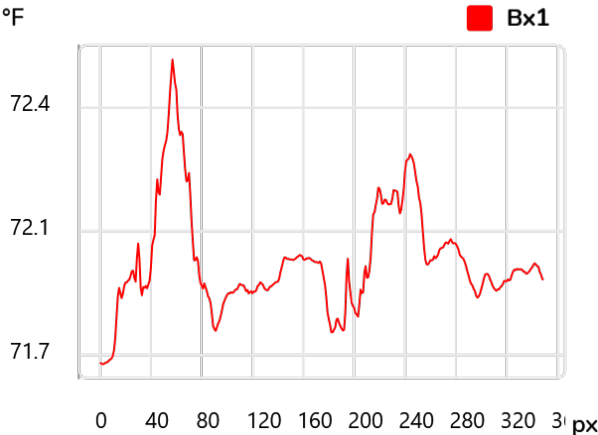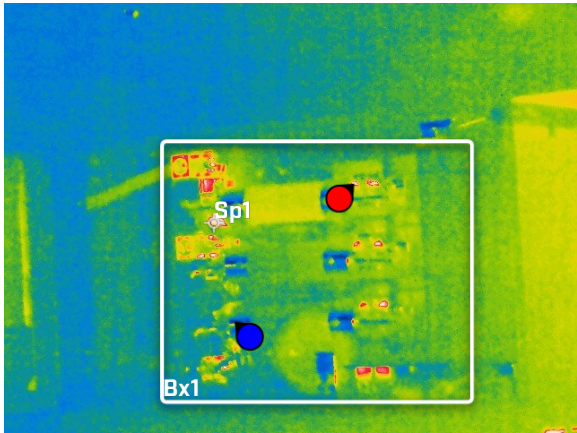

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	3.19 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 229 / 271

Visual Photo


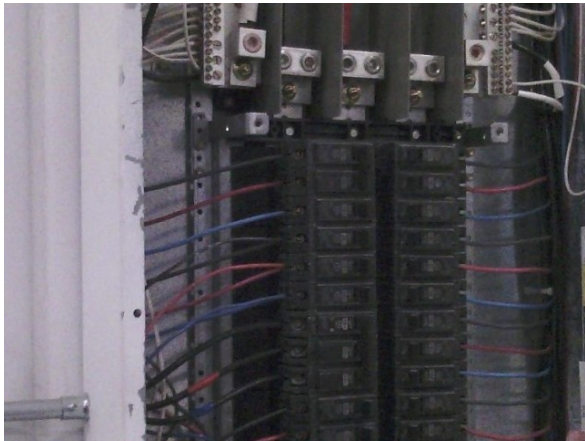


Equipment name : Sensors 204
Device name : 1039
Measurement Point : LZ1A
Status OK

Measurements

Bx1	
Max	76.7 °F
Min	69.7 °F
Area	1.100 ft ²
Dt1	
Bx1.Max	6.9 °F
-Bx1.Min	
Sp1	75.6 °F

Thermogram 221 Created: 5/18/2026 3:01:55 PM

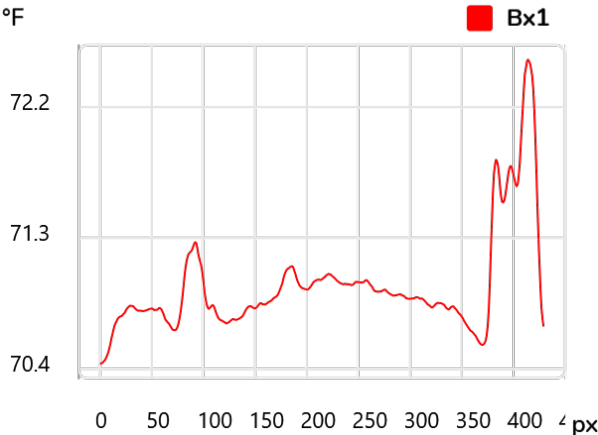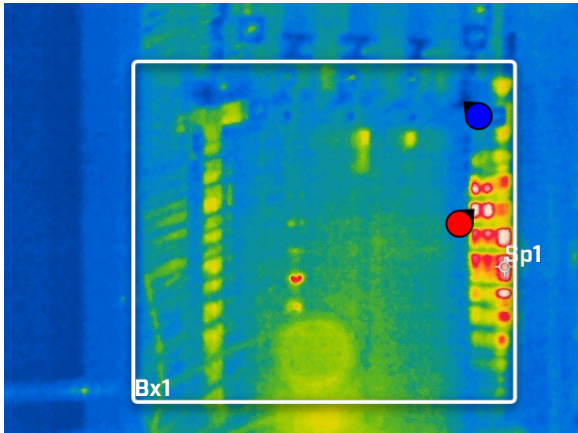

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 4.08 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 230 / 271

Visual Photo


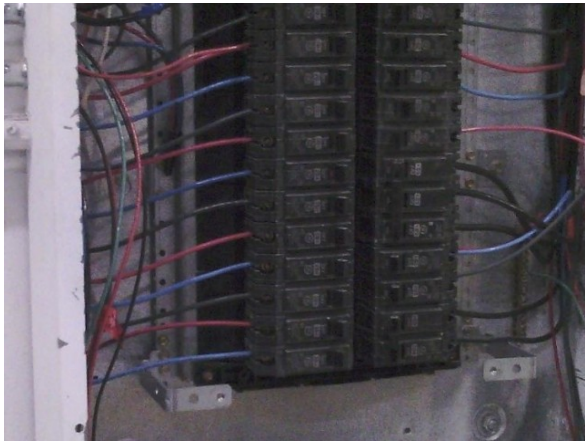


Equipment name : Sensors 204
Device name : 1039
Measurement Point : LZ1A
Status OK

Measurements

Bx1	
Max	78.9 °F
Min	69.7 °F
Area	1.299 ft²
Dt1	
Bx1.Max	9.2 °F
-Bx1.Min	
Sp1	77.2 °F

Thermogram 222 Created: 5/18/2026 3:02:30 PM

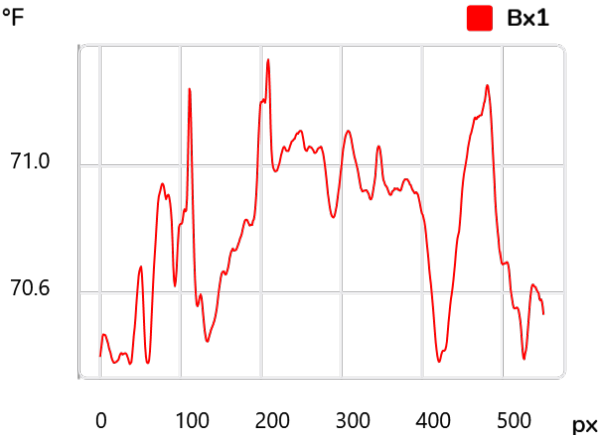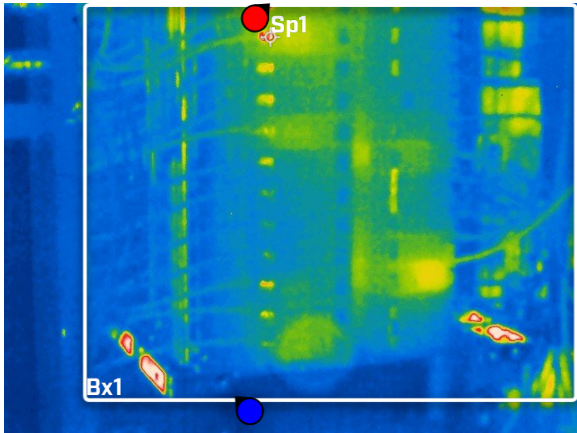

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.63 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 231 / 271

Visual Photo



Equipment name : Quality Lab 205
Device name : 1045
Measurement Point : Compressor #2
Status OK

Measurements

Value

Bx1



Max 108.3 °F

Min 77.2 °F

Area 0.328 ft²

Sp1 104.8 °F

Thermogram 223 Created: 6/3/2026 2:36:06 PM

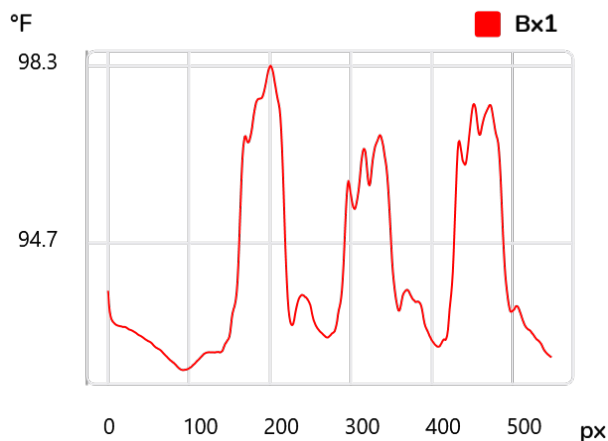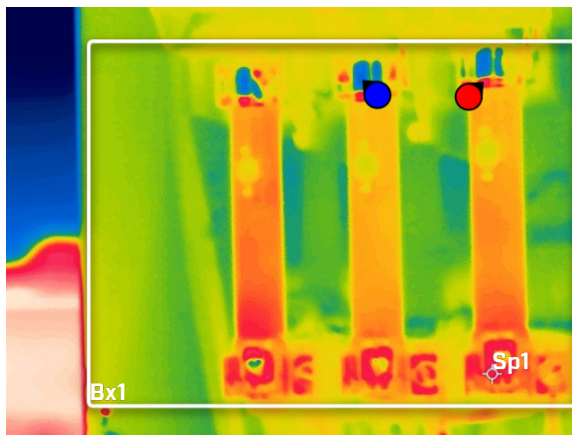

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 1.91 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 232 / 271

Visual Photo



Equipment name : Quality Lab 205
Device name : 1045
Measurement Point : Compressor #2
Status OK

Measurements

Value

Bx1


Max 170.2 °F

Min 47.7 °F

Area 0.763 ft²

Sp1 92.9 °F

Thermogram 224 Created: 6/3/2026 2:37:02 PM

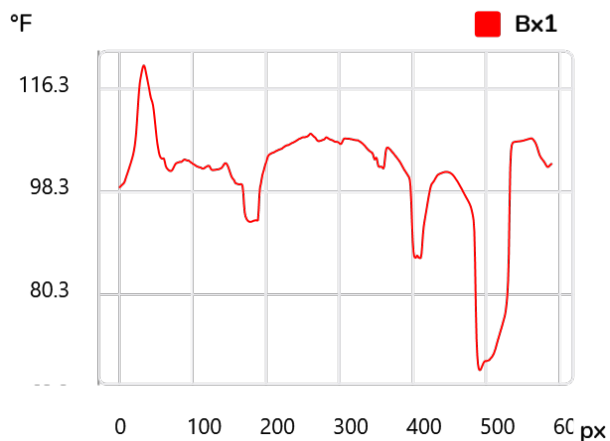

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.69 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 233 / 271

Visual Photo





Equipment name : Quality Lab 205
Device name : 1045
Measurement Point : Compressor #2
Status OK

Measurements

Bx1	
Max	118.1 °F
Min	50.9 °F
Area	0.974 ft²
Dt1	
Bx1.Max	67.3 °F
-Bx1.Min	
Sp1	114.2 °F
Sp2	111.5 °F

Thermogram 225 Created: 6/3/2026 2:37:40 PM

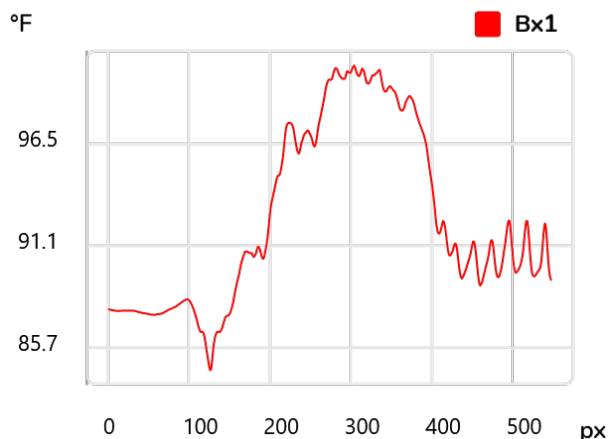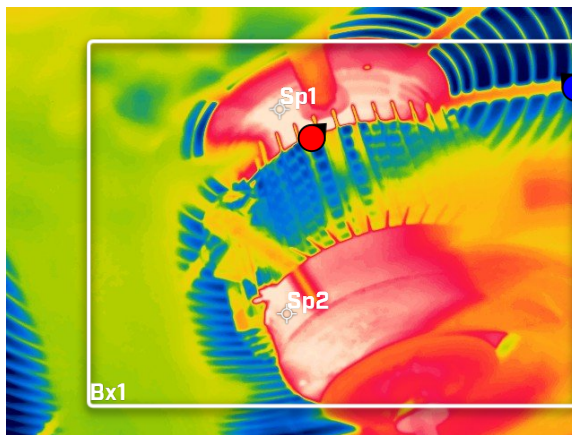

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity 0.95
Distance 3.28 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 234 / 271

Visual Photo

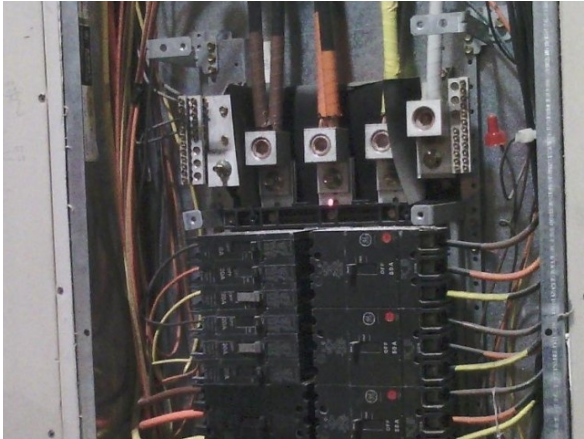

Equipment name : Large Shipping 400

Device name : 1046



Measurement Point : HZ-3

Status OK

Measurements

Bx1	
Max	75.6 °F
Min	68.6 °F
Area	1.886 ft²
Dt1	
Bx1.Max	7.0 °F
-Bx1.Min	
Sp1	70.7 °F

Thermogram 226 Created: 5/19/2026 12:45:18 PM

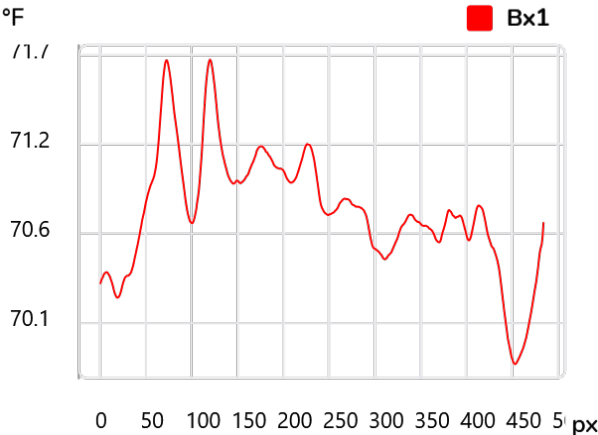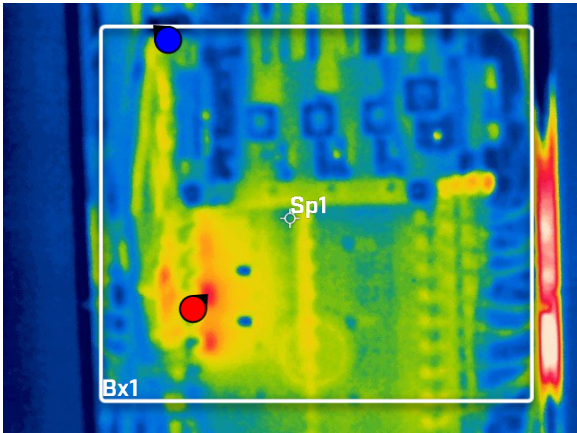

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 4.80 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 235 / 271

Visual Photo

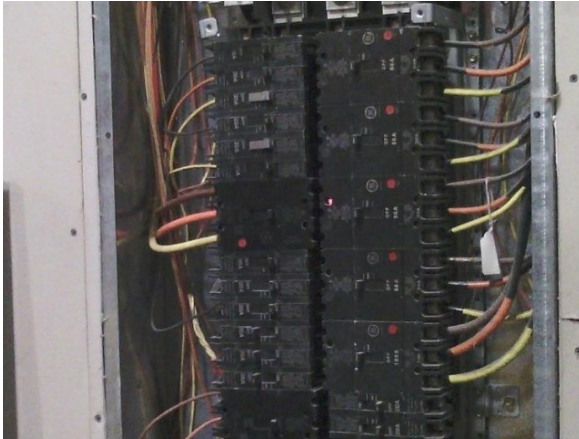

Equipment name : Large Shipping 400

Device name : 1046



Measurement Point : HZ-3

Status OK

Measurements

Bx1	
Max	75.7 °F
Min	68.6 °F
Area	1.802 ft²
Dt1	
Bx1.Max	7.1 °F
-Bx1.Min	
Sp1	74.8 °F

Thermogram 227 Created: 5/19/2026 12:46:32 PM

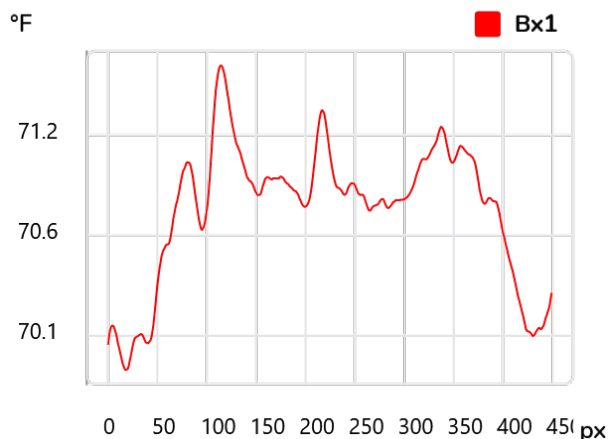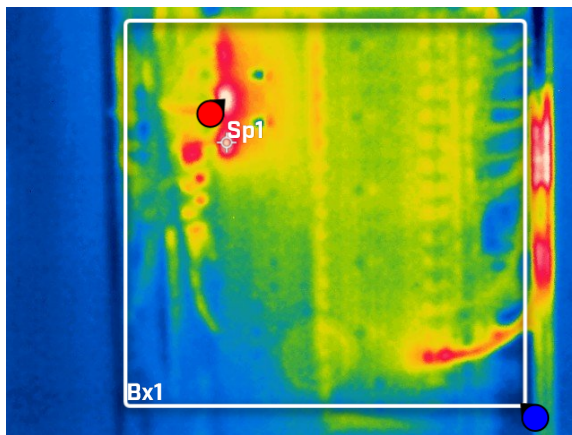

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	4.80 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 236 / 271

Visual Photo


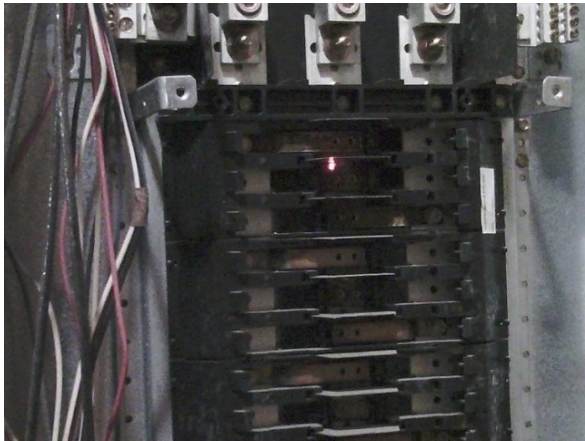


Equipment name : Large Shipping 400
Device name : 1047
Measurement Point : LZ-3B
Status OK

Measurements

Value	
Bx1	
Max	82.9 °F
Min	67.8 °F
Area	0.876 ft²
Sp1	69.7 °F

Thermogram 228 Created: 5/19/2026 1:17:59 PM

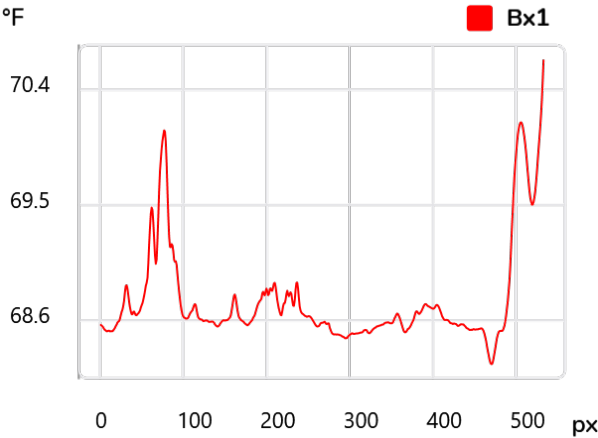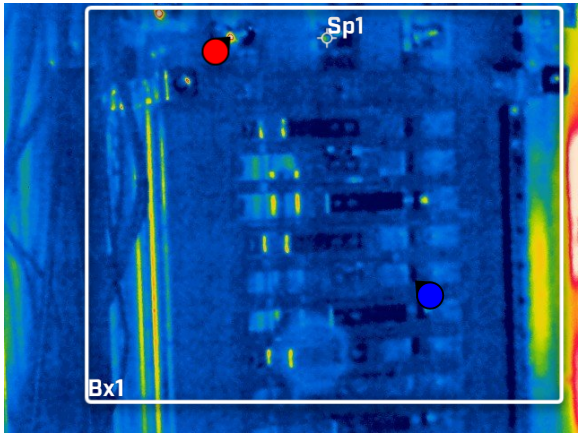

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	3.04 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 237 / 271

Visual Photo

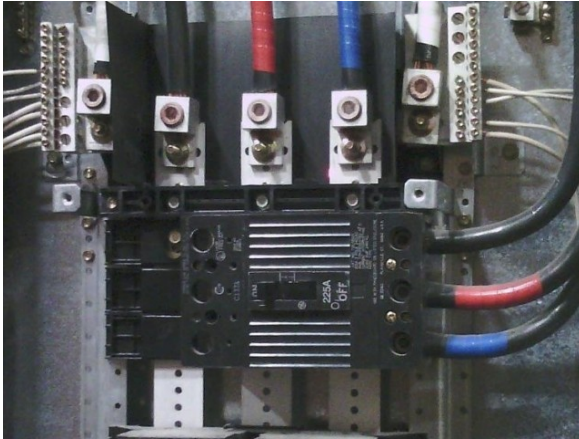

Equipment name : Large Shipping 400

Device name : 1048



Measurement Point : LZ-3A

Status OK

Measurements

Bx1	
Max	81.5 °F
Min	68.3 °F
Area	0.798 ft ²
Dt1	
Bx1.Max	13.2 °F
-Bx1.Min	
Sp1	68.8 °F

Thermogram 229 Created: 5/19/2026 1:03:19 PM

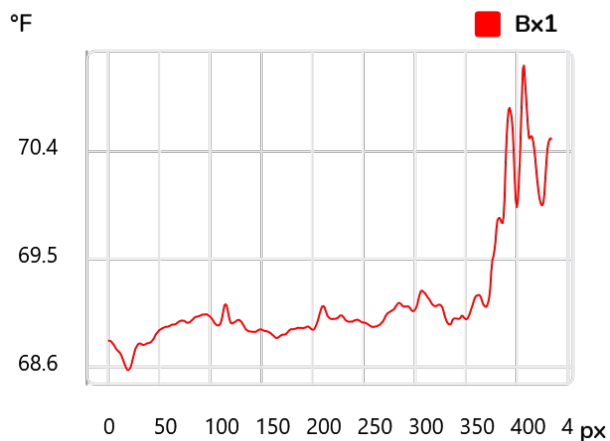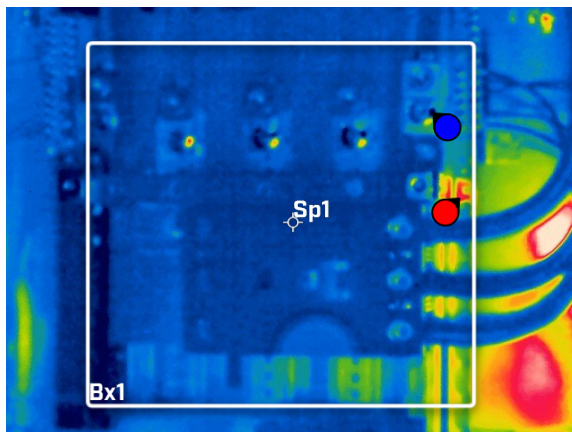

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	3.35 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 238 / 271

Visual Photo





Equipment name : Large Shipping 400
Device name : 1048
Measurement Point : LZ-3A
Status OK

Measurements

Bx1	
Max	71.3 °F
Min	68.3 °F
Area	0.763 ft²
Dt1	
Bx1.Max	3.1 °F
-Bx1.Min	
Sp1	69.6 °F

Thermogram 230 Created: 5/19/2026 1:04:08 PM

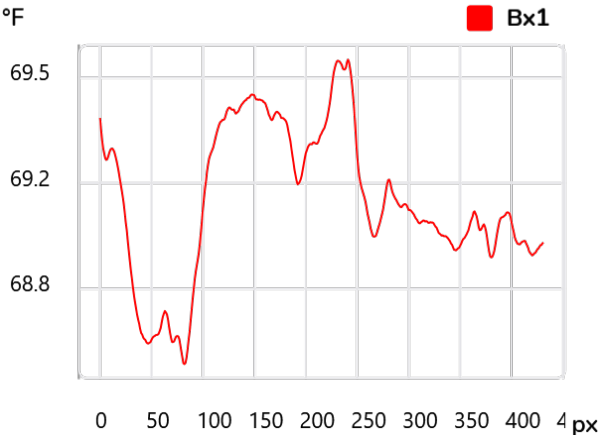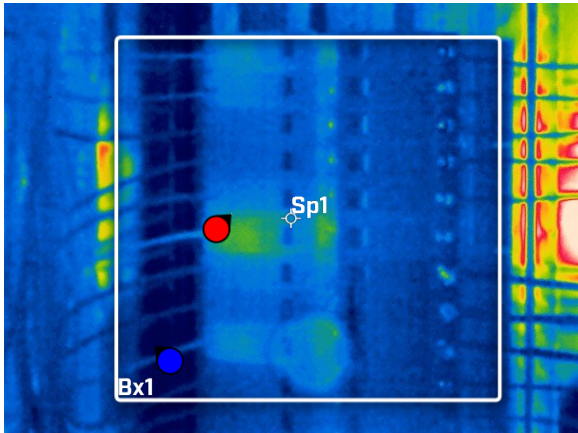

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	3.28 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 239 / 271

Visual Photo

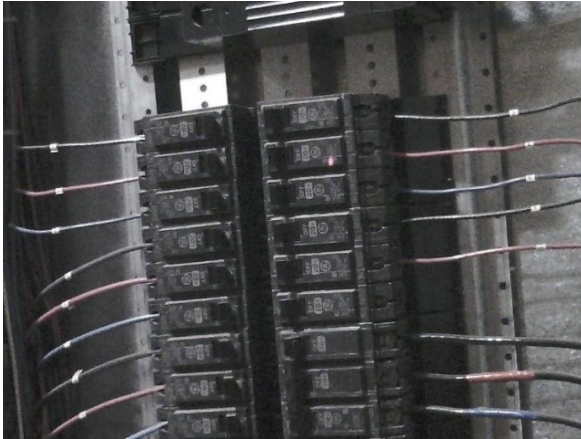

Equipment name : Large Shipping 400

Device name : 1048



Measurement Point : LZ-3A

Status OK

Measurements

Bx1	
Max	76.7 °F
Min	68.1 °F
Area	0.714 ft ²
Dt1	
Bx1.Max	8.6 °F
-Bx1.Min	
Sp1	71.7 °F

Thermogram 231 Created: 5/19/2026 1:05:13 PM

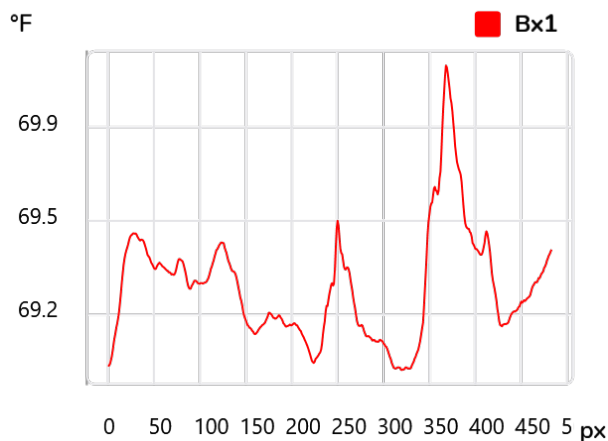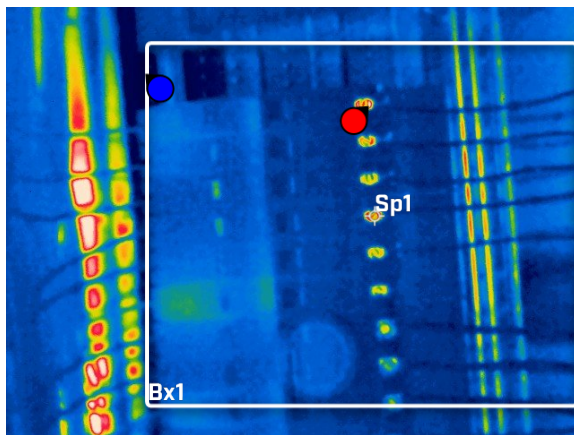

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	3.00 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 240 / 271

Visual Photo

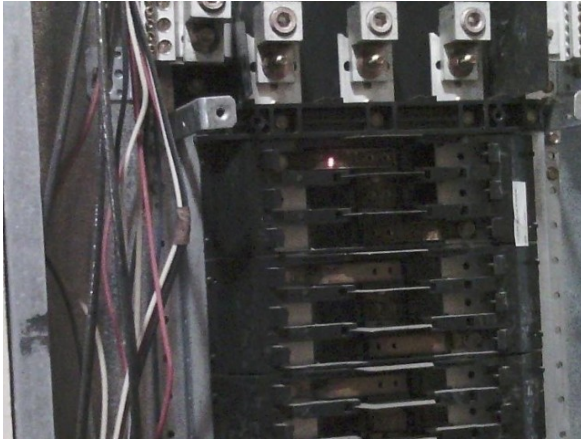

Equipment name : Large Shipping 400

Device name : 1048



Measurement Point : LZ-3A

Status OK

Measurements

Bx1	
Max	80.0 °F
Min	67.8 °F
Area	0.973 ft ²
Dt1	
Bx1.Max	12.2 °F
-Bx1.Min	
Sp1	69.0 °F

Thermogram 232 Created: 5/19/2026 1:15:55 PM

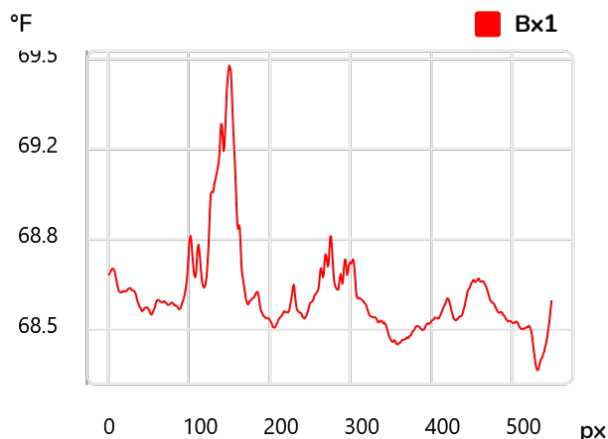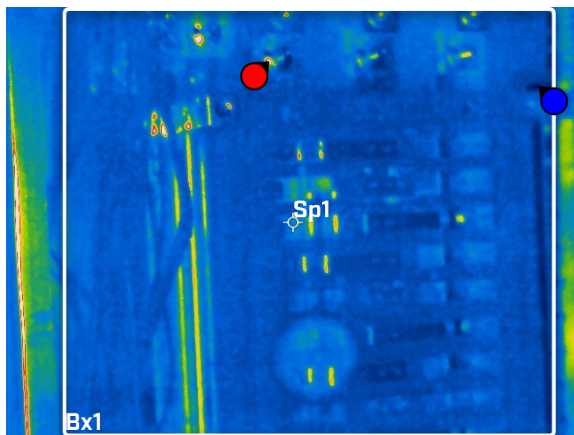

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	3.03 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 241 / 271

Visual Photo

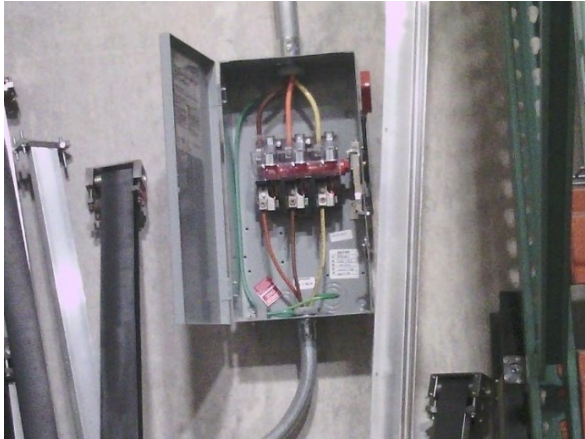

Equipment name : Large Shipping 400

Device name : 1049



Measurement Point : Sanitech Compactor

Status OK

Measurements

Bx1	
Max	72.0 °F
Min	65.8 °F
Area	2.390 ft²
Dt1	
Bx1.Max	6.2 °F
-Bx1.Min	
Sp1	69.7 °F

Thermogram 233 Created: 5/20/2026 12:25:16 PM

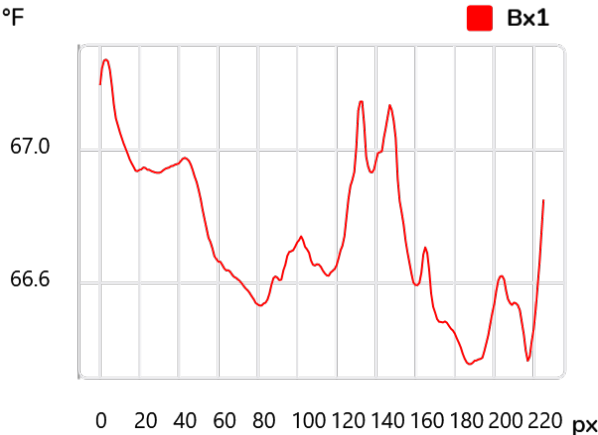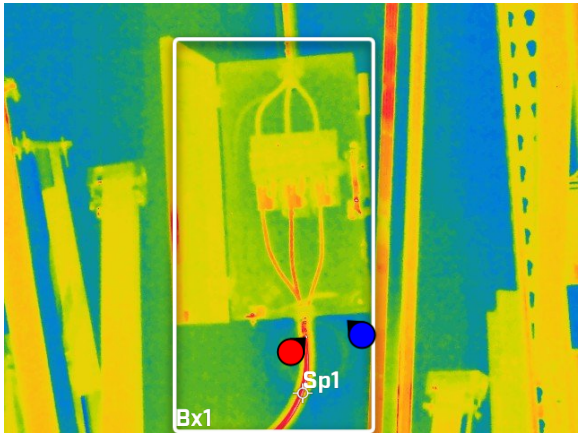

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	7.73 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 242 / 271

Visual Photo




Equipment name : Large Shipping 400

Device name : 1049

Measurement Point : Sanitech Compactor


Status OK

Thermogram 234 Created: 5/20/2026 12:26:10 PM

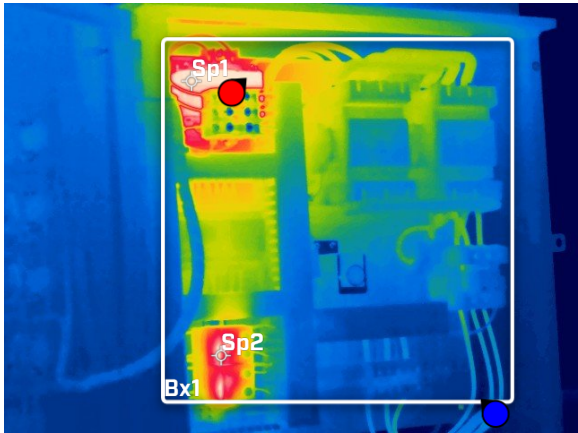

Measurements

Bx1	
Max	106.3 °F
Min	67.5 °F
Area	2.401 ft²
Dt1	
Bx1.Max -Bx1.Min	38.8 °F
Sp1	104.4 °F
Sp2	97.0 °F

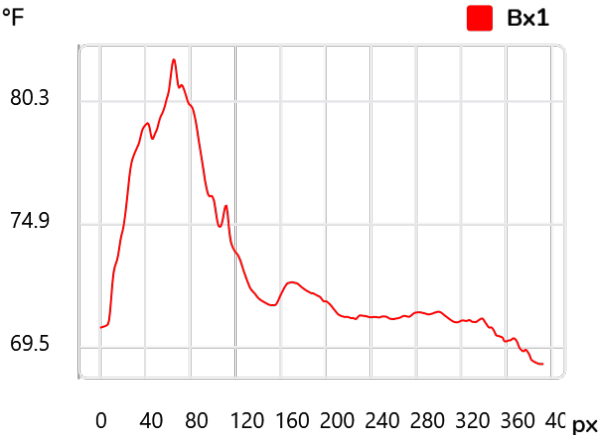

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 6.10 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 243 / 271

Visual Photo

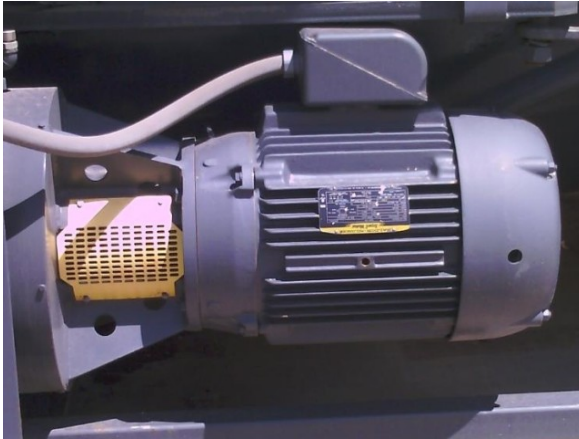

Equipment name : Large Shipping 400

Device name : 1049



Measurement Point : Sanitech Compactor

Status OK

Measurements

Bx1	
Max	100.8 °F
Min	25.1 °F
Area	6.298 ft ²
Dt1	
Bx1.Max	75.7 °F
-Bx1.Min	
Sp1	90.9 °F

Thermogram 235 Created: 5/20/2026 12:31:54 PM

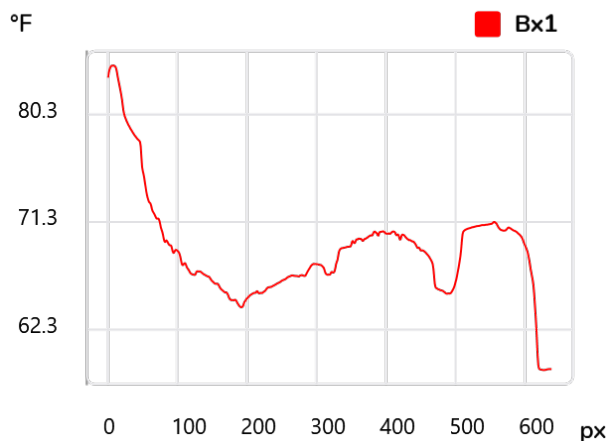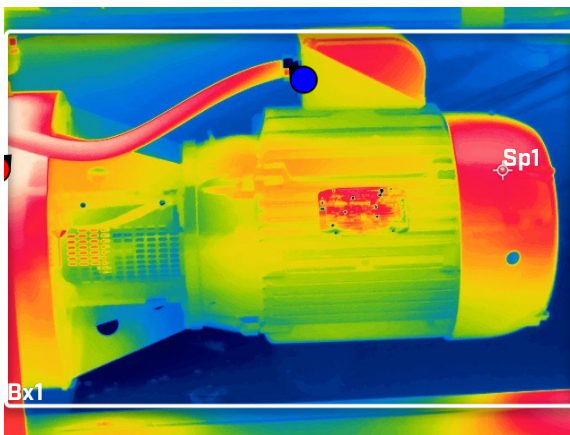

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	7.64 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 244 / 271

Visual Photo

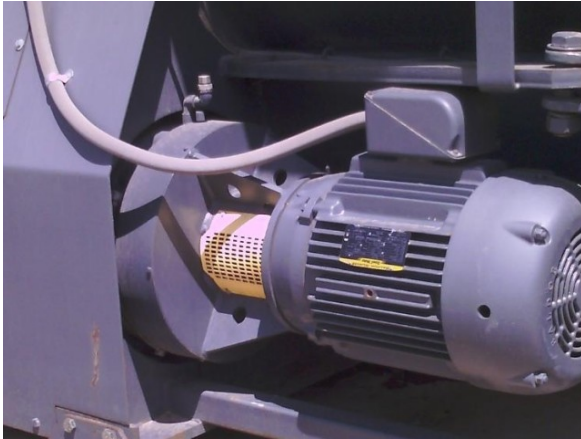

Equipment name : Large Shipping 400

Device name : 1049



Measurement Point : Sanitech Compactor

Status OK

Measurements

Bx1	
Max	99.8 °F
Min	12.6 °F
Area	8.366 ft ²
Dt1	
Bx1.Max	87.2 °F
-Bx1.Min	
Sp1	74.7 °F
Sp2	87.9 °F

Thermogram 236 Created: 5/20/2026 12:32:18 PM

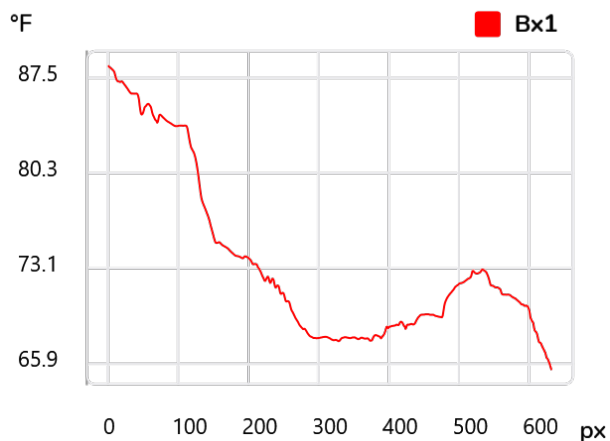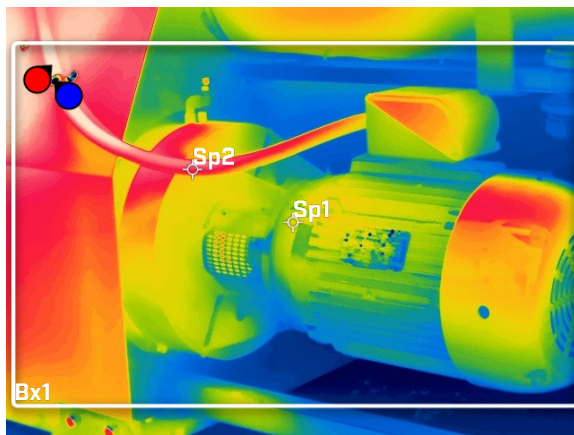

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters


Emissivity	0.95
Distance	8.98 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 245 / 271

Visual Photo

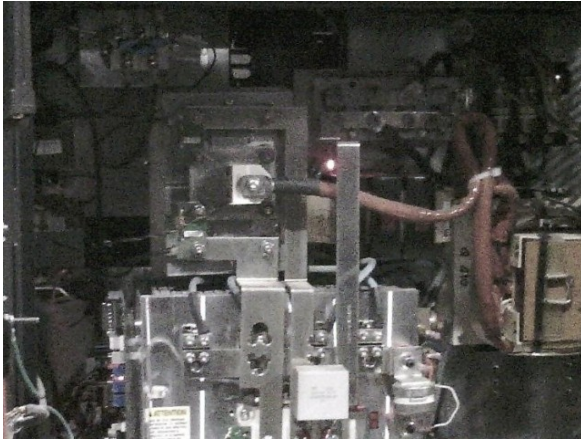

Equipment name : Large Shipping 400

Device name : 1049



Measurement Point : Sanitech Compactor

Status OK

Measurements

Bx1	
Max	112.4 °F
Min	66.7 °F
Area	2.348 ft ²
Dt1	
Bx1.Max	45.7 °F
-Bx1.Min	
Sp1	104.3 °F
Sp2	85.1 °F

Thermogram 237 Created: 5/20/2026 12:39:58 PM

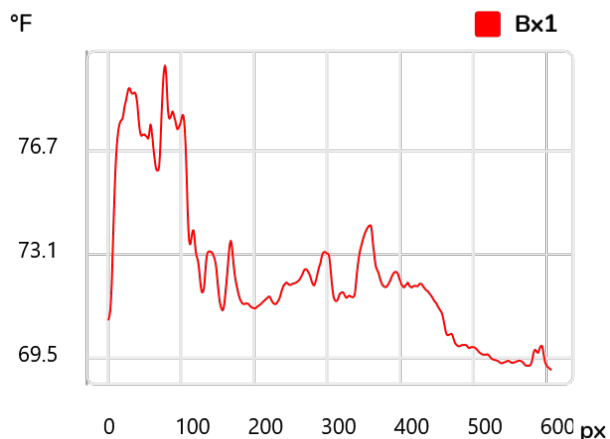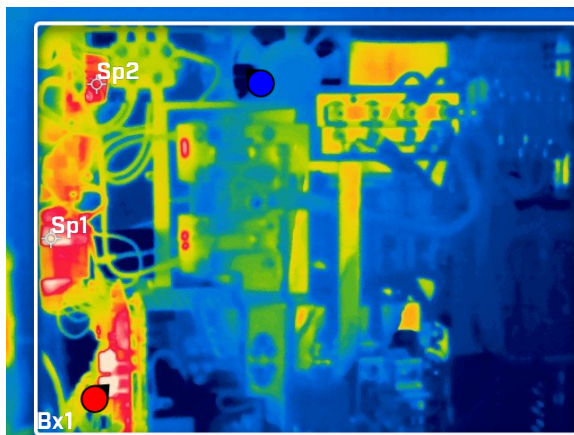

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	4.56 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 246 / 271

Visual Photo





Equipment name : TZ-3
Device name : Transformer
Measurement Point : TZ-3
Status OK

Measurements

Bx1	
Max	122.3 °F
Min	68.5 °F
Area	3.860 ft ²
Dt1	
Bx1.Max	53.9 °F
-Bx1.Min	
Sp1	89.3 °F

Thermogram 238 Created: 5/21/2026 10:29:06 AM

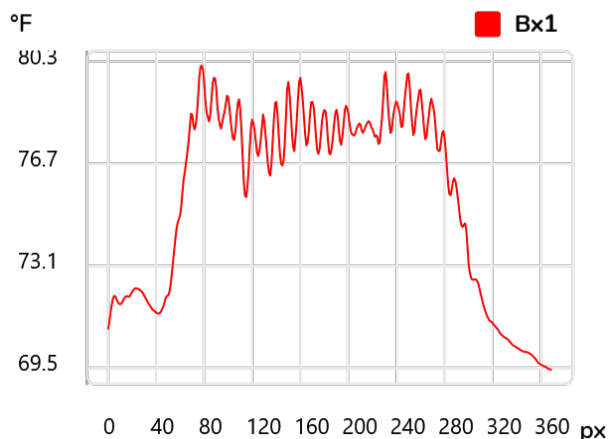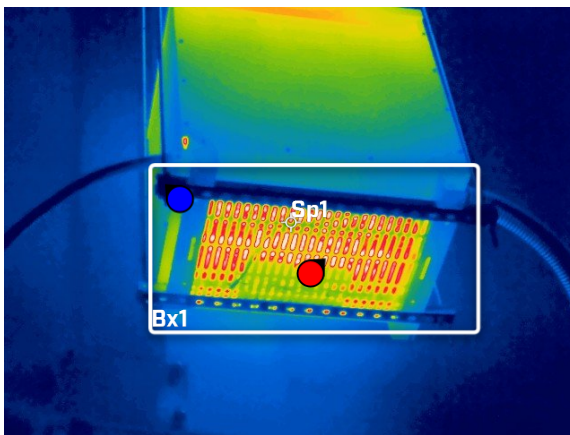

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 11.68 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 247 / 271

Visual Photo


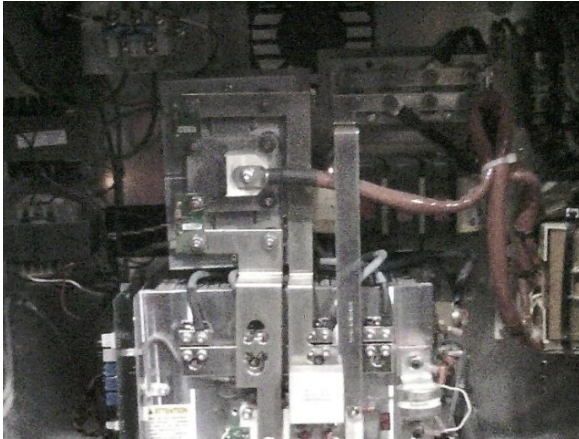


Equipment name : Small Parts Shipping 401

Device name : 1051

Measurement Point : GNB GTC-96ST1
Forklift Charger

Thermogram 239 Created: 5/20/2026 12:42:43 PM

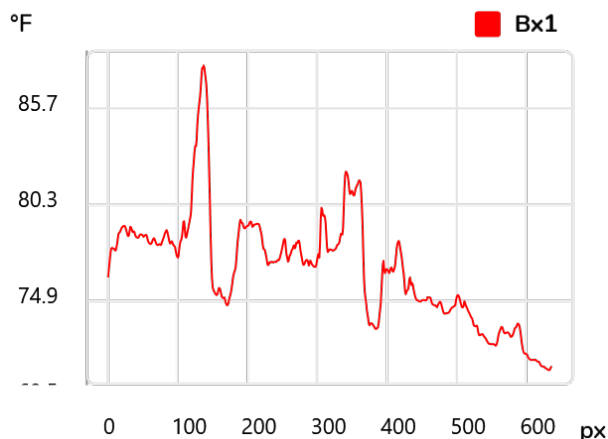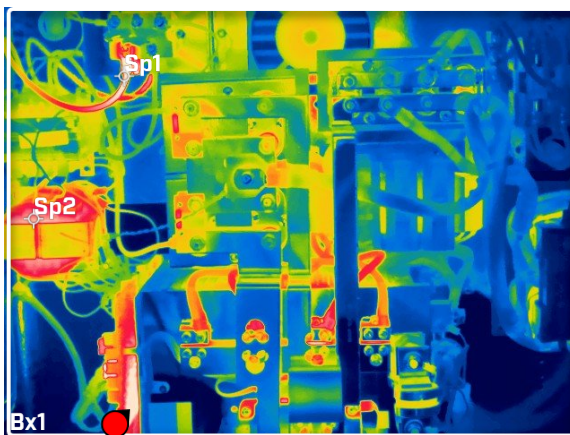

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Measurements

Status	OK
Value	
Bx1	
Max	148.3 °F
Min	68.4 °F
Area	2.132 ft²
Sp1	115.8 °F
Sp2	106.2 °F

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 4.17 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 248 / 271

Visual Photo



Equipment name : Small Parts Shipping 401

Device name : 1054



Measurement Point : Clean Air Humidor

Status OK

Measurements

Value	
Bx1	
Max	81.6 °F
Min	67.9 °F
Area	0.335 ft²
Sp1	79.4 °F
Sp2	79.5 °F

Thermogram 240 Created: 5/20/2026 1:22:21 PM

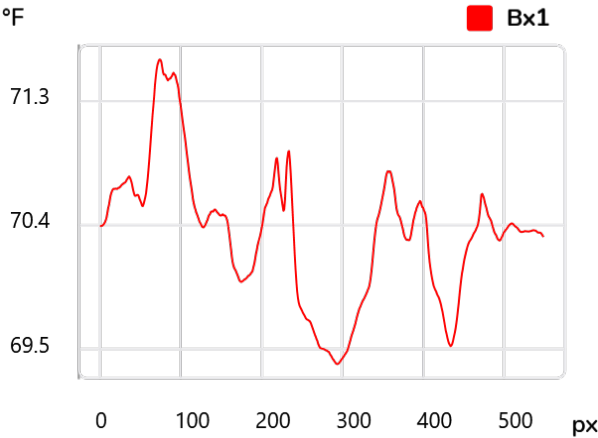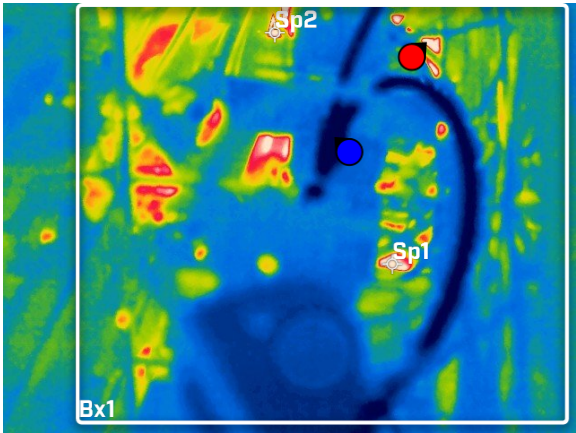

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	1.80 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 249 / 271

Visual Photo



Equipment name : Small Parts Shipping 401

Device name : 1054



Measurement Point : Clean Air Humidor

Status OK

Measurements

Bx1	
Max	84.0 °F
Min	69.8 °F
Area	397.585 ft ²
Dt1	
Bx1.Max	14.2 °F
-Bx1.Min	
Sp1	82.4 °F

Thermogram 241 Created: 5/20/2026 1:40:12 PM

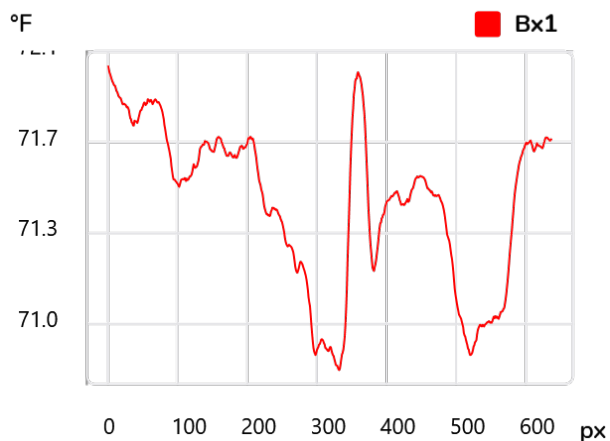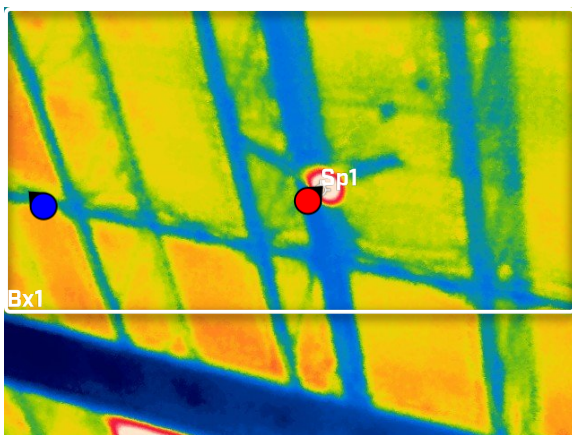

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	67.45 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 250 / 271

Visual Photo



Equipment name : Small Parts Shipping 401

Device name : 1055



Measurement Point : Harmony Cardboard Bailer

Status OK

Measurements

Bx1	
Max	110.8 °F
Min	65.8 °F
Area	3.385 ft ²
Dt1	
Bx1.Max	45.1 °F
-Bx1.Min	
Sp1	109.7 °F

Thermogram 242 Created: 5/20/2026 12:56:21 PM

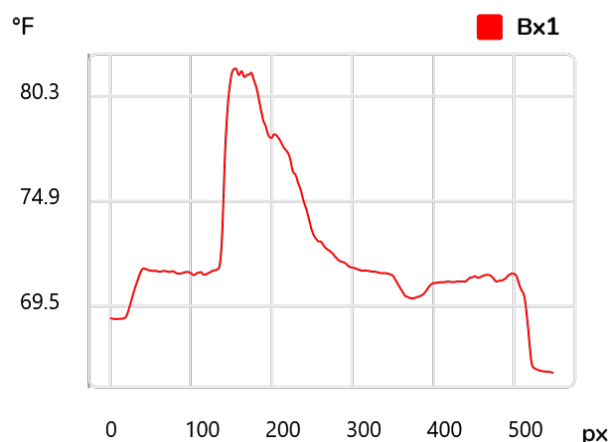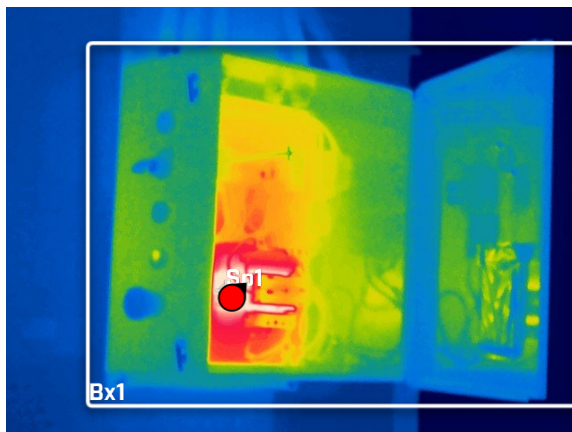

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	6.13 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 251 / 271

Visual Photo



Equipment name : Small Parts Shipping 401

Device name : 1055

Measurement Point : Harmony Cardboard
Bailer

Status OK

Measurements

Value

Bx1

Max 77.0 °F


Min 67.0 °F

Area 4.517 ft²

Sp1 69.5 °F


Thermogram 243

Created: 5/20/2026 12:56:44 PM

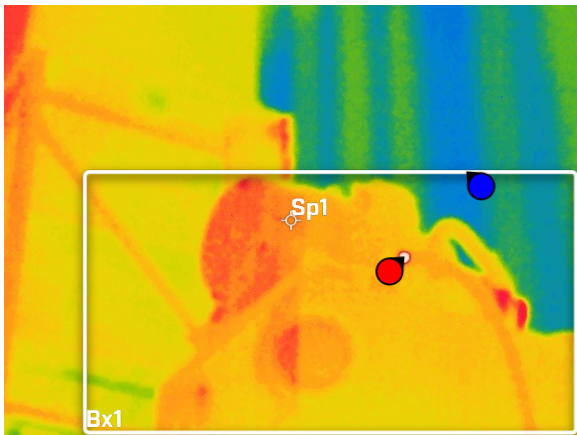

°F

Bx1

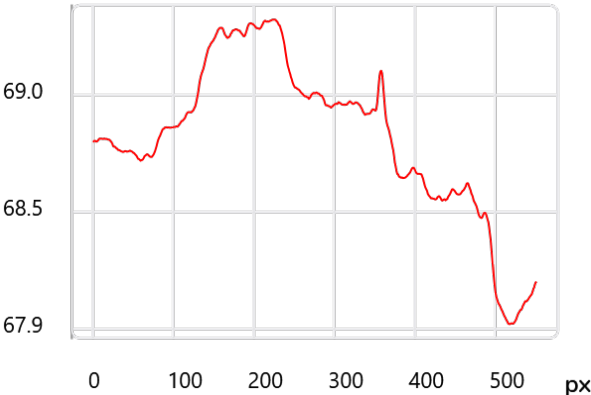

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity 0.95
Distance 8.32 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 252 / 271

Visual Photo





Equipment name : Receiving 501
Device name : 1056
Measurement Point : Douglas Forklift Charger
Status OK

Measurements

Value	
Bx1	
Max	83.5 °F
Min	68.4 °F
Area	0.523 ft²
Sp1	83.1 °F
Sp2	79.0 °F
Sp3	77.8 °F

Thermogram 244 Created: 5/20/2026 1:08:22 PM

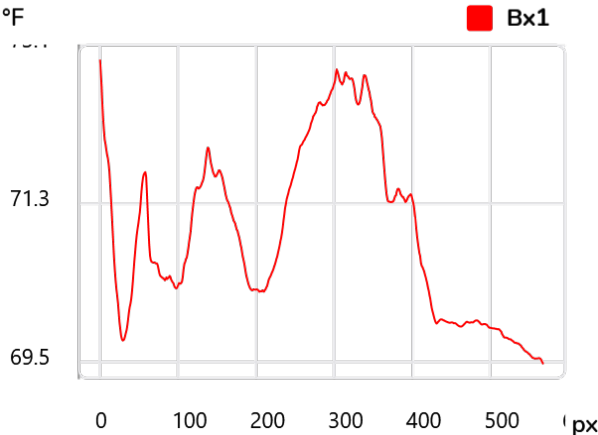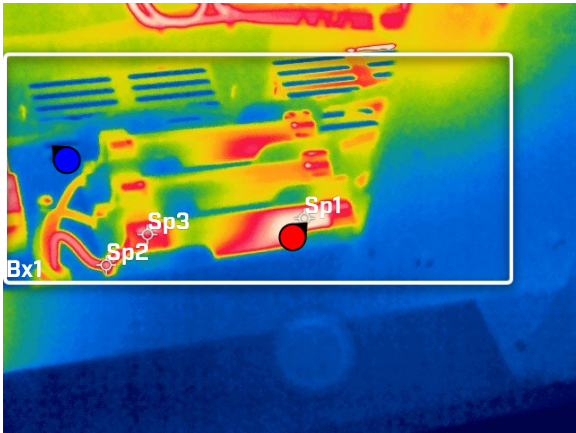

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.98 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 253 / 271

Visual Photo



Equipment name : Receiving 501
Device name : 1056
Measurement Point : Douglas Forklift Charger
Status OK

Measurements



Value

Bx1

Max 99.1 °F
Min 67.5 °F
Area 1.977 ft²
Sp1 94.0 °F
Sp2 81.1 °F
Sp3 93.0 °F

Thermogram 245

Created: 5/20/2026 1:10:21 PM

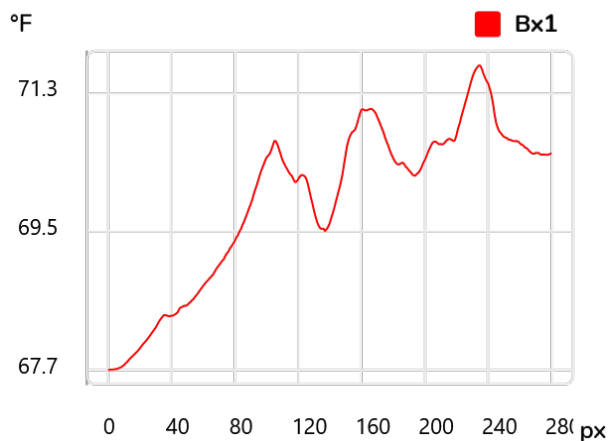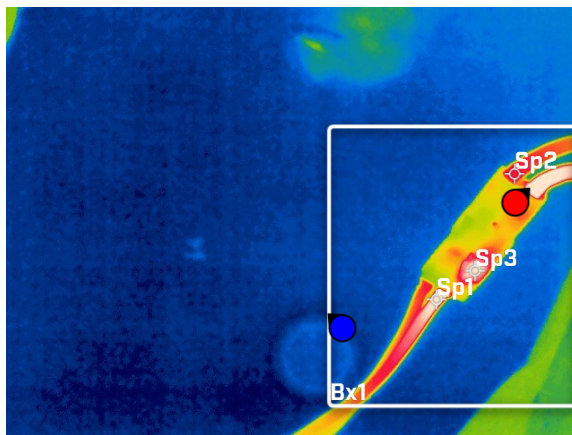

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity 0.95
Distance 7.46 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 254 / 271

Visual Photo

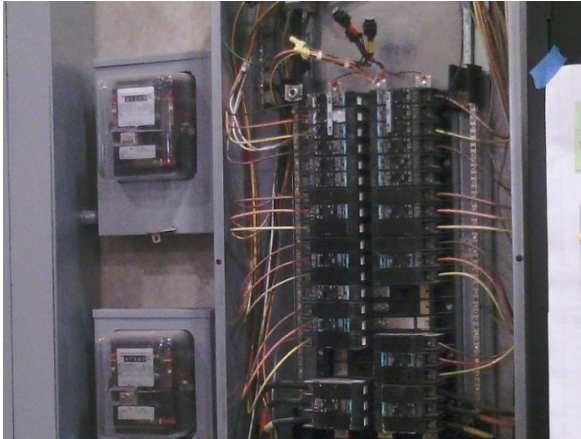

Equipment name : Receiving 501
Device name : 1057
Measurement Point : HP-4
Status Note



Measurements

Value

Bx1

Max 81.2 °F
Min 69.7 °F
Area 3.833 ft²
Sp1 73.7 °F

Thermogram 246 Created: 5/19/2026 1:57:19 PM

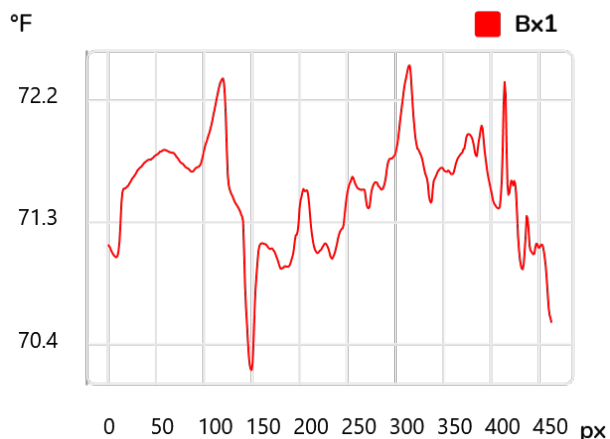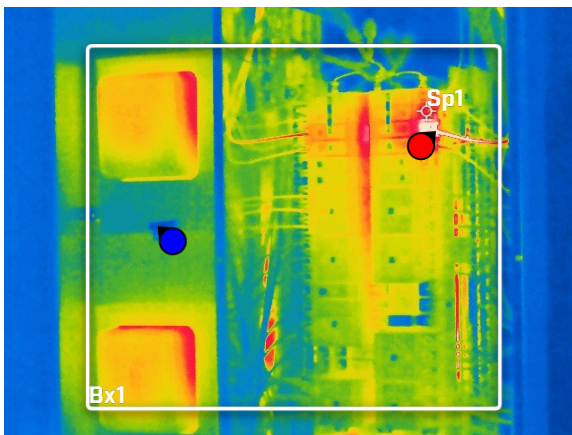

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Perform amp draw
Comment Check connection and amp draw.
Priority 2-Intermediate/Investigate

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 7.10 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 255 / 271

Visual Photo

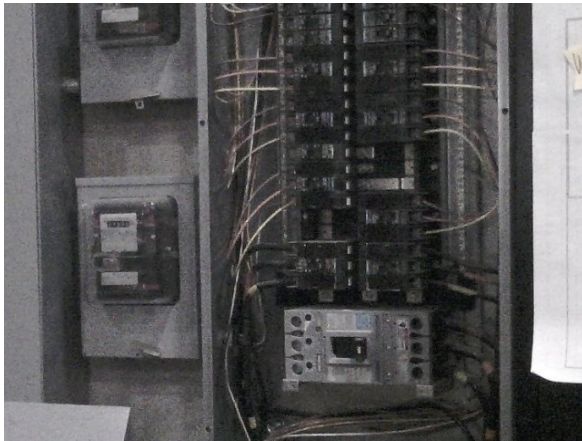

Equipment name : Receiving 501
Device name : 1057
Measurement Point : HP-4
Status Note



Measurements

Value

Bx1

Max 77.9 °F
Min 70.2 °F
Area 3.570 ft²
Sp1 70.7 °F

Thermogram 247 Created: 5/19/2026 2:04:02 PM

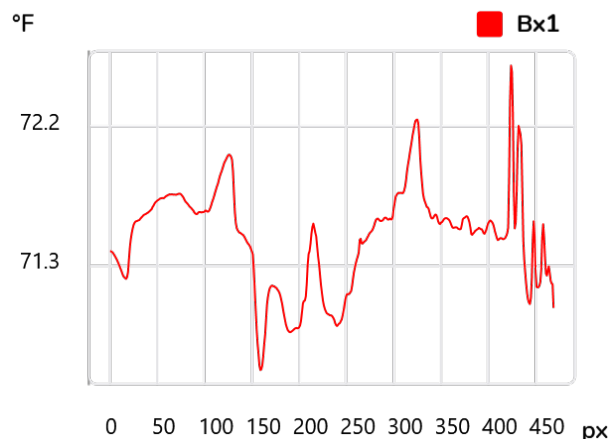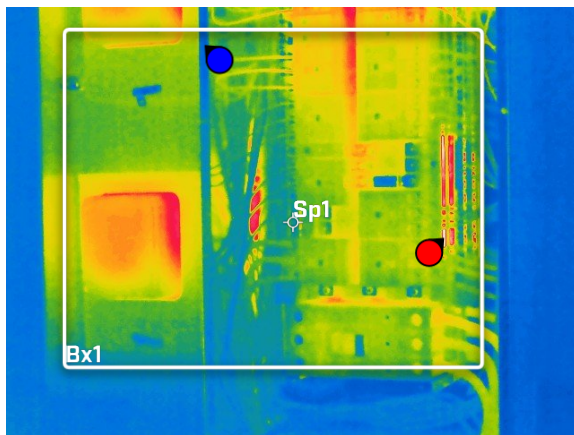

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue Dirty/corroded connection(s)
Recommended Action Perform amp draw
Comment Check connection and amp draw.
Priority 2-Intermediate/Investigate

Parameters


Emissivity 0.95
Distance 7.06 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 256 / 271

Visual Photo


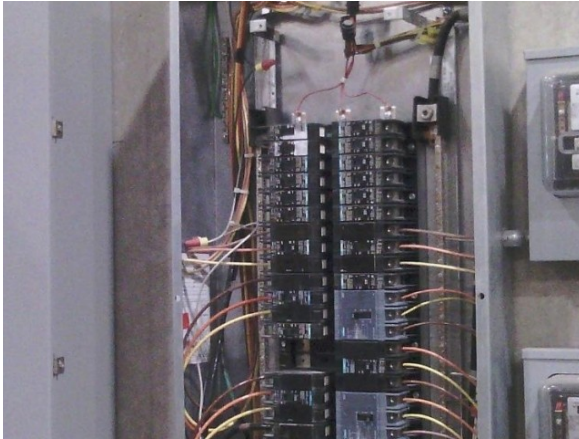


Equipment name : Receiving 501
Device name : 1058
Measurement Point : HP-3
Status OK

Measurements

Bx1	
Max	73.8 °F
Min	70.2 °F
Area	2.561 ft ²
Dt1	
Bx1.Max	3.6 °F
-Bx1.Min	
Sp1	73.6 °F

Thermogram 248 Created: 5/19/2026 2:13:44 PM

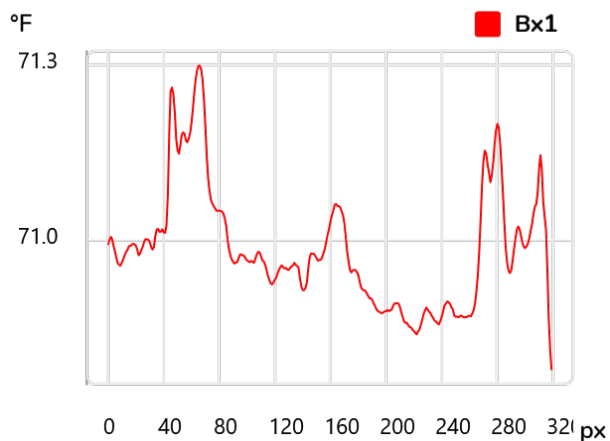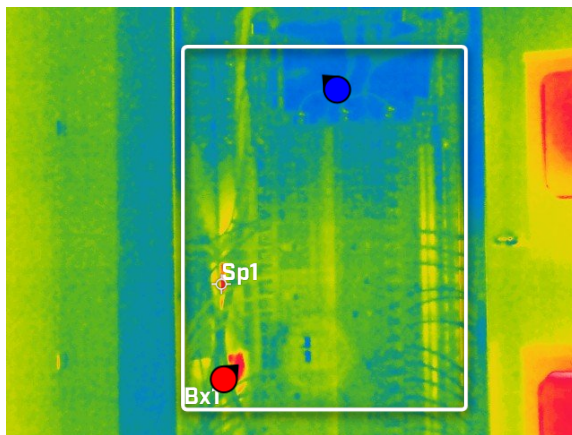

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	6.99 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 257 / 271

Visual Photo


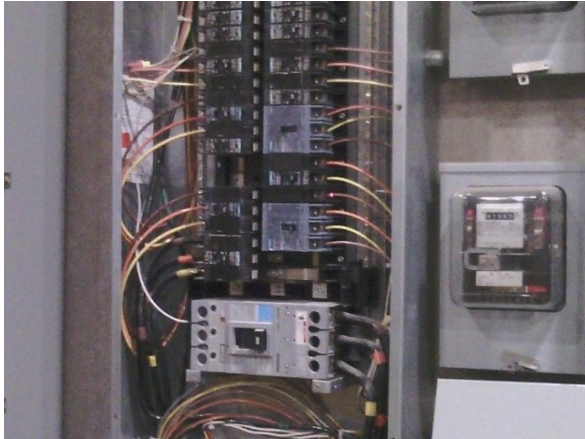


Equipment name : Receiving 501
Device name : 1058
Measurement Point : HP-3
Status OK

Measurements

Bx1	
Max	73.9 °F
Min	70.3 °F
Area	3.341 ft²
Dt1	
Bx1.Max	3.6 °F
-Bx1.Min	
Sp1	70.9 °F

Thermogram 249 Created: 5/19/2026 2:14:21 PM

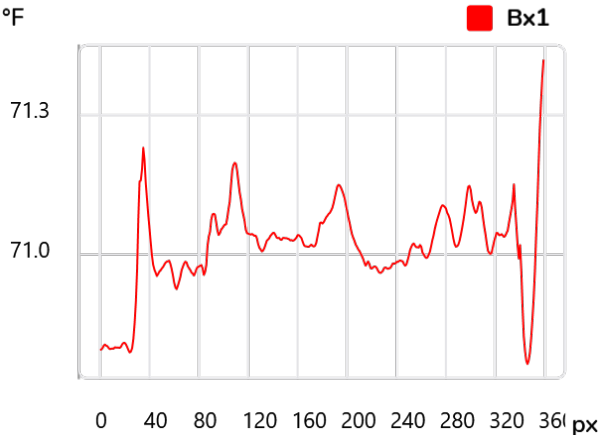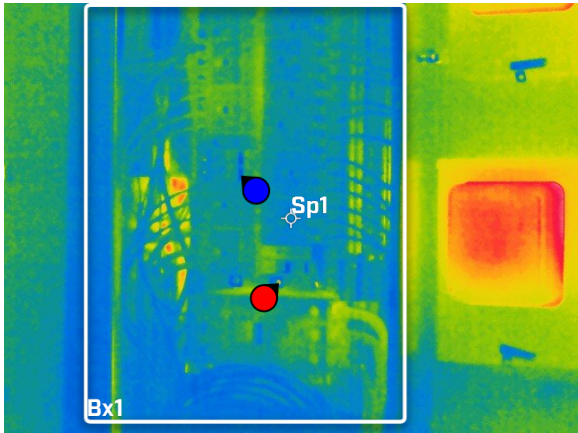

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters


Emissivity	0.95
Distance	7.03 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 258 / 271

Visual Photo


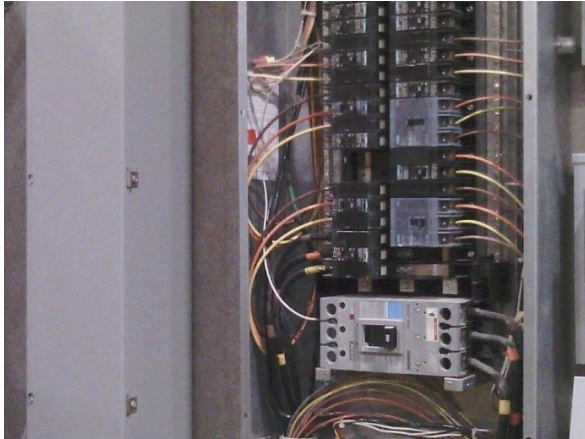


Equipment name : Receiving 501
Device name : 1058
Measurement Point : HP-3
Status OK

Measurements

Bx1	
Max	73.9 °F
Min	70.2 °F
Area	2.796 ft²
Dt1	
Bx1.Max	3.7 °F
-Bx1.Min	
Sp1	72.0 °F

Thermogram 250 Created: 5/19/2026 2:14:52 PM

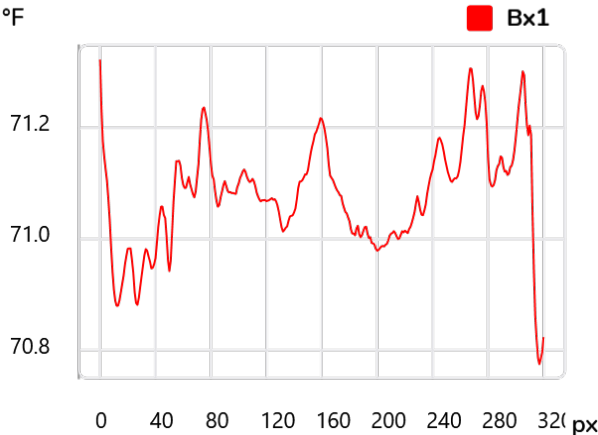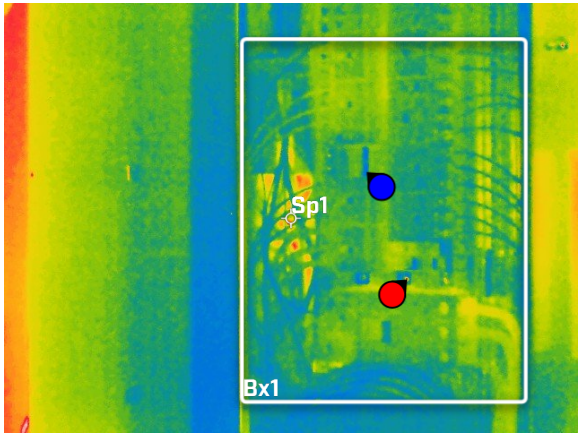

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 7.29 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 259 / 271

Visual Photo





Equipment name : Receiving 501
Device name : 1059
Measurement Point : V48M28T75S
Transformer (TOP)

Status OK

Measurements

Bx1	
Max	92.4 °F
Min	70.2 °F
Area	4.525 ft²
Dt1	
Bx1.Max	22.2 °F
-Bx1.Min	
Sp1	87.7 °F

Thermogram 251 Created: 5/19/2026 2:23:47 PM

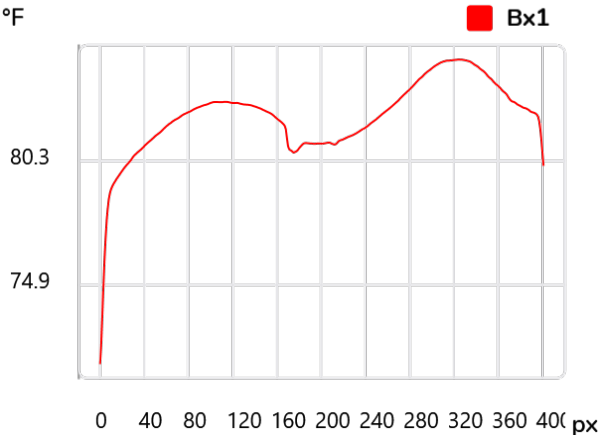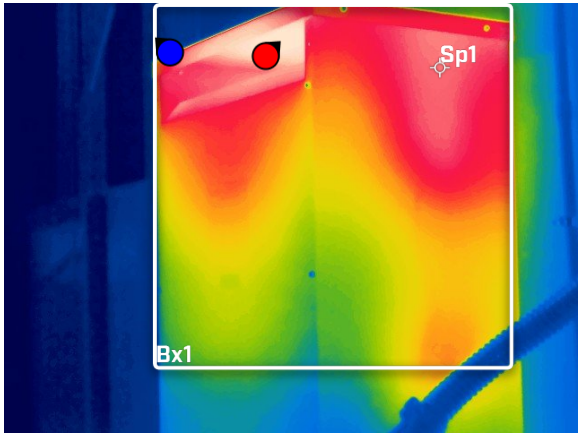

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	8.29 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection



Report 1654-000
Date 6/12/2026
Page 260 / 271

Visual Photo



Equipment name : Receiving 501
Device name : 1060
Measurement Point : V48M28T75S
Transformer
(BOTTOM)

Thermogram 252 Created: 5/19/2026 2:24:37 PM

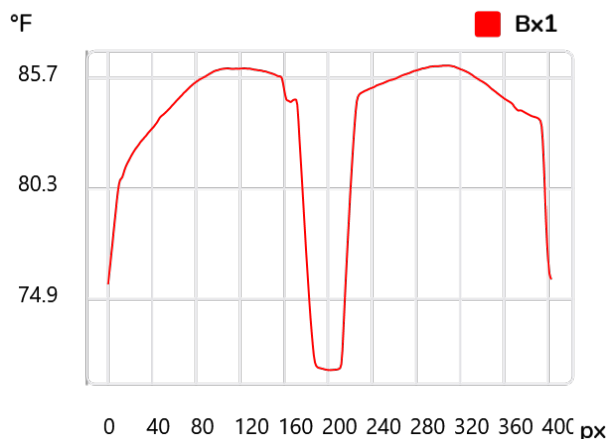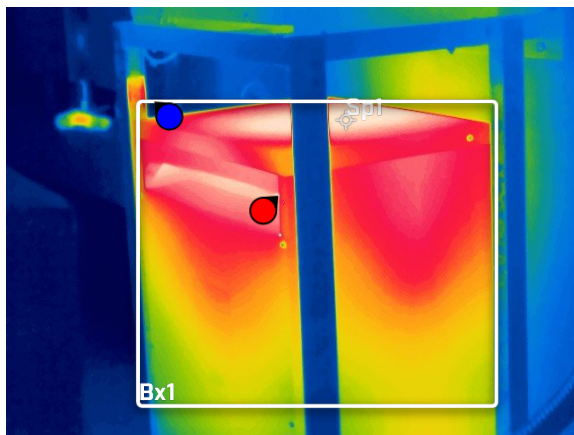

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Status MeasurementsOK

Bx1
Max 103.5 °F
Min 70.4 °F
Area 3.840 ft²
Dt1
Bx1.Max 33.1 °F
-Bx1.Min
Sp1 95.2 °F

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity 0.95
Distance 8.31 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 261 / 271

Visual Photo


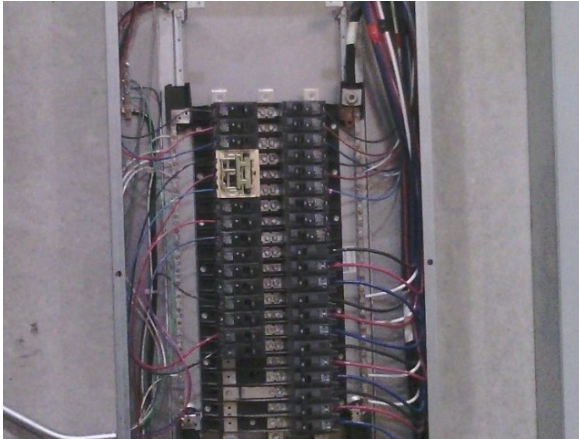


Equipment name : Receiving 501
Device name : 1061
Measurement Point : LP-1
Status OK

Measurements

Bx1	
Max	76.2 °F
Min	69.6 °F
Area	2.845 ft ²
Dt1	
Bx1.Max	6.6 °F
-Bx1.Min	
Sp1	70.1 °F

Thermogram 253 Created: 5/19/2026 2:33:03 PM

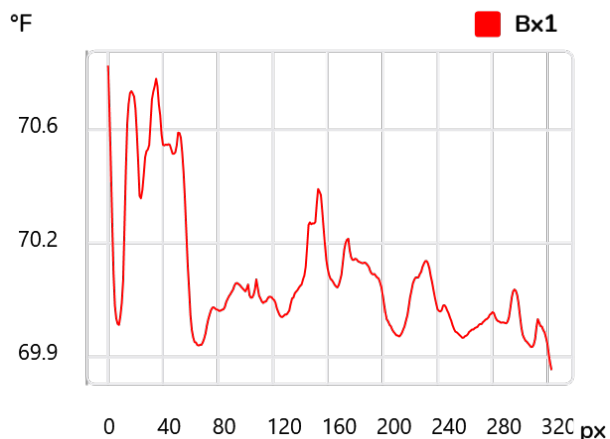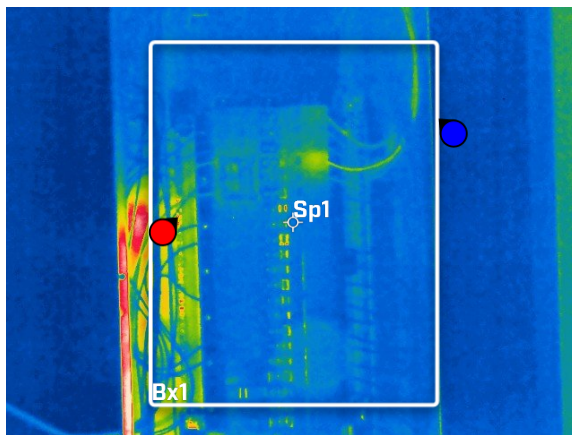

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	7.32 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 262 / 271

Visual Photo


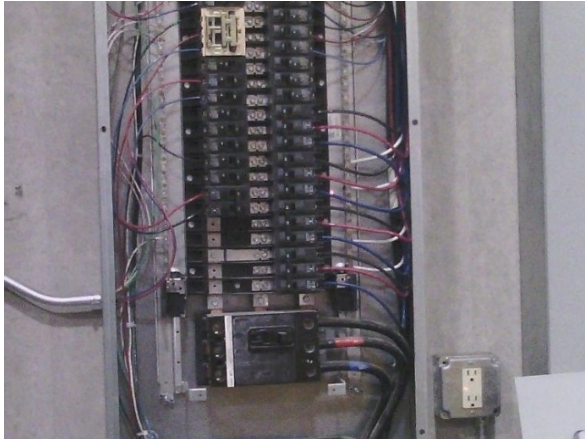


Equipment name : Receiving 501
Device name : 1061
Measurement Point : LP-1
Status OK

Measurements

Bx1	
Max	77.3 °F
Min	69.3 °F
Area	4.163 ft ²
Dt1	
Bx1.Max	8.0 °F
-Bx1.Min	
Sp1	75.7 °F

Thermogram 254 Created: 5/19/2026 2:33:30 PM

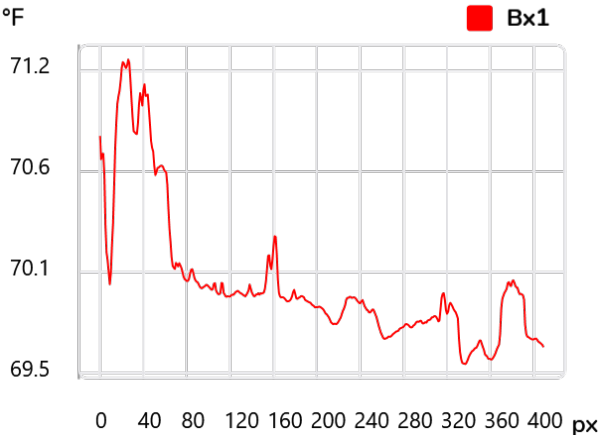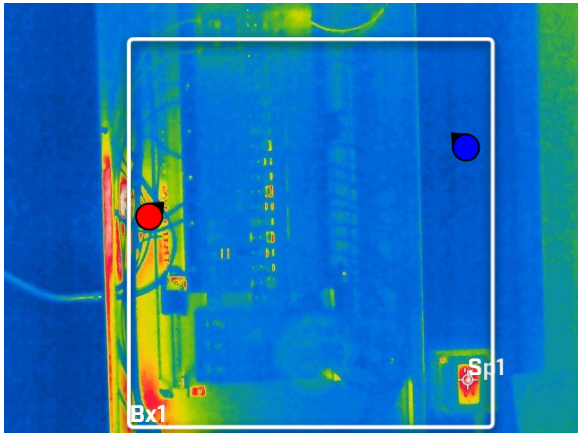

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Parameters

Emissivity	0.95
Distance	7.62 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 263 / 271

Visual Photo





Equipment name : Receiving 501
Device name : 1062
Measurement Point : LP-2
Status OK

Measurements

Bx1	
Max	79.3 °F
Min	69.1 °F
Area	7.127 ft ²
Dt1	
Bx1.Max	10.2 °F
-Bx1.Min	
Sp1	74.8 °F
Sp2	74.7 °F

Thermogram 255 Created: 5/19/2026 2:49:43 PM

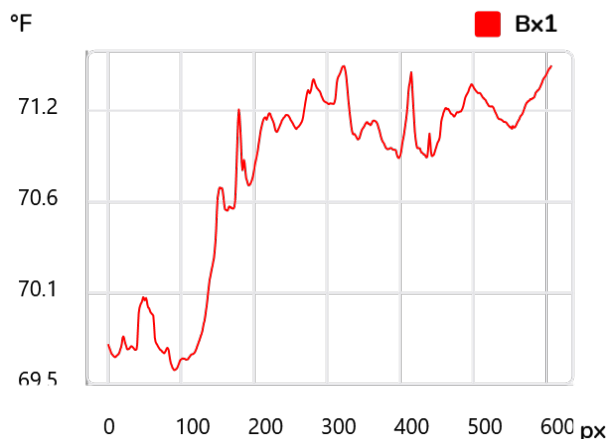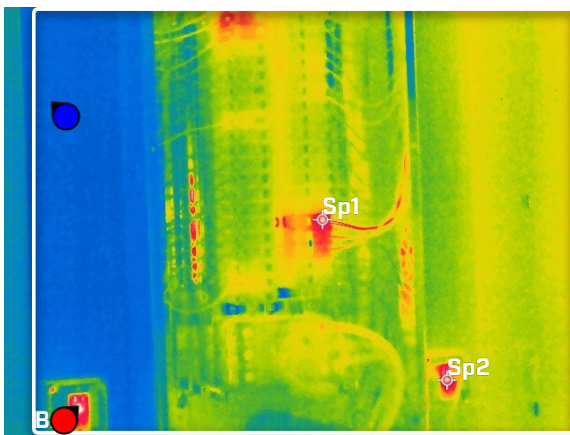

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters


Emissivity	0.95
Distance	7.83 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 264 / 271

Visual Photo


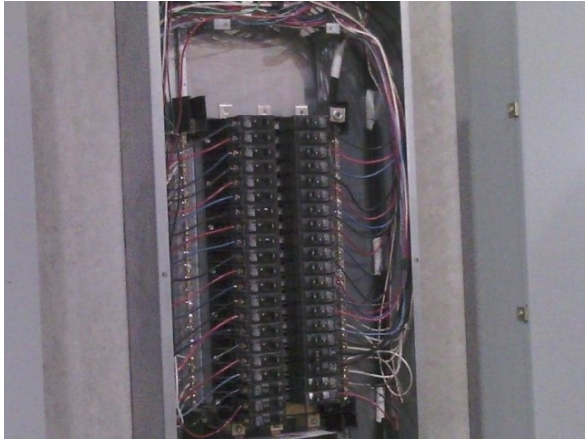


Equipment name : Receiving 501
Device name : 1062
Measurement Point : LP-2
Status OK

Measurements

Bx1	
Max	75.6 °F
Min	69.7 °F
Area	3.687 ft ²
Dt1	
Bx1.Max	6.0 °F
-Bx1.Min	
Sp1	74.0 °F

Thermogram 256 Created: 5/19/2026 2:53:25 PM

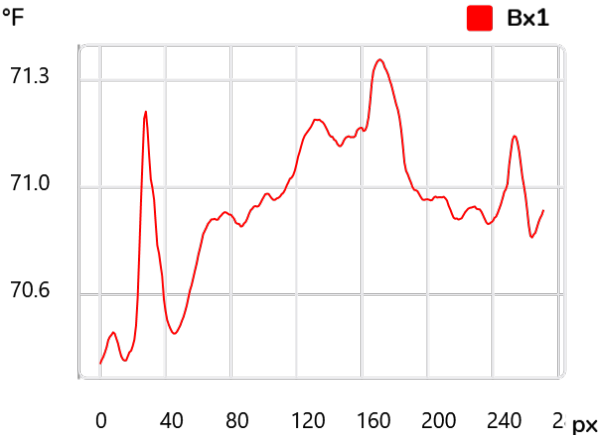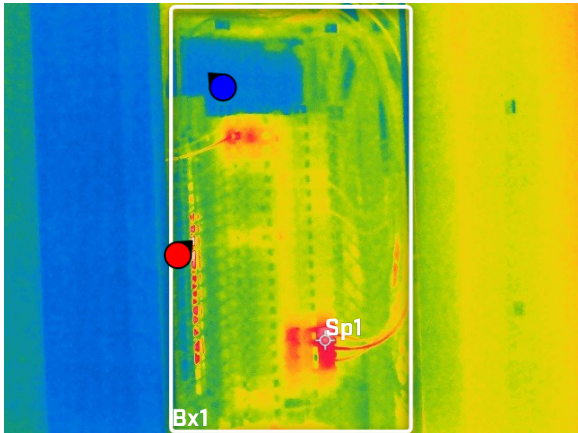

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Parameters

Emissivity 0.95
Distance 8.41 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 265 / 271

Visual Photo





Equipment name : Receiving 501
Device name : 1063
Measurement Point : LV-4
Status OK

Measurements

Value	
Bx1	
Max	93.2 °F
Min	78.6 °F
Area	0.396 ft²
Sp1	90.9 °F
Sp2	90.9 °F

Thermogram 257 Created: 5/21/2026 1:18:22 PM

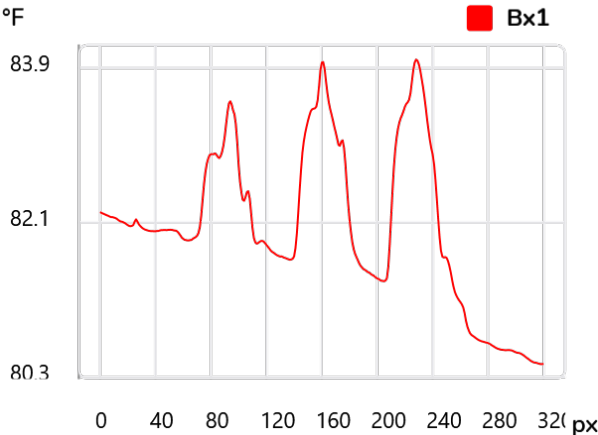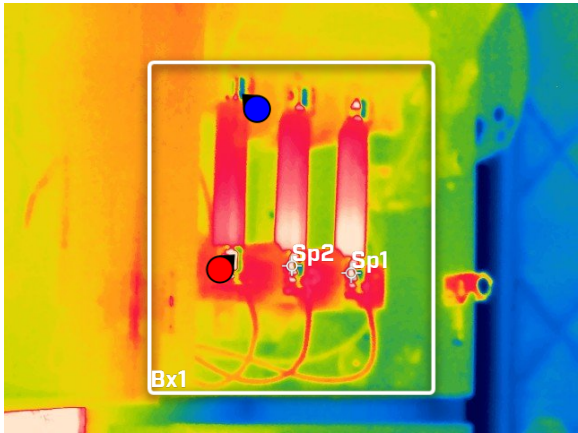

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 2.88 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 266 / 271

Visual Photo


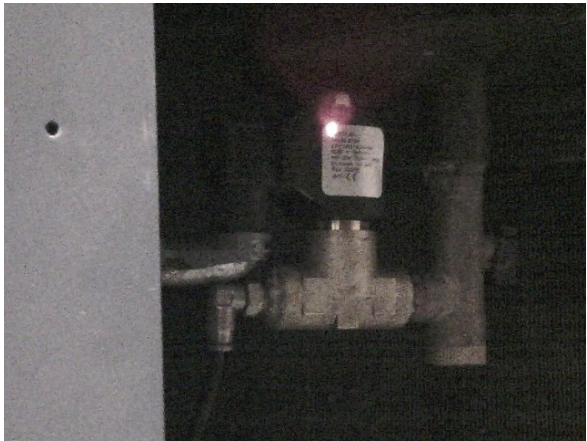


Equipment name : Receiving 501
Device name : 1063
Measurement Point : LV-4
Status OK

Measurements

Bx1	
Max	86.6 °F
Min	49.9 °F
Area	0.258 ft²
Dt1	
Bx1.Max	36.7 °F
-Bx1.Min	
Sp1	85.8 °F

Thermogram 258 Created: 5/21/2026 1:19:46 PM

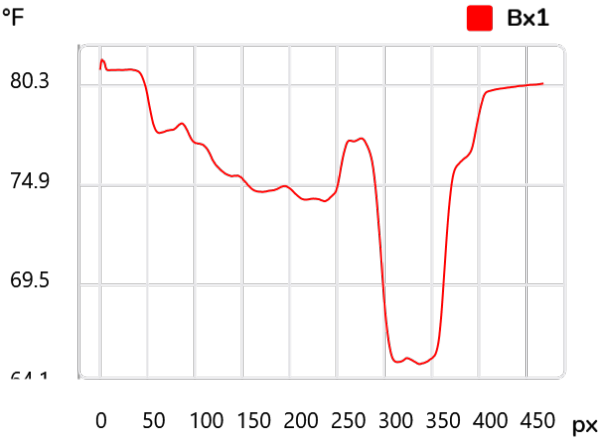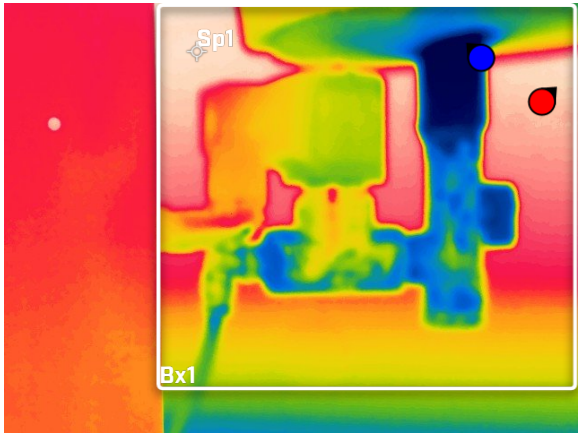

Text Annotations

Issue No Issue - Normal operation
Recommended Action No action recommended at this time
Comment No additional comments.
Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters


Emissivity 0.95
Distance 1.79 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 267 / 271

Visual Photo


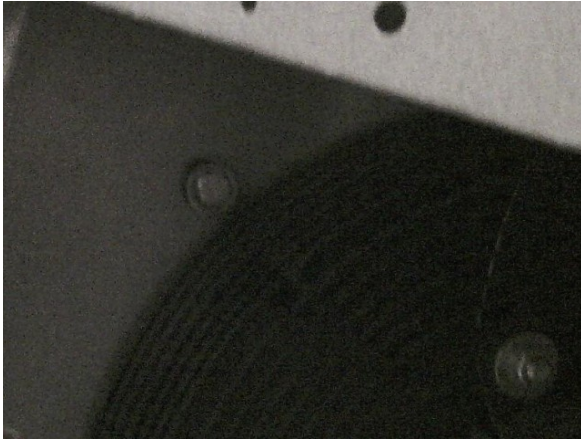


Equipment name : Receiving 501
Device name : 1063
Measurement Point : LV-4
Status OK

Measurements

Bx1	
Max	110.7 °F
Min	76.5 °F
Area	0.053 ft ²
Dt1	
Bx1.Max	34.2 °F
-Bx1.Min	
Sp1	88.8 °F

Thermogram 259 Created: 5/21/2026 1:21:43 PM

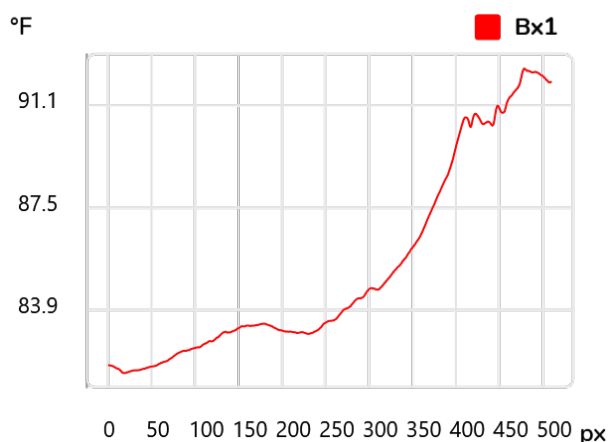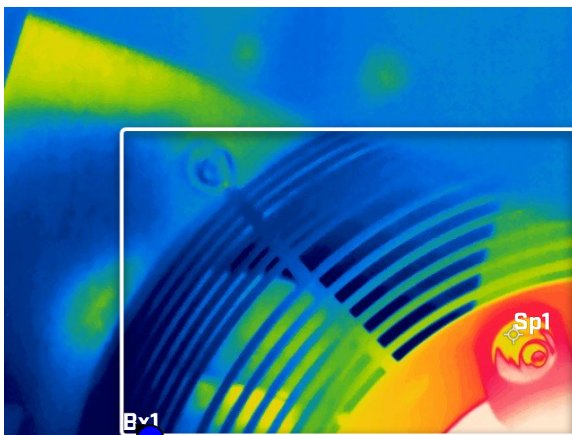

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	0.86 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 268 / 271

Visual Photo



Equipment name : Engineering Lab 625

Device name : 1064



Measurement Point : SEHV-1

Status OK

Measurements

Bx1	
Max	75.6 °F
Min	71.1 °F
Area	1.488 ft ²
Dt1	
Bx1.Max	4.5 °F
-Bx1.Min	
Sp1	71.5 °F

Thermogram 260 Created: 5/20/2026 10:10:35 AM

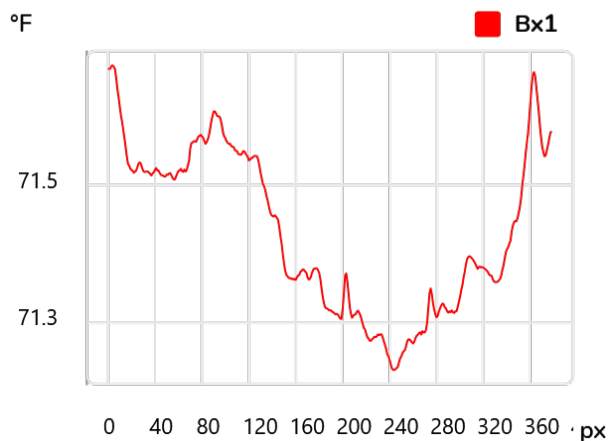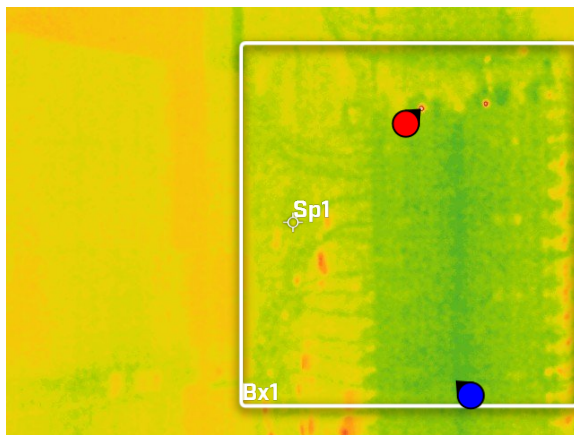

Camera information

Camera model	FLIR E96
Lens	FOL18
Camera serial	90206013

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Parameters

Emissivity	0.95
Distance	4.90 ft
Atmospheric temp.	68.0 °F
Relative humidity	50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 269 / 271

Visual Photo



Equipment name : Engineering Lab 625

Device name : 1064


Measurement Point : SEHV-1

Status OK

Measurements

Bx1	
Max	80.5 °F
Min	71.2 °F
Area	1.164 ft ²
Dt1	
Bx1.Max	9.4 °F
-Bx1.Min	
Sp1	71.4 °F

Thermogram 261 Created: 5/20/2026 10:11:35 AM

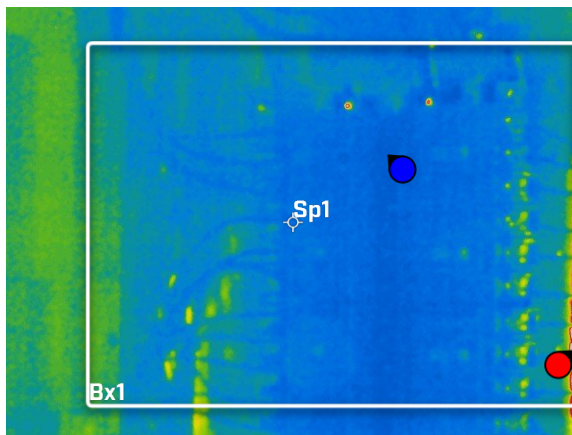

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 3.59 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



Retrofit Electric - Thermal Electrical Inspection

Report 1654-000
Date 6/12/2026
Page 270 / 271

Visual Photo



Equipment name : Engineering Lab 625

Device name : 1064

Measurement Point : SEHV-1

Status OK

Measurements

Value

Bx1



Max 74.9 °F

Min 71.1 °F

Area 0.585 ft²

Sp1 73.9 °F

Thermogram 262 Created: 5/20/2026 10:12:12 AM

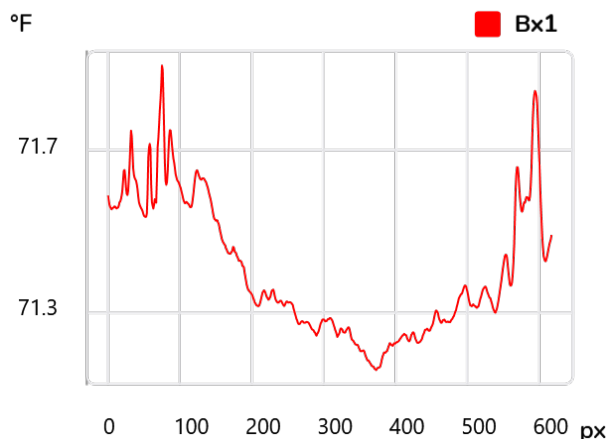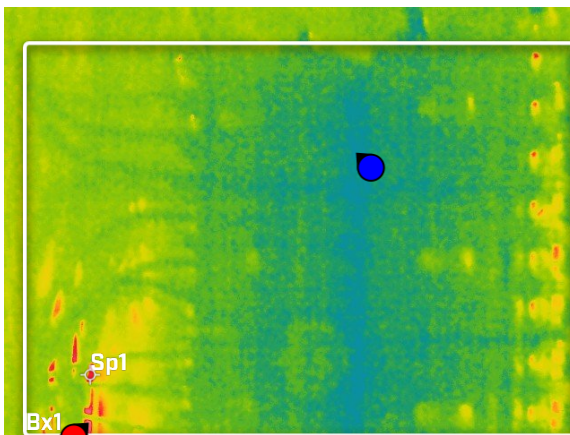

Text Annotations

Issue No Issue - Normal operation

Recommended Action No action recommended at this time

Comment No additional comments.

Priority None

Camera information

Camera model FLIR E96
Lens FOL18
Camera serial 90206013

Parameters

Emissivity 0.95
Distance 2.31 ft
Atmospheric temp. 68.0 °F
Relative humidity 50.0%



CERTIFIED ISO 9001 IN THE TRAINING, EDUCATION, AND CERTIFICATION OF PROFESSIONAL USERS OF THERMAL INFRARED SYSTEMS.

Certification #:

244085569

LEVEL I / CATEGORY I

CERTIFIED THERMOGRAPHER


THIS CERTIFIES THAT

Gary Johnson

**HAS ATTENDED THE COURSE AND PASSED THE PRACTICAL AND FINAL EXAMS THUS
MEETING THE REQUIREMENTS FOR INFRARED TRAINING CENTER CERTIFICATION**

ISSUE DATE: 03/13/2026

EXPIRATION DATE: 03/13/2031


Responsible Level III

Infrared Training Center
www.infraredtraining.com

**24 ITC CERTIFICATION
RENEWAL CREDITS**

© Infrared Training Center. All rights reserved including the right of reproduction in whole or in part in any form.



Gary Johnson

Certification #: 244085569

Completed: 03/13/2026

Expires: 03/13/2031




Calibration certificate

Model: FLIR E96 24°

Serial No.: 90206013

Site: FLIR Systems OÜ, Estonia

Date: 2026-04-02

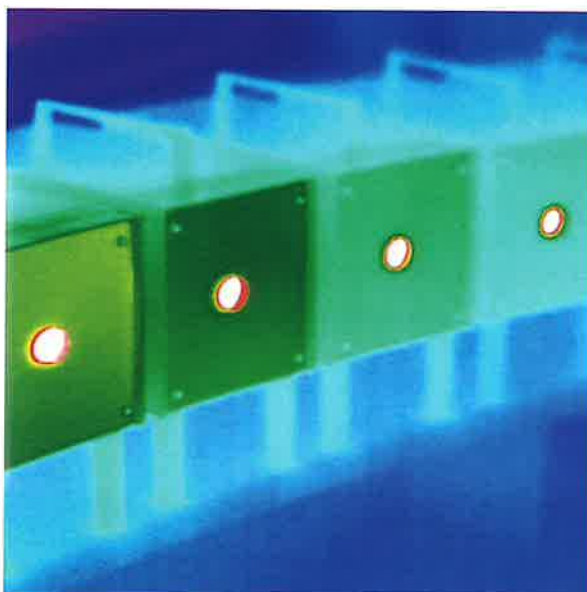



This is to certify that the calibration of the camera identified on the reverse side of this card is carried out using radiation sources that are traceable to National Standards at RISE, Research Institutes of Sweden, or to NIST, National Institute of Standards and Technology (USA).

Quality control

A handwritten signature in blue ink, appearing to be "M", written over a horizontal line.



1558507

FLIR Systems AB
P.O. Box 7376
SE-187 15 Täby
Sweden

Telephone: +46 8 753 25 00
Telefax: +46 8 753 23 64

<http://www.flir.com>
<http://support.flir.com>

PN: 1558507-J